

Prepared for:

Montana Department of Transportation
2701 Prospect Avenue
PO Box 201001
Helena, MT 59620-1001



Prepared by:

Confluence Consulting Inc.
1289 Stoneridge Drive
Bozeman, MT 59718



PAGE INTENTIONALLY LEFT BLANK

Table of Contents

1.0 INTRODUCTION.....	1
1.1 Detailed Project Description and Location.....	1
1.2 Ecological Setting and General Area Description.....	2
1.2.1 Land Cover.....	2
1.2.2 Ecoregion	2
2.0 WATERWAYS	2
2.1 Methods	3
2.1.1 Agency Coordination/Consultation.....	3
2.1.2 Literature/Database Searches	3
2.1.3 Field Survey Protocol	3
2.2 Site Description/Stream Morphology	3
2.2.1 Stone Creek (NWW-01)	4
2.2.2 Unnamed Spring Creek Tributary to the Beaverhead River (W-03/NWW-02)	5
2.2.3 Beaverhead River (NWW-03)	7
2.2.4 Co-op Ditch (IR-01)	8
2.2.5 Warm Springs Ditch (IR-02)	8
2.3 Total Maximum Daily Load (TMDL) Listing 303(d)	8
2.4 Potential Impacts.....	9
2.4.1 Potential Impacts at Stone Creek (NWW-01)	9
2.4.2 Potential Impacts at the Unnamed Spring Creek (NWW-02).....	9
2.4.3 Potential Impacts at the Beaverhead River (NWW-03)	9
2.5 Avoidance and Minimization Recommendations	10
2.6 Permitting Required.....	10
2.7 Stream Mitigation Requirements	11
2.7.1 Exemptions.....	11
2.7.2 Baseline Stream Factors.....	11
2.7.3 Credit Factors.....	12
3.0 GENERAL AQUATIC SPECIES.....	13
3.1 Methods	13
3.1.1 Agency Coordination/Consultation.....	13
3.1.2 Literature/Database Searches	13
3.1.3 Field Survey Protocol	13
3.2 Species Documented	14
3.3 Potential Impacts.....	15
3.3.1 Potential Impacts at Stone Creek (NWW-01)	15
3.3.2 Potential Impacts at the Unnamed Spring Creek (NWW-02).....	15
3.3.3 Potential Impacts at the Beaverhead River (NWW-03)	16
3.4 Avoidance and Minimization Recommendations	16
4.0 WETLANDS.....	17
4.1 Methods	17
4.1.1 Agency Coordination/Consultation.....	17

4.1.2 Literature/Database Searches	17
4.1.3 Field Survey Protocol/Wetland Delineation Methods.....	17
4.2 Description of Delineated Wetlands	20
4.2.1 Functional Assessment.....	24
4.2.2 Fens	24
4.3 Potential Impacts.....	26
4.4 Avoidance and Minimization Recommendations	27
4.5 Required Permitting.....	27
4.6 Proposed Compensatory Wetland Mitigation Strategy	27
5.0 REFERENCES.....	28

Appendices

Appendix A	Figures
Appendix B	Data Forms
Appendix C	Photographs

1.0 INTRODUCTION

The purpose of the Stone Creek-North project is to reconstruct this location to address horizontal and vertical alignments as well as shoulder widths and replace two deficient structures. The proposed project will reconstruct a portion of National Highway route N-49 (Montana 41) from RP 9.0 to RP 16.3 to provide geometric improvements, shoulder widening, and structure replacements at Stone Creek and the Beaverhead River. The horizontal alignment will be shifted up to approximately 450 feet east of the existing centerline from the Beaverhead River bridge north through approximately 3500 feet shy of the north end of the project limits.

The original aquatic resource delineation and Biological Resources Report/Preliminary Biological Assessment was completed by Confluence Consulting, Inc. in October 2013. Additional aquatic resource verification and delineation, fen identification and delineation, and sensitive plant surveys were assigned to Confluence Consulting by addendums between 2015 and 2017. This report combines and updates these previous reports to provide all of the relevant aquatic resource information in one comprehensive report; including information on waterways, wetlands and fens that have been documented in the project area.

1.1 Detailed Project Description and Location

The project occurs in Beaverhead and Madison Counties, on MT Highway Route 41, which connects the town of Twin Bridges and the City of Dillon. The project begins at Reference Post (RP) 9.0± just south of Stone Creek Bridge and extends north to RM 16.3± approximately 1.7 miles north of the Beaverhead River Bridge (Figure 1). The project is approximately 7.3 ± miles in length. The geographic coordinates of the existing bridge over the Beaverhead River are: 45.383488°, -112.453164°. The linear project area bisects nine sections within three ranges and two townships, including T6S R8W S12, T6S R7W S5 and S6, and T5S R7W S15, S22, S27, S28, S32, and S33. Project limits on either side of the highway vary along its length, as described below:

- Two hundred feet east and west perpendicular from existing centerline from RP 9.0 (beginning of project to approximate RP 14.3 (south side of East Bench Road).
- Five hundred feet east and 200 feet west perpendicular from existing centerline from approximate RP 14.3 (south side of East Bench Road) to approximate RP 15.7.
 - Extend project area 500 feet from existing centerline and approximately 100 feet north and south of East Bench Road intersection with mainline.
 - Extend project area 500 feet west from existing centerline along proposed alignment of Beaverhead Rock Road as shown on the plans in this area, between approximate RP 14.9 (in-line with irrigation structure on Beaverhead Rock Road south of current intersection) to north of current intersection (approximate RP 15.1).
 - Extend project area 500 feet east and 200 feet west perpendicular from existing centerline from approximate RP 15.3 to approximate RP 15.7.
- Two hundred feet east and west perpendicular from existing centerline from approximate RP 15.7 to approximate RP 16.4 (just past end of project).

- Perform OHWM delineation at Stone Creek 300 feet up and downstream of existing mainline crossing.
- Perform new OHWM delineation at Beaverhead River 500 feet upstream and 1500 feet downstream of existing mainline crossing.
- Project area extends 300 feet from existing centerline and approximately 100 feet north and south of all approaches (private and public) to mainline.

The study area can be found on the Beaverhead Rock, Beaverhead Rock SW, and Glen SE 7.5-minute U.S. Geological Survey (USGS) topographic maps. The southern portion of the project area lies within the Stone Creek Hydrologic Unit Code (HUC 100200020605); the majority of the project area is located in the Beaverhead River-Charlton Slough sub-watershed (HUC100200020703); and the northern-most portion of the project area is located in the Beaverhead River-Big Dry Gulch sub-watershed (HUC 100200020705).

1.2 Ecological Setting and General Area Description

1.2.1 Land Cover

The terrain in the project area is dry rolling hills that generally drains from south to north. The main drainage within the project area is the Beaverhead River, and is considered perennial. Six ephemeral/intermittent streams were identified within the study area on the USGS topographic maps and included Stone Creek and five unnamed drainages. Two bridges are present within the project limits; the first is at Stone Creek at RP 9.0, and the second is at the Beaverhead River at RP 14.67.

1.2.2 Ecoregion

The project area occurs in the Dry Intermontane Sagebrush Valleys of the Middle Rockies Ecoregion (Woods et al. 2002). The terrain is rolling hills from Stone Creek (RP 9.0) to approximately RP 14.34 where the road drops into the Beaverhead River valley and routes across level terrain to the northern extent of the project area (Figure 2). In the southern portion of the project area land cover includes sub-humid grassland and semiarid grazing land, while the northern portion of the project area is irrigated land.

The nearest weather station is the Dillon Airport (Coop # 242404-2). Based on weather data collected between 1948 and 2023 the typical growing season is about 129 days long; extending from May 16th to September 22nd (WRCC 2023).

2.0 WATERWAYS

The term non-wetland waterway (NWW) is a jurisdiction-neutral term used by Confluence to identify channels that have been scoured of vegetation below an ordinary high-water mark (OHWM), or exhibit a drainage pattern (water conveyance channel). Non-wetland waterway channels occur in rivers, streams (perennial, intermittent or ephemeral), canals, ditches, and overflow channels.

2.1 Methods

2.1.1 Agency Coordination/Consultation

MDT biologist Deb Wambach and FWP fisheries biologists were consulted for input on construction restrictions and mitigation measures regarding fish species within the project areas.

2.1.2 Literature/Database Searches

Several database searches were completed for this project. Databases that were queried as part of this project included:

- MTNHP Wetland and Riparian Mapping Service (MTNHP 2023)
- Montana Department of Environmental Quality (DEQ) Clean Water Act Information Center (CWAIC) (MDEQ 2023)
- Montana Fish, Wildlife and Parks' FishMT Waterbody Information Database (FishMT) (MFWP 2023)

2.1.3 Field Survey Protocol

The entire project area was reviewed, and all aquatic resources were inspected between July 31 and August 10, 2023. Features were classified as either a wetland or a waterway and delineated or mapped according to MDT's Stream and Wetland Delineation Process (MDT 2020).

The OHWM was identified and mapped in the field using the guidance provided in the *National Ordinary High Water Mark Field Delineation Manual for Rivers and Streams* (David et al. 2022). A resource grade Trimble Geo7x global positioning system (GPS) was used to map the boundaries. The lines generated were then incorporated into the aquatic resource mapping provided in this report and will be used for future permitting calculations. The OHWM was mapped by identifying "physical characteristics such as a clear, natural line impressed on the bank, shelving, changes in the character of soil, destruction of terrestrial vegetation, the presence of litter and debris, ..." (33 CFR Part 328).

Characteristics such as Rosgen stream type, width range of the OHWM, substrate type, and bank vegetation were recorded. Channels were classified as perennial (year-round flow), intermittent (seasonal), or ephemeral (flow that results from storm events or snowmelt).

2.2 Site Description/Stream Morphology

Three streams were identified in the project area, Stone Creek (NWW-01), an unnamed spring creek that is tributary to the Beaverhead River (W-03/NWW-02) (located WSW of the Five Rivers Lodge), and the Beaverhead River (NWW-03) itself. In addition, two canals, the Co-op Ditch (IR-01), and the Warm Springs Ditch (IR-02) also occur in the middle to northern portion of the project area.

Table 1. Waterways delineated along Stone Creek – North project area.

Waterway ID	Stream/Ditch Name	Watershed	Approx. RP	Area (ac)	Narrative Description
NWW-01	Stone Creek	Stone Creek - 100200020605	9.06	0.098	Approx. 15ft-wide channel with narrow wetland margin (WL-1)
NWW-02/ W-03	Unnamed Spring Creek	Beaverhead River - Charlton Slough 1002000207	12.8	0.090*	Unnamed perennial channel below 5 Rivers Lodge; online impoundments upstream of (south) highway.
NWW-03	Beaverhead River	Beaverhead River - Big Dry Gulch - 100200020705	14.67	3.624	Approx. 60ft-wide channel bordered by palustrine emergent and scrub/shrub riparian wetlands.
IR-01	Co-op Ditch	Beaverhead River - Big Dry Gulch - 100200020705	14.97-15.58	1.594	Co-op Ditch with a diversion on Beaverhead River at Point of Rocks; eventually flows back into river through an intricate irrigation network.
IR-02	Warm Springs Ditch	Beaverhead River - Big Dry Gulch - 100200020705	15.25-16.40+	1.603	Warm Springs Ditch originates at the warm springs; and is supplemented by shallow groundwater. Return flows into the Beaverhead River.
Total Area				5.72	

*Area includes the impoundment upstream (south) of the highway.

The following discussion has been excerpted from the 2013 biological resources report; updated as needed to reflect current conditions.

2.2.1 Stone Creek (NWW-01)

Though displayed as an intermittent stream by the USGS, in the project area Stone Creek appears to have perennial flow; flowing generally west to east toward the Beaverhead River. It originates in the Ruby Mountains and flows approximately 13.4 miles in a northwesterly direction until its' confluence with the Beaverhead River. Much of the Stone Creek watershed has been converted to agricultural production. Several pivot irrigation systems draw water from the stream and drain tiles discharge back to the stream. The creek flows beneath a bridge with wooden timbers and piers just northeast of RP 9 on Highway 41 (photograph in Appendix C). Downstream of the highway, the stream gets routed into a series of irrigation ditch, through which it does finally discharge to the Beaverhead River.

Although the creek originates in the Ruby Mountains, the headwaters of the creek receive relatively little snowpack; therefore, Stone Creek's hydrology is not significantly influenced by spring snowmelt. The bankfull/ordinary high-water mark along Stone Creek is representative of a spring-type system, and is approximately 0.4 feet above the base flow water surface elevation. The spring-type hydrology of the

stream is primarily driven by groundwater discharge and drain tile inputs from adjacent, irrigated fields. Headwater reaches of Stone Creek are isolated from reaches further downstream due to irrigation demands and the channel flowing subsurface while the lower segments of Stone Creek remain flowing year-round (Jaeger pers comm.).

In the project area Stone Creek has a slope of 0.45% upstream of the highway, and 0.37% downstream of the highway. Bankfull width, as measured at riffles averages 10.9 feet, while average channel depth at these features is 0.6 feet. Pool habitat features are slightly deeper, with an average depth of 0.7 feet. The creek has a gravel bed and is classified as a C3/C4 stream type under the Rosgen classification system.

Aerial photography and site topography suggest the Stone Creek channel has been manipulated from its historic configuration upstream and downstream of Highway 41. The creek is channelized for approximately 575 feet upstream and 280 feet downstream of the highway to better align the channel with the bridge. Stream habitat consists primarily of long, straight riffles separated by short, shallow pools.

The riparian corridor along the creek has been reduced to a thin band of pasture grasses and sparse woody shrubs. Crops have been planted up to the edge of the channel and have replaced much of the native riparian vegetation upstream of the bridge. Downstream of the bridge, the channel is incised and includes a narrow band of grasses and forbs along the immediate channel fringe. Approximately twenty mature narrow-leaf willows have established along roughly 100 feet of the left bank downstream of the bridge, and provide the only source of shade and cover within a half mile of the bridge (photograph in Appendix C).

Culverts have been placed in the channel at road crossings 800 feet upstream and 850 feet downstream of the bridge. The culvert downstream of the bridge also serves as a check dam for an irrigation pump station. A check structure has been placed in the channel approximately 1,000 feet downstream of the bridge which diverts all of Stone Creek into an irrigation ditch servicing agricultural operations to the north. The historic alignment of Stone Creek downstream of this check structure has been largely eliminated due to extensive agricultural, residential, and livestock activities.

2.2.2 Unnamed Spring Creek Tributary to the Beaverhead River (W-03/NWW-02)

In the project area, the unnamed spring creek was vegetated and impounded on the southeastern side of the highway, and flowing, but fully vegetated on the northwestern side of the highway, and so was classified primarily as a wetland (W-02), though for permitting purposes it will also need to be considered as a stream (NWW-02).

NWW-02 crosses beneath Highway 41 at approximately RP 12.7, flowing generally from south to north. This creek appears to be perennial in the project area and originates approximately 2 miles south of the highway at Trout Creek Road, and flows adjacent to several pivot irrigated fields before reaching the highway. Immediately upstream of the highway, three impoundments have been constructed across the channel to create a series of fish ponds (photograph in Appendix C). Downstream of the highway, the creek continues to flow through a draw before being diverted into Brown Ditch. Brown Ditch drains to a constructed wetland south of the Mailey Ditch. During the site visit a portion of the Brown Ditch within the project area, and between NWW-02 and the constructed wetland, was found to be dry, with

no wetlands occurring in (at least) that section of ditch. This indicates the NWW-02 does not have a relatively permanent connection to the Beaverhead River.

Stream flow in the channel is generated from groundwater recharge, and is likely influenced by pivot irrigation practices in adjacent fields. The East Bench Canal may also influence discharges by leaking water into the spring creek system. Because the unnamed creek originates roughly 2 miles south of Highway 41, snowmelt has little to no impact on its annual hydrograph.

Upstream of the highway and the impoundments, the channel exhibits a naturally meandering pattern prior to being impounded into a series of three ponds. Downstream of the highway, the channel was moved east of its historic alignment for approximately 575 feet, presumably to accommodate the location of the culvert installed beneath Highway 41 during road construction. At the base of the draw, the entire channel has been diverted into the Brown Ditch, which runs along the base of a bluff before being diverted into an MDT mitigation wetland, south of Mailey Ditch. The channel's historic configuration below the base of the bluff has been obliterated by agricultural development and pivot irrigation operations. It is unclear if the historic alignment of the spring directly connected with the Beaverhead River, or if it naturally terminated in the meadows before reaching the river.

With the exception of the artificially constructed online pond features, the relatively steep channel consists of riffle habitat features only. No pool features were observed within 500 feet upstream and downstream of the highway. The spring hydrology of the channel does not produce enough discharge to scour deeper pool habitat; therefore, deeper pool formations are not present in the vicinity of the highway.

Just upstream of the highway, the landowners have constructed three impoundments to create three fish ponds. The lower pond is approximately 0.12 acres, while the middle and upper ponds are approximately 0.6 acres in size.

Downstream of the highway, the unnamed spring creek's channel is vegetated, with flow occupying the approximately a 2 feet wide channel. A 5-10 foot wide band of riparian vegetation primarily composed of pasture grasses, thistle, sparse sedges, and scattered hawthorn shrubs occurs along both sides of the channel. Due to the spring driven hydrology, the creek lacks an extensive floodplain and does not exhibit indicators of frequent flooding outside of its banks.

Upstream of the highway, the riparian vegetation has been manipulated due to the pond developments. Cattails surround the pond closest to the highway, while pasture grasses surround the upper ponds. Downstream of the highway, the unnamed spring creek has been channelized and diverted from its original configuration for approximately 550 feet, likely as part of earlier road construction efforts. Although the creek has been diverted from its historic location, it appears stable vertically and laterally. Approximately 1,100 feet downstream from the highway, the entire channel has been diverted into an irrigation ditch, and the remaining length of natural channel has been obliterated.

2.2.3 Beaverhead River (NWW-03)

The Beaverhead River (NWW-03) crosses the highway at approximately RM 14.6 on Highway 41 (Appendix C), and flowing from west to east. At this location the Beaverhead River is immediately adjacent to Beaverhead Rock, a prominent limestone cliff and landmark made famous by the Lewis and Clark expedition. The bridge crosses the Beaverhead River at the apex of a large meander bend in the river. A USGS gaging station (#06018500) is located on the northeastern side of the bridge.

Discharge in the Beaverhead River is regulated by the Clark Canyon Dam, completed in 1964 and approximately 33 miles upriver from the project site. The regulated nature of the Beaverhead below Clark Canyon Dam is reflected in dam-releases, which provide irrigation water throughout the summer months to several large diversions. The Clark Canyon dam also provides flood control downstream, therefore the Beaverhead River does not exhibit a natural flood regime. The regulated nature of the river has caused vegetation to encroach upon the channel in several locations, including just upstream of the Highway 41 bridge.

Upstream of the Highway 41 Bridge, the Beaverhead River has been modified from its historic channel alignment. A historic road grade was constructed, spanning the width of the valley, and creating a floodplain constriction approximately 0.5 miles upstream of the existing bridge. Pieces of a former bridge crossing remain, including piers and concrete footers. Downstream from this historic road grade, the river has been channelized against the bluff on the south side of the floodplain for approximately 1,800 feet before meandering back to the north and flowing beneath the highway bridge. Downstream of the bridge, the river exhibits a natural, sinuous meander pattern across an extensive floodplain.

The existing bridge crosses the river near the apex of a meander bend that sweeps more than 180 degrees from a northern to a southern flow direction. A lengthy, deep pool extends from approximately 230 feet upstream of the bridge to approximately 350 feet downstream of the bridge. Riffle and run habitats also exist within 300 feet (upstream) of the bridge, offering habitat for aquatic insect production. A drain ditch enters the Beaverhead River 200 feet upstream of the bridge, and offers backwater habitat for juvenile fish.

The riparian corridor up- and downstream of the bridge is largely intact and functioning properly. The corridor mainly consists of wetland sedges and rushes immediately adjacent to the channel, with dense stands of willows and grasses spread across the floodplain. Willow growth along the channel banks provides some degree of cover and shade along the immediate bank line, and contributes to instream woody habitat.

Observations of the riparian corridor greater than 500 feet upstream of the bridge indicated reduced function, as much of the corridor has been removed or converted to pasture grasses. Riparian shrubs along the left (north) bank of the channelized section of the river range from sparse to non-existent for over 1,000 feet. Vegetation along the south bank includes a thin band of riparian shrubs and grasses, which separate the river from a pasture used for grass and hay production.

Observations of the riparian corridor greater than 1,000 feet downstream of the bridge indicate some woody shrub removal and conversion to irrigated hay fields. An irrigated hay field runs adjacent to the river for approximately 1,500 feet. This reach contains no riparian buffer between the irrigated hay field and the river channel.

The river has been channelized from its former alignment for approximately 1,800 feet upstream of the Beaverhead River Bridge. Riprap has been placed along 370 feet of the left (north) bank to protect the adjacent hay field from erosion. Riprap has been placed along 225 feet of the north bank upstream and downstream of the Highway 41 Bridge to maintain lateral river stability.

Downstream of the bridge, removal of woody riparian vegetation along the south bank and irrigation practices are contributing to lateral instability and sediment inputs to the channel. Flood irrigation is saturating a high, steep bank along the right (south) bank causing the bank to slough into the river channel. The bank has no riparian buffer or deep binding roots to maintain stability and will continue to erode sediments into the river indefinitely. Short (10-25') segments of the channel have been riprapped along the right bank to protect a pump intake and to prevent further lateral erosion.

2.2.4 Co-op Ditch (IR-01)

The Co-op Ditch (IR-01) originates from the Beaverhead River, roughly 1,250 feet upstream of Beaverhead Rock. It flows south to north along the base of Beaverhead Rock until it meets up with Highway 41 at approximately RP 15.3. It then flows along the west side of the highway for approximately 1,300 feet before being routed to the north into a cropped alfalfa field, away from the highway. The Co-op Ditch varies in width from 10 to 30 feet, and generally has a silty/mucky bottom. Wetlands occur along most of its length, in some locations, cattails (*Typha latifolia*) and bulrush (*Schoenoplectus acutus*) extend into its bottom (Appendix C).

2.2.5 Warm Springs Ditch (IR-02)

As its name implies, the Warm Springs Ditch (IR-02) originates at a warm spring on the east side of the highway at approximate RP 15.25. The Warm Spring Ditch flows south to north and parallels Highway 41 from its point of origin to the northern terminus of the project area. IR-02 varies in width from 3 to 15 feet, and contains emergent wetlands along its margins (Appendix C). A review of historic swales visible on available aerial photography suggests that historically the warm spring naturally flowed to the east and northeast to the Beaverhead River, and likely supported the fen wetlands found in that area.

2.3 Total Maximum Daily Load (TMDL) Listing 303(d)

Within the project area Stone Creek and the Beaverhead River are both classified as B-1 streams. In 2021, the Montana Department of Environmental Quality (DEQ) reviewed the available data and assessed each of them for their ability to support the beneficial uses associated with the B-1 classification. Based on their review of the data, the DEQ determined that both streams are impaired for not fully supporting aquatic life or primary contact recreation (DEQ 2021, DEQ 2023). They have both been determined to be fully supporting agricultural uses (DEQ 2021).

The DEQ lists the causes for impairment of Stone Creek (MT41B002_131) include alteration in stream-side or littoral vegetative covers, Aluminum, Copper, Iron, Nitrate/Nitrite (Nitrite + Nitrate as N), Nitrogen (Total), Phosphorus (Total), and sedimentation/siltation. The sources of these impairments are attributed to agriculture, crop production, surface mining, and unspecified unpaved road or trail (DEQ 2021).

For the Beaverhead River (MT41B001_020) the causes of impairment include alteration in stream-side or littoral vegetative covers, flow regime modification, Nitrogen (Total), Phosphorus (Total), physical substrate habitat alterations, sedimentation/siltation, and temperature. The DEQ attributes the sources of these impairments to agriculture, irrigated crop production, grazing in riparian or shoreline zones, loss of riparian habitat, and site clearing from land development or redevelopment (DEQ 2021, DEQ 2023).

2.4 Potential Impacts

2.4.1 *Potential Impacts at Stone Creek (NWW-01)*

The existing Stone Creek timber bridge will be removed and replaced. The new structure will be a double cell, reinforced concrete box (RCB) culvert with each cell 12 ft wide x 10 ft high. The west side box culvert will be partially backfilled with riprap and native streambed material and carry Stone Creek under the highway. The east side box culvert will also be partially backfilled with native material and used as an underpass for livestock to cross under the highway. The current bridge does not create a floodplain constriction or impede Stone Creek's flood flows and the new structure is not expected to either. The channel was previously manipulated to align perpendicular to the highway, and has remained in this configuration. A temporary detour on the east (upstream) side of the highway will be installed to maintain traffic flow during the construction process. Impacts to the stream channel and adjacent wetlands will occur at this site and will be quantified by MDT when the designs have been finalized.

2.4.2 *Potential Impacts at the Unnamed Spring Creek (NWW-02)*

Widening the highway at this drainage crossing will require lengthening the culvert to accommodate fill slopes and embankment widths. The current channel downstream (west) of the highway turns sharply to the northeast immediately after coming out of the culvert and runs parallel to the highway for approximately 135 feet before turning back to the north. The lengthening of the culvert and placing fill around the new culvert sections will result in permanent impacts to the channel and adjacent wetlands downstream (west) of the highway. Based on current guidance from the Supreme Court and the U.S. Environmental Protection Agency (EPA), because the creek was observed to go dry in Browns Ditch before reaching the Beaverhead River, NWW-02 is preliminarily considered to be non-jurisdictional.

2.4.3 *Potential Impacts at the Beaverhead River (NWW-03)*

The location of the existing bridge at the apex of the meander bend and its tight radius of curvature through this reach limits the opportunity for realignment of this river crossing. Widening the highway at this river crossing will require new bridge abutments, however no piers or abutments will be placed within the ordinary high water mark. A small amount of riprap fill material will be placed below the

ordinary high water mark in the northeast quadrant of the bridge. Fill materials along the new road grade will be placed within jurisdictional wetlands found in the floodplain of the Beaverhead River, with the majority of the projected impacts occurring north of the river. Reclamation of the old road grade back to wetland habitat is being explored with the adjacent landowners, which could help to offset wetland impacts.

2.5 Avoidance and Minimization Recommendations

Direct impacts to all three waterways are anticipated. The use of Best Management Practices (BMPs) is recommended to prevent pollution and siltation of state waters. The following measures are provided for MDT's consideration to minimize impacts to aquatic resources by the proposed project.

Design Related

- Any stream bank armoring designed to protect bridges from stream and river migration should be kept to the minimum length necessary and placed outside of the active channel to extent practicable.
- Efforts should be made in design to keep the total length of impact in each creek under 300 feet and 0.03-acre of impact per USACE stream mitigation requirements.
- At NWW-02, the minimum length of new culvert should be used to minimize impacts to the creek and adjacent wetlands.
- The new bridge at the Beaverhead River (NWW-03) should be designed to span and avoid the placement of fill within the active channel to the extent practicable.
- Employ design elements that prevent direct drainage of stormwater and runoff into adjacent aquatic resources (e.g., placement of deck drains on the bridge that drain outside of the active channel).
- Bioengineered bank treatments, including woody vegetation components, should be incorporated in areas of affected stream channel and structure replacements.
- Place detours and temporary work bridges as close as possible to the existing highway bridge to reduce overall impact to the creek and adjacent habitats. The detour structure should span the active channel and riparian/wetland fringe along the waterway.

Construction Related

- The Contractor must comply with permit conditions, special provisions, and MDT Standard Specification Sections 208.03.2, 208.03.3, and 208.03.4.
- Construction equipment operating in aquatic habitat should be limited to that which is absolutely required to perform the necessary work.
- Consider icing issues that commonly occur during the winter months and the inverted hydrograph with low water typically occurring in July when planning the construction at the Beaverhead River.

2.6 Permitting Required

MDT and the Contractor will be required to acquire and comply with various state and federal water quality permits associated with this project. Sections 202 and 208 of the MDT Standard Specifications for Road and Bridge Construction (MDT 2023) specify the process with which the contractor must comply in removing structures and how to prevent and control the siltation of aquatic resources. The contractor must comply with the state and federal laws or regulations for preventing or abating erosion, water pollution, and siltation. The following permits are anticipated to be required for this project:

- Erosion control plan filed with the MDEQ (SWPPP).
- Clean Water Act Section 404 permit from the U.S. Army Corps of Engineers (USACE).
- Clean Water Act Section 401 permit certification from MDEQ.
- Montana Stream Protection Act (SPA) 124 from FWP.
- Short-term water quality standard for Turbidity (318 authorization) from MDEQ.
- A floodplain permit will be required from Madison County/DNRC for proposed work on the Beaverhead River.
- Depending on the outcome of hydraulic modeling, a Letter of Map Revision (LOMR) may also be required from the Federal Emergency Management Agency.

2.7 Stream Mitigation Requirements

2.7.1 Exemptions

NWW-01 is a perennial stream in the project area that has a direct connection to the Beaverhead River (NWW-03). The Beaverhead River is a navigable waterway. For these reasons both of these waterways will likely be considered jurisdictional waters of the U.S. by the USACE. Because of this these two waterways are not exempt from Section 404 of the Clean Water Act. All three waterways are considered to be State waters and are subject to all permitting requirements administered by the State of Montana.

NWW-02 is an intermittent stream and is not a “relatively permanent waterway”. For this reason, the USACE will likely consider NWW-02 to be non-jurisdictional. Impacts to non-jurisdictional aquatic resources will be mitigated in accordance with FHWA guidance and EO 11990.

The total length of impact in each creek has not yet been determined. If the length of impact on a jurisdictional drainage is less than 300 linear feet and 0.03-acre, compensatory stream mitigation is typically not required. Stream impacts greater than 300 feet and 0.03-acre on each stream may trigger compensatory stream mitigation requirements. For areas impacting less than the mitigation threshold, the USACE may evaluate areas upstream and downstream from each impact area to determine the cumulative impact of past actions and whether the proposed project warrants compensatory mitigation.

2.7.2 Baseline Stream Factors

Baseline stream factors that are evaluated by the USACE’s Montana Regulatory Office are provided in Table 2. Factors related to compensatory mitigation are not included in this table because impacts and related compensatory mitigation have not been calculated at this time.

Stone Creek (NWW-01)

Stone Creek is a 2nd Order, perennial stream that is listed as impaired by the DEQ. It is not an outstanding Fisheries Resource Value, it is not in a Federal or State protected area, and does not contain critical habitat or core areas for aquatic species (MFWP 2023). Because of this, it is in the “all other waters” category (Table 2). The existing condition of Stone Creek is ‘impaired’ because it has been channelized upstream of the highway, has stream crossings up- and downstream of the Highway 41 bridge, and has the Highway 41 bridge crossing. In addition, a cobble grade control structure was installed downstream of the bridge to prevent further headcutting, and accelerated bank erosion was observed in its vicinity on the left bank. An isolated group of willows do occur downstream of the grade control structure along the left bank. Stone creek has very limited floodplain development.

Unnamed Spring Creek (NWW-02)

Because NWW-02 is an intermittent stream that will likely not be considered jurisdictional under the Clean Water Act by the USACE, it is not considered for stream mitigation.

Beaverhead River (NWW-03)

The Beaverhead River is a 7th Order, perennial waterway, that is listed as impaired by the DEQ. It is not an outstanding Fisheries Resource Value, it is not in a Federal or State protected area, and does not contain critical habitat or core areas for aquatic species (MFWP 2023). Because of this, it is in the “all other waters” category (Table 2). The existing condition of the Beaverhead River is ‘somewhat impaired’ because it a hydrologically controlled river (Clark Canyon Dam), is crossed by the highway in the project area, has been channelized upstream of the highway, and has a major irrigation diversion approximately 3,000 feet upstream of the bridge. The Beaverhead River has an extensive floodplain, much of which is dominated by willows.

2.7.3 Credit Factors

This project aims to improve road safety and maintain the flow and circulation of all creeks where they cross the highway. In their current configurations, these creeks are relatively stable, though some aggradation and channel widening was observed in discrete segments during the site visit. While no specific designs of the proposed structures are available for review, it is anticipated that the replacement structures will span the active channels and, at a minimum, accommodate the passage of the predicted 100-year flood event through the structures.

Table 2. Baseline stream factors for streams in the Stone Creek-North project area. Beaverhead and Madison Counties, Montana.

Factor	Stone Creek (NWW-01)		Beaverhead River (NWW-03)	
	Description	Score	Description	Score
Stream Type	Perennial	0.6	Perennial	0.6
Stream Status	All other waters	0.25	All other waters	0.25
Existing Condition	Impaired	0.25	Somewhat Impaired	0.75
Dominant Impact	Pipe	2.2	Riprap with willows	0.4
Cumulative Impact	<1,000 ft	78 Ft x 0.0005=0.039	<1,000 ft	?? Ft x 0.0005
Comparative Stream Order of Mitigation Site	TBD	TBD	≥2 or more Order Difference	0.2
Location of Mitigation Site	Off-site	0.1	Off-site	0.1
Mitigation Timing	Prior to Impacts	1.0	Prior to Impacts	1.0

The third bullet in the Applicability Section of the Stream Mitigation Procedure specifies:

Projects that result in more than 300 linear feet of new impact on streams will usually require compensatory mitigation. Projects impacting less than 300 linear feet will require compensatory mitigation on a case-by-case basis. Areas upstream and downstream from the proposed project will be evaluated, regardless of property ownership or control, to determine if the cumulative impact of past actions and the proposed project warrants compensatory mitigation for projects impacting less than 300 linear feet of stream channel.

In addition, the general conditions for the 2022 NWP states as condition 23d:

(d) Compensatory mitigation at a minimum one-for-one ratio will be required for all losses of stream bed that exceed 3/100 acre and require preconstruction notification, unless the district engineer determines in writing that either some other form of mitigation would be more environmentally appropriate or the adverse environmental effects of the proposed activity are no more than minimal, and provides an activity-specific waiver of this requirement. This compensatory mitigation requirement may be satisfied through the restoration or enhancement of riparian areas next to streams in accordance with paragraph (e) of this general condition. For losses of stream bed of 3/100 acre or less that require preconstruction notification, the district engineer may determine on a case-by case basis that compensatory mitigation is required to ensure that the activity results in only minimal adverse environmental effects. Compensatory mitigation for losses of streams should be provided, if practicable, through stream rehabilitation, enhancement, or preservation, since streams are difficult to-replace resources (see 33 CFR 332.3(e)(3)).

Total stream impacts at each waterway are undetermined at this time. The design team will make every effort to minimize stream impacts while still achieving the purpose of the project. If stream mitigation is required, it will be coordinated with the USACE and secured from an approved mitigation site with available credits. As necessary, stream mitigation calculations and mitigation proposals will be performed during final design and documented in the Aquatic Findings Report and Clean Water Act Section 404 permitting.

3.0 GENERAL AQUATIC SPECIES

3.1 Methods

3.1.1 Agency Coordination/Consultation

MDT biologist Deb Wambach and the FWP fisheries biologist was consulted for input on construction restrictions and mitigation measures regarding fish species within the project area.

3.1.2 Literature/Database Searches

The Montana Natural Heritage Program – Species Snapshot database was queried to determine species known to occur in Beaverhead and Madison Counties, Montana (2023c). The MFWP FishMT was queried to determine fish distribution within the project area (MFWP 2023).

3.1.3 Field Survey Protocol

Confluence conducted an on-site survey of the project area from July 31 - August 9, 2023. Two Confluence biologists surveyed the streams in the project area to document the presence of fish, and other aquatic species.

3.2 Species Documented

Twenty-one species of fish have been documented in Beaverhead County and 26 species of fish in Madison County (MTNHP 2023d). The MFWP maintains fishery information in their online database called FishMT. In the project vicinity, a combined total of six fish species were captured during electrofishing events on Stone Creek in 2012, 2013, and 2020 (Table 3) (MFWP 2023). Brown trout, brook trout, white suckers, and mottled sculpin have been sampled by MFWP in lower Stone Creek near the confluence with the Beaverhead River (email from MFWP biologist Matt Jaeger, 9/6/13). MFWP suggests this fish assemblage is representative in lower Stone Creek from the confluence with the Beaverhead River through the wetted reach of Stone Creek upstream of Highway 41. Stone Creek goes subsurface somewhere upstream of Highway 41, and remains dry year-round for several miles. FWP has documented an abundance of pure westslope cutthroat trout above the confluence of Stone Creek and Winnipeg Creek, which is approximately 10 miles upstream of the Highway 41 Bridge. According to FWP, this dry channel barrier likely prevents westslope cutthroat trout population from extending their range with any regularity downstream to the reach of Stone Creek in the vicinity of the Highway 41 Bridge.

No fish have been officially documented or were observed in the unnamed spring creek (NWW-02) during any of the surveys; however, the landowner stated that rainbow trout are stocked in the ponds and brown trout existed in the channel prior to construction of the impoundments. No other fish species were observed utilizing the spring creek.

On the Beaverhead River, three fish species have recently been documented in the project vicinity (Table 3) (MFWP 2023). On the Beaverhead River (NWW-03), rainbow trout, brown trout, common carp, and muskrat were observed within the river immediately upstream and downstream of the Highway 41 Bridge in 2013.

Three additional fish species observed utilizing a warm spring and ditch near the base of Beaverhead Rock include sailfin molly (*Poecilia latipinna*), western mosquitofish (*Gambusia affinis*), and variable platyfish (*Xiphophorus variatus*) (L. Urban, pers. comment), all of which are in the molly family (Poeciliidae). Sailfin mollies were observed in the central portion of the Co-op Ditch, and the upper portion of the Warm Springs Ditch during the wetland delineation. Fish in the molly family are live-bearers, can survive in areas of low oxygen content, and are found most often in the tropical fish aquarium trade (MTNHP 2023b).

Table 3. Summary of fish species recently documented in Stone Creek and the Beaverhead River in or near the project area (MFWP 2023).

Waterbody	Species	Species	Relative Abundance
	Common Name	Scientific Name	
Stone Creek	Brown trout	<i>Salmo trutta</i>	Abundant
Stone Creek	Redside shiner	<i>Richardsonius balteatus</i>	Uncommon
Stone Creek	Rocky Mountain sculpin	<i>Cottus bondi</i>	Uncommon
Stone Creek	White sucker	<i>Catostomus commersonii</i>	Abundant
Stone Creek	Mottled sculpin	<i>Cottus bairdii</i>	Abundant
Stone Creek	Brook trout	<i>Salvelinus fontinalis</i>	Rare
Beaverhead River	Brown trout	<i>Salmo trutta</i>	Abundant
Beaverhead River	Mountain whitefish	<i>Prosopium williamsoni</i>	Common
Beaverhead River	Rainbow trout	<i>Oncorhynchus mykiss</i>	Rare

3.3 Potential Impacts

Due to the proposed bridge and culvert replacements, direct impacts to all three waterways are expected. Permanent impacts will be limited to the area in the immediate vicinity of each bridge/culvert and at select locations where the stream channel parallels and interacts with the road grade. Existing channel gradients and dimensions are expected to be maintained, so no permanent secondary (e.g., indirect) impacts are anticipated.

Short-term adverse impacts are expected and will likely be most pronounced during construction. During construction, fish movement upstream and downstream are of most concern, especially during spawning periods. Increases in turbidity and sediment could result in a temporary reduction in stream productivity, a temporary reduction of feeding opportunities for sight-feeding species, temporary avoidance of critical habitat by fish, and sedimentation of spawning habitat or eggs. Specific impacts at each location are discussed below.

3.3.1 Potential Impacts at Stone Creek (NWW-01)

The existing Stone Creek timber bridge will be removed and replaced. The new structure will be a double cell, reinforced concrete box (RCB) culvert with each cell 12 ft wide x 10 ft high. The west side box culvert will be partially backfilled with riprap and native streambed material and carry Stone Creek under the highway. The east side box culvert will also be partially backfilled with native material and used as an underpass for livestock to cross under the highway. The current bridge does not create a floodplain constriction or impede Stone Creek's flood flows and the new structure is not expected to either. The channel was previously manipulated to align perpendicular to the highway, and has remained in this configuration. A temporary detour on the east (upstream) side of the highway will be installed to maintain traffic flow during the construction process. Impacts to the stream channel and adjacent wetlands will occur at this site and will be quantified by MDT when the designs have been finalized.

3.3.2 Potential Impacts at the Unnamed Spring Creek (NWW-02)

Widening the highway at this drainage crossing will require lengthening the culvert to accommodate fill slopes and embankment widths. The current channel downstream (west) of the highway turns sharply to the northeast immediately after coming out of the culvert and runs parallel to the highway for approximately 135 feet before turning back to the north. The lengthening of the culvert and placing fill

around the new culvert sections will result in permanent impacts to the channel and adjacent wetlands downstream (west) of the highway. Based on current guidance from the Supreme Court and the U.S. Environmental Protection Agency (EPA), because the creek was observed to go dry in Browns Ditch before reaching the Beaverhead River, NWW-02 is preliminarily considered to be non-jurisdictional.

3.3.3 Potential Impacts at the Beaverhead River (NWW-03)

The location of the existing bridge at the apex of the meander bend and its tight radius of curvature through this reach limits the opportunity for realignment of this river crossing. Widening the highway at this river crossing will require new bridge abutments, however no piers or abutments will be placed within the ordinary high water mark. A small amount of riprap fill material will be placed below the ordinary high water mark in the northeast quadrant of the bridge.

3.4 Avoidance and Minimization Recommendations

Design Related

- Incorporate public access at the Beaverhead River (NWW-03) crossing.
- Fill materials adjacent to the channel, including rip-rap should be vegetated to maintain shade and cover along the affected creek banks.
- Replacement bridges/culverts should incorporate natural streambed cobbles and gravels, and a low flow channel into the bottom of the structure to promote aquatic organism passage (AOP) through the structure.

Construction Related

- The Contractor must comply with permit conditions, special provisions, and MDT Standard Specification Sections 208.03.2, 208.03.3, and 208.03.4.
- Avoid impacts to spawning brown trout (November-April).
- Equipment that could come in contact with the water should follow FWP's rules and guidelines to prevent the spread of aquatic invasive species.
- Maintain the opportunity for upstream and downstream fish passage during in-stream construction activities, including through temporary detours. (MDT Standard Specification 208.03.3)
- Adhere to Section 208.03.3 – Aquatic Resource Protection of MDT's Standard Specifications during placement of artificial materials within the active channel, a temporary coffer dam should be installed to dewater the bank to prevent excessive turbidity. Where possible, the creek bed and banks should remain undisturbed to prevent unnecessary sediment delivery downstream.
- Heavy equipment operation in the creeks should be minimized to reduce turbidity and the potential for fuel spills into the creek.
- Removal of riparian and creekside vegetation should be kept to a minimum to reduce bank erosion.
- Any equipment that could come in contact with the water should follow FWP's rules and guidelines to prevent the spread of aquatic invasive species.

4.0 WETLANDS

The interaction of wetland hydrology, hydrophytic vegetation, and hydric soil results in the development of site characteristics unique to wetlands. For delineation purposes, wetlands are defined as:

Those areas that are inundated or saturated by surface or groundwater at a frequency and duration sufficient to support, and that under normal circumstances do support, a prevalence of vegetation typically adapted for life in saturated soil conditions (33 CFR 328.3, 40 CFR 230.3).

Consequently, except under certain circumstances, the USACE Wetlands Delineation Manuals (Environmental Laboratory 1987; USACE 2010) require the simultaneous presence of hydrophytic vegetation, wetland hydrology, and hydric soils during the growing season to positively delineate an area as a wetland.

4.1 Methods

4.1.1 Agency Coordination/Consultation

MDT biologist Deb Wambach was consulted prior to initiating field work better to understand the scope and intent of the project, gather existing materials already developed for the project, and gain any additional knowledge of the surrounding area that may be available.

4.1.2 Literature/Database Searches

Several database searches were completed for this project. Databases that were queried as part of this project included:

- NRCS Web Soil Survey (NRCS 2023)
- MTNHP Wetland and Riparian Mapping Service (MTNHP 2023d)
- Montana Natural Heritage Program (MTNHP) Field Guide Database (MTNHP 2023b)
- Montana Natural Heritage Program (MTNHP) Environmental Summary Report (MTNHP 2023a)
- Montana Department of Environmental Quality (DEQ) Clean Water Act Information Center (CWAIC) (DEQ 2023)
- Montana Fish, Wildlife and Parks FishMT Waterbody Information Database (MFWP 2023)

4.1.3 Field Survey Protocol/Wetland Delineation Methods

This wetland delineation builds on and replaces the previous wetland delineations completed for this project in 2013, 2015, and 2016. During site visits from July 31 – August 9, 2023 a Confluence wetland scientist surveyed the entire project area to assess previously delineated wetlands and associated sample points, and to locate new wetlands and fens. During site reconnaissance, any areas identified as being substantially different than what was previously delineated, or new potential wetlands, were further investigated for the presence of wetland hydrology, hydrophytic vegetation, and hydric soils in accordance with the routine method described in the USACE *Wetlands Delineation Manual* (Environmental Laboratory 1987), the *Regional Supplement to the USACE Wetland Delineation Manual: Western Mountains, Valleys, and Coast Region* (USACE 2010), and MDT's Stream and Wetland Delineation Process (MDT 2020). Paired wetland and upland data points were completed to determine each wetland's wetland/upland boundary. All wetland boundaries and points were mapped using a resource-grade GPS unit. The waterway boundaries, wetland boundaries, and data points were

converted to ArcGIS shapefiles and combined with aerial imagery in a Geographic Information System (GIS) to perform calculations and create the figures in this report. Photographs were taken of each data point and included in Appendix C. All delineation data were recorded using the smartphone application called EcoBot, which is specifically designed for this purpose. The collected data was later exported to USACE Wetland Determination Data Form format (Appendix B).

Plants observed within each data plot were identified primarily using the *Manual of Montana Vascular Plants* (Lesica et al. 2012), and the 2020 National Wetland Plant List was used to identify the wetland indicator status of the species observed. Soil types within the project area were obtained from the *Soil Survey Geographic (SSURGO) Database* (NRCS 2023).

Wetland polygons were labeled with the same number if surface water connected them. A lowercase letter was added to the label when multiple wetland polygons comprised the wetland, with the direction of flow represented in ascending alphabetical order. Data points were labeled to correspond with the associated wetland, with lowercase letters used to denote additional data points taken for the same wetland feature. Sub-letters “w” denoting a wetland data point or “u” denoting an upland data point were used at the end of the sample point label to assist the reader interpreting the data.

Wetlands were classified based on the hydrogeomorphic (HGM) classification method (Smith et al. 1995), the wetland classifications used by USFWS (FGDC 2013), and MDT’s Montana Wetland Assessment Method (MWAM) (Berglund and McElowney 2008). Wetland types were identified within wetland polygons using the USFWS classification system (FGDC 2013), where the predominant life form is chosen if it comprises an aerial coverage of 30% or more of the substrate (e.g., emergent, scrub-shrub, forested). Areas containing wetland hydrology, but less than 5% aerial coverage of vegetation were considered unvegetated mudflats.

Wetland Boundaries

Wetland boundaries were typically readily identifiable due to changes in topography, shifts in vegetation composition, changes in hydrology, and/or changes in soil type. Topographic inflection points were frequently used to help identify wetland boundaries in areas where a slope met a valley floor or flat area (e.g., toe of slope), or along relatively narrow drainages or roadside ditches. Shifts in plant species composition toward drier species such as smooth brome, cheatgrass, and crested wheatgrass were integrated into boundary determinations. Changes in soil saturation and/or surface saturation also guided the delineator in identifying wetland boundaries. The delineator checked soils in multiple locations along the wetland boundary, in addition to the recorded data points. Observations of shifts in soil color and/or redoximorphic features (e.g., mottling, depth to mottling, etc.) provided supporting data for determining wetland boundaries in the field.

Fen Identification and Delineation

This report includes a brief overview of the fen identification and delineation methods completed in 2017. For a more complete review of these methods, please refer to *Wetland Addendum Technical Memorandum #2 – Fen Verification* (dated June 18, 2017).

There are several different definitions of fens that occur in the literature, none of which have been officially adopted by the U.S. Army Corps of Engineers. The definition that the 'MDT Fen Working Group' decided to use is the definition described in the U.S. Fish and Wildlife Service (USFWS) Region 6 Fen Policy (USFWS 1999). This definition states,

"For the purposes of this policy, fens will be defined as wetlands with organic materials accumulations that are groundwater driven." (USFWS 1999)

The definition in their fen policy goes on to define the underlying terminology used, and incorporating the organic soil definition developed by the Natural Resources Conservation Service (NRCS) to describe histosols. The Fen Working Group felt that this was the most logical fen definition to use because it uses specific quantifiable parameters, and because the USFWS is a regulatory authority that has had a long-term role in the identification, classification, mapping, and stewardship of wetlands in the United States.

In technical terms organic soils are referred to as histosols. The definition of a histosol is provided below, and includes quantifiable metrics useful in making a concrete determination of their presence or absence.

Histosol is defined as, an organic soil that is saturated with water for 30 days or more per year in normal years (or are artificially drained), at least 40 cm [16 inches] thick with an organic carbon content of 18% or more if the mineral fraction contains 60% or more clay; or 12% or more if the mineral fraction contains no clay; or 12 + (clay percentage multiplied by 0.1) percent or more if the mineral fraction contains less than 60 percent clay (NRCS 2016; Soil Survey Staff 2014).

As described in the definition above, there are three main components to classifying a soil as a histosol, these are:

1. Hydrology: saturated with water for 30 days or more per year.
2. Organic carbon content: 12 to 18% organic carbon depending on clay content.
3. Depth of organic soil: Depth of organic soil must be 16 inches or more in the upper 32 inches of the soil profile.

These three characteristics were used to positively identify an area as possessing an organic soil and being a fen. All three of these parameters must occur for a sample site to be categorized as 'organic'. One other characteristic of fen wetlands that is commonly referenced in the literature is that they are supported by mineral rich groundwater that has a typical range in pH between 4.5 and 7.5 (USFWS 1999). pH was not used as a defining parameter for fens because the pH values are not unique to fens.

The percent organic matter was determined using the Loss on Ignition (LOI) procedure.

The sample sites that had organic soils and that appeared to have the appropriate hydrology of 30 days of soil saturation based on available groundwater data and site observations, were classified as 'fen'. These and the non-fen sample points were then used to refine the extent of the mapped fen boundary.

Mapping was initially completed in GIS by integrating and extrapolating the results of the soil sampling, available groundwater data, and available natural color and color infrared aerial (CIR) photography from 2005, 2009, 2011, and 2013. The resulting map of the fen was then loaded into a resource grade GPS unit for verification in the field in 2017. These preliminary fen boundaries were located in the field and either verified and left unchanged, or modified to better reflect on-the-ground conditions. In areas where there were no detectable changes in topography, soil, hydrology, or vegetation, the fen boundary was not changed. In some cases, this meant that some mineral soil sample locations were included within the fen boundary. Thus, the fen boundary identifies the *dominant* soil condition for the area, and does not preclude the occurrence of mineral soils.

In 2023, no new soil samples were taken for LOI analysis, and no new hydrology data was reviewed. However, numerous supplemental sample points were checked in the field for the presence/absence of organic soils. If organic soils were found to be dominant in an area, the fen boundary was changed to accommodate these areas. Similarly, if mineral soils were found to be dominant within an area mapped as fen, the fen boundary was adjusted to exclude the mineral soil area.

Functional Assessment

Wetland functions within the project area were evaluated using the MDT MWAM. With this method, the user defines an assessment area (AA) based on the guidance in the manual and then works through a series of decision matrices to qualitatively evaluate up to 12 wetland functions. A point system is used to score each function from 0.1 (low) to 1.0 (high). When complete, functional points for each function are summed to calculate total functional points for the AA. Total functional points are then divided by the total number of points possible for the AA to calculate a percentage of points possible. This percentage is then used in conjunction with additional factors to determine the functional category of the AA. There are four functional categories. Category I is the highest function rank an AA can receive, followed by Category II, Category III, and Category IV. Functions evaluated using MWAM include:

- Habitat for federally listed or proposed threatened or endangered plants or animals
- Habitat for plants or animals rated S1, S2, or S3 by the MTNHP
- General wildlife habitat
- General fish/aquatic habitat
- Flood attenuation
- Long- and short-term surface water storage
- Sediment/nutrient/toxicant retention and removal
- Sediment/shoreline stabilization
- Production export/terrestrial and aquatic food chain support
- Groundwater discharge/recharge
- Uniqueness
- Recreation/education potential

4.2 Description of Delineated Wetlands

A total of 104 data points were investigated, with 81 of those being completed in 2023 (Appendix B). The remaining 25 sample points were evaluated in the field and kept if they were determined to still be relevant and valid. Updates to these older data points were made as needed. Fifteen wetlands covering

approximately 48.884 acres were delineated within the project area (Table 4, Maps 1-10 in Appendix A). Of the 48.884 acres of wetland delineated, 12.438 acres of them were identified and mapped as fen wetlands (Figure 3) in the project area north of the Beaverhead River, and east of the highway.

Emergent wetlands made up the majority (29.943 ac, 61%) of the wetland polygons found in the project area. Wetlands with a mix of emergent and scrub-shrub components were the second most common (18.108 ac, 37%) wetland type. Pure scrub-shrub wetlands were limited to 0.6% (0.289 ac) of the wetlands mapped in the project area, and a single wetland comprised of both emergent and forested wetland types was found (0.543 ac, 1.1%).

Dominant plants found in wetlands varied based on their location, but several of the more common hydrophytic plant species in the project area included coyote willow (*Salix exigua*), creeping meadow foxtail (*Alopecurus arundinacea*), reed canarygrass (*Phalaris arundinaceus*), quackgrass (*Elymus repens*), field sow thistle (*Sonchus arvensis*), hardstem bulrush (*Schoenoplectus acutus*), Nebraska sedge (*Carex*

Table 4. Summary of wetlands within the Stone Creek – North project area.

Wetland ID	HGM Class	USFWS Class ¹	Primary Source of Wetland Hydrology	Data Points	Approx Reference Post	Extends Outside of Study Area (Yes/No)	Area (ac)	Narrative Description	Nexus Narrative
W-01a&b	Riverine	PEM1B, PSS1E	Stone Creek	SP01a-u, SP01a-w (S of hwy) SP01b-u, SP01b-w (N of hwy)	9.02	Yes	0.135	Stone Creek flows from the east to the west toward the Beaverhead River. A 5-10 ft wide emergent wetland occurs on either side of Stone Creek.	Emergent riparian wetland abutting Stone Creek. North of the project area Stone Creek is diverted into an irrigation ditch, which connects to a canal. This canal flows to the Beaverhead River.
W-02	Slope	PEM1E	Groundwater, seasonal surface water, precipitation	SP02-u, SP02-w	10.22	No	0.073	Approx. 25 ft wide wetland swale on south side of highway. Wetland does not continue on the north side of the highway.	Wetland includes narrow swale through ephemeral drainage on the south side of Highway. No direct connection to WUS identified. No wetland indicators observed north of highway.
W-03a (pond) W-03b (Crk N of Hwy)	Depressional Riverine	PEM1E	Perennial surface water in unnamed drainage	SP03a-u, SP03a-w (S of hwy), SP03b-u, SP03b-w (N of hwy)	12.73	Yes	0.633	Narrow wetland margin surrounding manmade ponds and along an unnamed tributary downstream from the pond on north side of highway. Includes a part of an island dominated by willow trees (PFO).	Pond drains to a ditch (NWW-02) that drains to Browns Ditch that, when it flows, drains into constructed MDT wetland complex south of Mailey's Ditch. Downstream of the project area Brown's Ditch was found to not be flowing, and appeared to not have flowed recently. Browns Ditch is not considered to be a relatively permanent waterway.
W-04	Riverine	PEM1E	Groundwater, seasonal surface water, precipitation	SP04-u, SP04-w	14.35	Yes	0.136	Old meander scar historically used as part of the Mailey irrigation ditch. It is unknown if it is still in use. Site was hayed.	A landscaped yard and shed appear to disconnect the swale from its historic surface connection to the Beaverhead River.
W-05	Depressional	PEM1B	Precipitation, runoff	SP05-u, SP05-w	14.38	No	0.099	Shallow depression, historically maintained as wetland by irrigation ditch, no longer active. Occasional flooding during high flows.	Shallow depression, historically maintained as wetland by Mailey irrigation ditch, no longer active. No surface connection to a WUS identified.
W-06a,b,c	Riverine	PEM1E/PSS1E	Alluvial groundwater, flooding from Beaverhead River	SP06(a,b,d,e,f,g,h,i,j)-u (9 upl pts), SP06(a,b,c,d,e,f,g,h,i,j)-w (10 wetland pts)	14.45-14.64	Yes	13.160	River flows west to east. Emergent and scrub-shrub wetlands in the active floodplain of the Beaverhead River. PEM wetlands extend below the OHWM in some areas. PEM wetland dominated by reed canarygrass extends under the bridge on the right (south) bank.	Riparian wetland abutting the Beaverhead River.
W-07	Depressional	PEM2B	Alluvial groundwater, precipitation	SP07-u, SP07-w	14.7	No	0.096	Depression with shallow seasonal groundwater surrounded by a berm and road fill.	Isolated wetland depression with no direct connection to other wetlands or WUS.
W-08	Riverine	PEM1E/PSS1E	Alluvial groundwater, precipitation, Co-op Ditch, occasional flooding from Beaverhead River	SP08(a,b,d)-u (3 upl pts), SP08(a,b,c)-w (3 wetland pts)	14.68-14.82	Yes	2.025	Historic ox-bow with high water table	Historic ox-bow with high water table supported by Beaverhead River and the Co-op ditch. Outside of the project area this wetland directly abuts the Co-op Ditch and the Beaverhead River.
W-09	Riverine	PEM1E	Alluvial groundwater, precipitation	SP09-u, SP09-w	14.73-14.86	Yes	2.087	Seasonally wet meadow in a meander scar on a floodplain terrace. Saturated during spring and early summer.	Old meander that connects to the Beaverhead River through adjacent wetlands that ultimately abut the Beaverhead River.

Wetland ID	HGM Class	USFWS Class ¹	Primary Source of Wetland Hydrology	Data Points	Approx Reference Post	Extends Outside of Study Area (Yes/No)	Area (ac)	Narrative Description	Nexus Narrative
W-10a,b	Riverine	PEM1E/PSS1E	Alluvial groundwater, precipitation, Co-op Ditch, occasional flooding from Beaverhead River	SP10a-u, SP10a-w (W of hwy) SP10b-u, SP10b-w (E of hwy) SP10c-u (W of hwy)	14.91	No	0.403	Cattail/bulrush/willow depression, saturated soil surface, culvert under road at drain point.	Wetland located in old oxbow, connected to larger wetland outside of study area with direct connections to Co-op Ditch and the Beaverhead River.
W-11	Riverine	PEM1E	Alluvial groundwater, precipitation, Co-op Ditch, occasional flooding from Beaverhead River	SP11a-u, SP11a-w, SP11(b,c,d)-u (4 upl pts, 1 wetland pt)	14.91	No	3.511	Cattail/bulrush/willow depression, saturated soil surface, culvert under road at drain point.	Wetland located in old oxbow, connected to larger wetland outside of study area with direct connections to Co-op Ditch and the Beaverhead River.
W-12a,b	Riverine	PEM1E/PSS1E	Alluvial groundwater, precipitation, Co-op Ditch	SP12(a,c,d)-u (3 upl pts), SP12(a,b,c,d)-w (4 wetland pts)	15.02-15.31	Yes	4.271	Occurs on either side of the Co-op Ditch west of the highway at the base of Beaverhead Rock. Includes a community of common reed (<i>Phragmites australis</i>), as well as other PEM and PSS communities. Co-op Ditch flows south to north. Surface water present in lowest depressions.	Wetland directly associated with the Co-op Ditch. Co-op Ditch with irrigation returns directly connected to WUS.
W-13	Riverine	PEM1E/PSS1E	Alluvial groundwater, precipitation, warm spring	SP13(a,b,d,e,f,g,h,i,j,k,l)-u (11 upl pts), SP13(c,d,e,f,g,h,i,j,)-w (8 wetland pts)	14.86-15.44	Yes	21.015	Wetland complex within historic oxbow complex. A warm spring occurs in this area, as well as extensive fen wetlands. The warm spring flows northward and is the source of the Warm Springs Ditch.	Wetland connected to larger wetland complex (abandoned ox-bows) outside of project with contiguous connection to Beaverhead River.
W-14a,b,c,d	Riverine	PEM1E	Co-op Ditch, precipitation	SP14(a,b,c)-u (3 upl pts), SP14(a,b,c)-w (3 wetland pts)	15.31-15.58	Yes	0.076	Very narrow wetland fringe along each side of the Co-op Ditch on the west side of the highway. The ditch side slopes are very steep and the ditch is frequently cleaned/maintained making the establishment and persistence of wetland vegetation difficult. The wetland fringe is not continuous and does not extend all the way to the NW end of the project extent.	The Co-op Ditch flows from south to north and through a convoluted pathway, eventually connects back to the Beaverhead River.
W-15a,b,c, d,e,f,g,h,i,j,k,l,m,n,o,p	Riverine	PEM1E/PSS1E	Warm Springs Ditch, precipitation	SP15(a,b,c,d,e,f,g,h,i,l)-u (9 upl pts), SP15((a,b,c,d,e,f,g,h,i,l)-w (9 wetland pts)	15.38-16.4	Yes	1.164	Narrow wetland margin along both side of the irrigation canal.	Wetland fringe directly associated with the Warm Springs Ditch (WSD). WSD with irrigation returns directly connected to WUS.
						Total Area	48.884		

¹ P - Palustrine; EM - Emergent, 1 - Persistent vegetation, 2 - Nonpersistent; SS - Scrub/Shrub, 1 - Broad-leaved deciduous; FO - Forested, 1 - Broad-leaved deciduous; Modifiers: A- Temporarily Flooded, B - Saturated, C - Seasonally Flooded; E - Seasonally Flooded/Saturated.

nebrascensis), silverweed (*Potentilla anserina*), alkali cordgrass (*Spartina gracilis*), and common spikerush (*Eleocharis palustris*). Common reed (*Phragmites australis*) occurs in the area surrounding the warm spring in wetlands W-12 and W-13.

Soil textures were somewhat variable and reflected the alluvial nature of the project area. Textures included loamy sand, sandy loam, silt loam, loam, sandy clay, clay, and silty clay. The majority of the hydric soil indicators observed in the project area included histosols (W-13 fen area), hydrogen sulfide, loamy gleyed matrix, and a depleted matrix. Wetland hydrologic indicators included primary indicators such as surface water, saturation, hydrogen sulfide odor, and oxidized rhizospheres, as well as secondary indicators such as geomorphic position, and passing the FAC-neutral test. More specific information about each sample point is provided on the data forms provided in Appendix B.

4.2.1 Functional Assessment

Wherever possible wetlands were grouped together based on similar attributes for their assessment using the Montana Wetland Assessment Method (MWAM). A total of 11 assessment areas were evaluated and are summarized in Table 5. Most of the wetlands were rated as having a moderate level of functionality (Category III), one wetland was rated as possessing a low level of functionality (W-07, Category IV), and six wetlands (W-06, W-08, W-10, W-11, W-12, and W-13) were rated as highly functional Category II wetlands (Table 5). Disturbances within the AAs included highway right-of-way maintenance, cultivation, haying, grazing, and hydrologic alteration. Surrounding the AAs, cultivation, grazing, mowing, and high road density were common disturbances. Structural diversity was generally low, with only a handful of wetland areas supporting willow stands. The wetland areas adjacent to the highway mostly provided poor habitat for federally listed or proposed T&E plants or animals and MTNHP recognized Species of Concern. General wildlife habitat was rated as low to moderate, with disturbance and smaller size causing the lower scores. The proximity to the active highway corridor and active agricultural practices limits wildlife usage in those areas. Fish habitat was present within eight AAs and averaged a moderate rating when applicable.

MWAM data forms are provided in Appendix B.

4.2.2 Fens

Between 2015 and 2017 99 sites were sampled for the presence or absence of organic soils meeting the NRCS' definition of organic soils, also known as histosols. This extensive three-year sampling effort was conducted in order to understand the extent and configuration of the fen so that different roadway alignments could be fully evaluated. In 2023 the boundary of the fen was re-evaluated in areas where it had been previously been mapped, and boundaries were adjusted, as appropriate, to fit the new study area. The result of these efforts is the mapping of a 12.175-acre fen occurring entirely within W-13 on the east side of the highway in the vicinity of the warm spring (Figure 3). These wetlands are considered to be fens, a special type of wetland, because they are predominately comprised of organic soils (meeting both organic carbon and depth requirements), are saturated for 30 or more days per year, and because the wetlands are primarily supported by groundwater.

The depicted fen area in Figure 3 is comprised of a complex of organic and mineral soils, and appears to reflect historic drainage patterns of the warm spring - prior to the creation of the Warm Spring Ditch and the routing of the water from the warm springs directly north along the current highway alignment. This

Table 5. Summary of Montana Wetland Assessment Method evaluations completed for wetlands found in the Stone Creek – North project area.

Function and Value Parameters	Assessment Areas										
	AA-01	AA-02	AA-03	AA-04	AA-05	AA-06	AA-07	AA-08	AA-09	AA-10	AA-11
Wetlands and Waterways within Assessment Area	W-01, NWW-01	W-02, W-04, W-05	W-03a, NWW-02	W-03b, NWW-02	W-07	W-06, W-08 NWW-03	W-09	W-10, W-11, W-12	W-13	W-14, IR-01	W-15, IR-02
Listed/Proposed T&E Species Habitat	Low (0.0)	Low (0.0)	Low (0.0)	Low (0.0)	Low (0.0)	Low (0.1)	Low (0.1)	Low (0.1)	Low (0.1)	Low (0.0)	Low (0.0)
MTNHP Species Habitat	Low (0.0)	Low (0.0)	Low (0.0)	Low (0.0)	Low (0.0)	High (0.9)	Mod (0.7)	High (0.9)	High (0.9)	Low (0.0)	Low (0.1)
General Wildlife Habitat	Low (0.2)	Low (0.1)	Mod (0.7)	Low (0.2)	Low (0.2)	Mod (0.7)	Mod (0.4)	Mod (0.7)	Mod (0.5)	Low (0.1)	Low (0.2)
General Fish/Aquatic Habitat	Mod (0.4)	NA	Low (0.3)	Low (0.3)	NA	Mod (0.6)	NA	NA	NA	NA	NA
Flood Attenuation	Mod (0.5)	NA	High (0.9)	Mod (0.5)	NA	High (0.8)	NA	Mod (0.5)	NA	Low (0.1)	NA
Short and Long Term Surface Water Storage	Low (0.3)	Low (0.3)	High (0.8)	Low (0.3)	Low (0.2)	High (0.9)	Low (0.3)	Mod (0.6)	High (0.8)	Low (0.2)	Low (0.2)
Sediment/Nutrient/Toxicant Removal	Mod (0.5)	High (0.8)	Mod (0.7)	Mod (0.7)	Mod (0.5)	Mod (0.4)	Mod (0.4)	Mod (0.5)	Mod (0.4)	Mod (0.4)	Mod (0.4)
Sediment/Shoreline Stabilization	High (1.0)	NA	High (1.0)	High (1.0)	NA	High (1.0)	NA	High (1.0)	High (1.0)	Low (0.3)	High (1.0)
Production Export/Food Chain Support	Mod (0.6)	Low (0.1)	Mod (0.7)	Mod (0.4)	Low (0.3)	High (0.8)	Mod (0.6)	Mod (0.7)	High (0.8)	Low (0.3)	Mod (0.5)
Groundwater Discharge/Recharge	NA	Mod (0.4)	High (1.0)	NA	Mod (0.7)	High (1.0)	Mod (0.7)	High (1.0)	High (1.0)	Low (0.2)	NA
Uniqueness	Low (0.1)	Low (0.1)	Mod (0.4)	Low (0.1)	Low (0.1)	Mod (0.5)	Low (0.3)	High (0.8)	High (0.9)	Low (0.1)	Low (0.1)
Recreation/Education Potential	NA	NA	Low (0.05)	NA	NA	High (0.20)	NA	Low (0.05)	Low (0.05)	NA	NA
Actual Points / Possible Points	3.6 / 10	1.8 / 8	6.55 / 11	3.5/10	2.0 / 8	7.9 / 11	3.5 / 8	6.85 / 10	6.45 / 9	1.6 / 10	2.5 / 8
% of Possible Score Achieved	36%	23%	60%	35%	25%	72%	44%	69%	72%	16%	31%
Overall Category	III	IV	III	IV	IV	II	III	II	II	IV	III

complex of mineral and organic soils is dominated by organic soils. While it is possible that areas outside of the 2017 fen boundary may contain discrete pockets of organic soil, if they occur, they will be relatively small in extent.

4.3 Potential Impacts

Any realignment or widening of the highway with adjacent wetland habitat will likely result in wetland impact. At this time the roadway design has not been finalized and so wetland impacts have not been quantified. Minimal impacts to aquatic resources are anticipated from the start of the project at Stone Creek to approximately RP 14.50 where the road drops into the Beaverhead Valley. This reach of highway will include the replacement of the Stone Creek Bridge with a double cell RCB and a culvert replacement at W-03/NWW-02, as well as the modification of roadway geometrics to improve vertical curves and to meet current standards.

The existing Stone Creek timber bridge will be removed and replaced. The new structure will be a double cell, reinforced concrete box (RCB) culvert with each cell 12 ft wide x 10 ft high. The west side box culvert will be partially backfilled with riprap and native streambed material and carry Stone Creek under the highway. The east side box culvert will also be partially backfilled with native material and used as an underpass for livestock to cross under the highway. A temporary detour on the east (upstream) side of the highway will be installed to maintain traffic flow during the construction process. Impacts to the stream channel and adjacent wetlands will occur at this site and will be quantified by MDT when the designs have been finalized.

Widening the highway at W-03/NWW-02 will require lengthening the culvert to accommodate fill slopes and embankment widths. The current channel downstream (west) of the highway turns sharply to the northeast immediately after coming out of the culvert and runs parallel to the highway for approximately 135 feet before turning back to the north. The lengthening of the culvert and placing fill around the new culvert sections will result in permanent impacts to the channel and adjacent wetlands downstream (west) of the highway. Based on current guidance from the Supreme Court and the U.S. Environmental Protection Agency (EPA), because the creek was observed to go dry in Browns Ditch before reaching the Beaverhead River, W-03/NWW-02 are preliminarily considered to be non-jurisdictional.

More impacts are expected from RP 14.50 to the northern end of the project. Wetlands occur on one or both sides of the highway for this entire stretch and portions of the roadway will be realigned to the east of the present travelled way. The highway will be realigned to the east beginning at the East Bench Road to improve the radius of curvature of the turn there, and thereby improve motorist safety. Fill materials along the new road grade will be placed within W-06 found in the floodplain of the Beaverhead River, with the majority of the projected impacts occurring north of the river. Reclamation of the old road grade back to wetland habitat is being explored with the adjacent landowners, which could help to offset wetland impacts. Minimal impacts to the river bed are anticipated as the bridge is designed and constructed to span the full width of the river. Continuation of the realigned highway will impact wetlands W-09, W-13, and W-15. Impacts to W-13 will include impacts to the fen wetlands found there. Impacts will be finalized and quantified in the Aquatic Findings Report.

4.4 Avoidance and Minimization Recommendations

Prior to and during construction, MDT and the contractor are required to obtain and comply with various state and federal water quality permits in association with this project. These may include an Erosion Control Plan to be filed with the DEQ and permits and certifications to be obtained under the Stream Protection Act (124) and USACE Clean Water Act (404/401). The contractor must comply with the FWP, DEQ, and all other state or federal laws or regulations for preventing or abating erosion, water pollution, and siltation. The use of BMPs must be used to prevent polluting and siltation of State waters. Chemicals, fuels, lubricants, bitumen, raw sewage, and other wastes must be prevented from entering State waters. Erosion, siltation, and water pollution must be controlled during all work activities.

The following measures are provided for MDT's consideration to minimize impacts to aquatic resources by the proposed project. Additionally, state and federal water quality permit conditions may be stipulated at the time of permit issuance.

Design Related

- Use porous material (e.g., (6-inch minus with 8% max fines/-200 sieve) under the roadway prism at W-13 to allow hydrologic connectivity of shallow groundwater under the new highway alignment.
- Steepen designed fill slopes to the extent practicable to minimize the construction footprint on adjacent wetlands.
- Consider the use of guardrail as needed to further reduce the construction footprint on adjacent wetlands.
- Any disturbed areas should be revegetated with appropriate plantings following construction.

Construction Related

- The Contractor must comply with permit conditions, special provisions, and MDT Standard Specification Sections 208.03.2, 208.03.3, and 208.03.4.
- Construction areas in wetlands should be fenced to help prevent inadvertent impacts outside of the approved work area.

4.5 Required Permitting

Impacts to wetlands in the project area will require the following permits:

- Clean Water Act Section 404 permit from the USACE. Because anticipated impacts will likely be more than 0.5 acres, an individual permit should be anticipated, requiring selection of the least environmentally damaging practicable alternative (LEDPA).
- Clean Water Act Section 401 permit certification from MDEQ. Because an individual 404 permit will likely be required, an individual 401 permit will also be required.
- Montana Stream Protection Act (SPA) 124 from FWP.
- Short-term water quality standard for Turbidity (318 authorization) from MDEQ.

4.6 Proposed Compensatory Wetland Mitigation Strategy

The extent of impacts to wetlands caused by the proposed project will be calculated when the design is more complete. It is expected that MDT will use wetland credits generated by their Corps approved Wetland Mitigation Reserves for Watershed 6 – Upper Missouri to offset permanent wetland impacts

caused by this project. Temporary impacts will be restored onsite by returning the ground surface to the original elevations and seeding the sites with a native wetland seed mix.

5.0 REFERENCES

- Berglund, J. and R. McEldowney. 2008. *MDT Montana Wetland Assessment Method*. Prepared for Montana Department of Transportation, Helena, Montana. Post, Buckley, Schuh, & Jernigan, Helena, Montana. 42pp.
- David, G., K. Fritz, Tracie-Lynn Nadeau, B. Topping, A. Allen, P. Trier, S. Kichefski, L. James, E. Wohl, and D. Hamill. 2022. *National Ordinary High Water Mark Field Delineation Manual for Rivers and Streams*. Technical Report ERDC/CRREL TR-22-26. US Army Corps of Engineers, Washington, DC. 388 p.
- Environmental Laboratory. 1987. *Corps of Engineers Wetlands Delineation Manual*, prepared by U.S. Army Corps of Engineers, Washington, DC.
- Federal Geographic Data Committee (FGDC). 2013. *Classification of Wetlands and Deepwater Habitats of the United States*. FGDC-STD-004-2013. Second Edition. Wetlands Subcommittee, Federal Geographic Data Committee and U.S. Fish and Wildlife Service, Washington, DC.
- Jaeger, Matt, Fisheries Biologist with Montana Fish, Wildlife and Parks. Personal Communication on July 17, 2013 regarding fish sampling efforts and species identified in lower Stone Creek during 2013 sampling.
- Lesica, P., M.T. Lavin, and P.F. Stickney. 2012. *Manual of Montana Vascular Plants*. Fort Worth, TX: BRIT Press. viii + 771 p.
- Montana Department of Environmental Quality (DEQ). 2021. Montana 2020 Water Quality Integrated Report. Helena, MT: Montana Dept. of Environmental Quality.
- Montana Department of Environmental Quality (DEQ). 2023. Clean Water Act Information Center (CWAIC). Accessed September 2023 at: <https://svc.mt.gov/deq/dst/#/app/cwaic>.
- Montana Department of Transportation (MDT). 2020. *MDT Wetland and Stream Delineation Process*. Accessed September 2023 at: <https://www.mdt.mt.gov/business/contracting/docs/env/WetlandStreamDelineationProcess-FINAL.pdf>
- Montana Department of Transportation (MDT). 2023. *Standard and Supplemental Specifications for Road and Bridge Construction*. 2020 Edition, V4.0. Accessed September 2023 at: <https://www.mdt.mt.gov/other/webdata/external/const/specifications/2020/SPEC-BOOK/2020-SPEC-BOOK-V4-0.pdf>. Effective June 29, 2023.
- Montana Fish, Wildlife, and Parks (MFWP). 2023. FishMT: Waterbody Reports Available Online. Accessed September 2023 at: <https://myfwp.mt.gov/fishMT/explore>.

Montana Natural Heritage Program (MTNHP). 2023a. *Environmental Summary Report*. September 6, 2023.

Montana Natural Heritage Program (MTNHP). 2023b. Montana Online Field Guide. Accessed September 2023 at: <http://fieldguide.mt.gov/>

Montana Natural Heritage Program (MTNHP). 2023c. Species Snapshot. September 2023.

Montana Natural Heritage Program (MTNHP). 2023d. Wetland and Riparian Mapping. Accessed July 2023 at <https://mtnhp.org/mapviewer/?t=8>

Natural Resources Conservation Service (NRCS). 2016. Field Indicators of Hydric Soils in the United States, Version 8.0. L.M. Vasilas, G.W. Hurt, and J.F. Berkowitz (eds.). USDA, NRCS, in cooperation with the National Technical Committee for Hydric Soils. 55 p.

Natural Resources Conservation Service (NRCS). 2023. *Soil Survey (SSURGO) Database for [Beaverhead and Madison Counties, Montana]*. Accessed September 2023 at: <https://websoilsurvey.sc.egov.usda.gov/App/WebSoilSurvey.aspx>

Rosgen, D. L. (1994). *A classification of natural rivers*. Catena, 22(3), 169-199.

Smith, R. D., A. Ammann, C. Bartoldus, and M. M. Brinson. 1995. *An Approach for Assessing Wetland Functions Using Hydrogeomorphic Classification, Reference Wetlands, and Functional Indices*, prepared by U.S. Army Corps of Engineers Waterways Experiment Station, Vicksburg, Mississippi, for U.S. Army Corps of Engineers, Washington, DC.

Soil Survey Staff. 2014. Keys to Soil Taxonomy. 12th Edition. 372 p.

U.S. Army Corps of Engineers (USACE). 2010. *Regional Supplement to the Corps of Engineers Wetland Delineation Manual: Western Mountains, Valleys, and Coast Region (Version 2.0)*, prepared by U.S. Army Corps of Engineers, U.S. Army Engineer Research and Development Center, Environmental Laboratory, Vicksburg, MS.

U.S. Army Corps of Engineers (USACE). 2013. *Montana Stream Mitigation Procedure*. Omaha district. February 2013. Accessed August 2021 at: <http://www.nwo.usace.army.mil/Portals/23/docs/regulatory/MT/Mitigation/MTSMP-Revised-February%202013.pdf>

U.S. Army Corps of Engineers (USACE). 2020. *National Wetland Plant List (Version 3.5)*, prepared by U.S. Army Corps of Engineers, U.S. Army Engineer Research and Development Center, Cold Regions Research and Engineering Laboratory, Hanover, NH.

U.S. Fish and Wildlife Service (USFWS). 1999. Regional Policy on the Protection of Fens, As Amended. From Action Regional Director, Region 6. Available URL: <https://www.fws.gov/mountain-prairie/es/fen/FWSRegion6FenPolicy1999.pdf>. Site accessed February 2017.

U.S. Fish and Wildlife Service (USFWS). 2023. *Nuisance Swallows*. Accessed September 2023 at:
<https://www.fws.gov/story/nuisance-swallows>.

Woods, Alan J., Omernik, H., James, M., Nesser, John A., Sheldon, J., Comstock, J.A., Azevedo, Sandra H.
2002. *Ecoregions of Montana*. 2nd Edition. (Color poster with map, descriptive text, summary
tables, and photographs). Map scale 1:1,500,000.

Western Regional Climate Center (WRCC). 2023. Cooperative Climatological Data Summaries, Dillon Arpt,
Montana (Coop# 242404-2). Accessed September 2023 at [https://wrcc.dri.edu/cgi-
bin/cliMAIN.pl?mt2404](https://wrcc.dri.edu/cgi-bin/cliMAIN.pl?mt2404).

THIS PAGE INTENTIONALLY LEFT BLANK


Appendix A

Figures




AQUATIC RESOURCE DELINEATION REPORT
Stone Creek – North
STPP 49-1(25)9
UPN 7931

Beaverhead and Madison Counties, Montana
December 2023

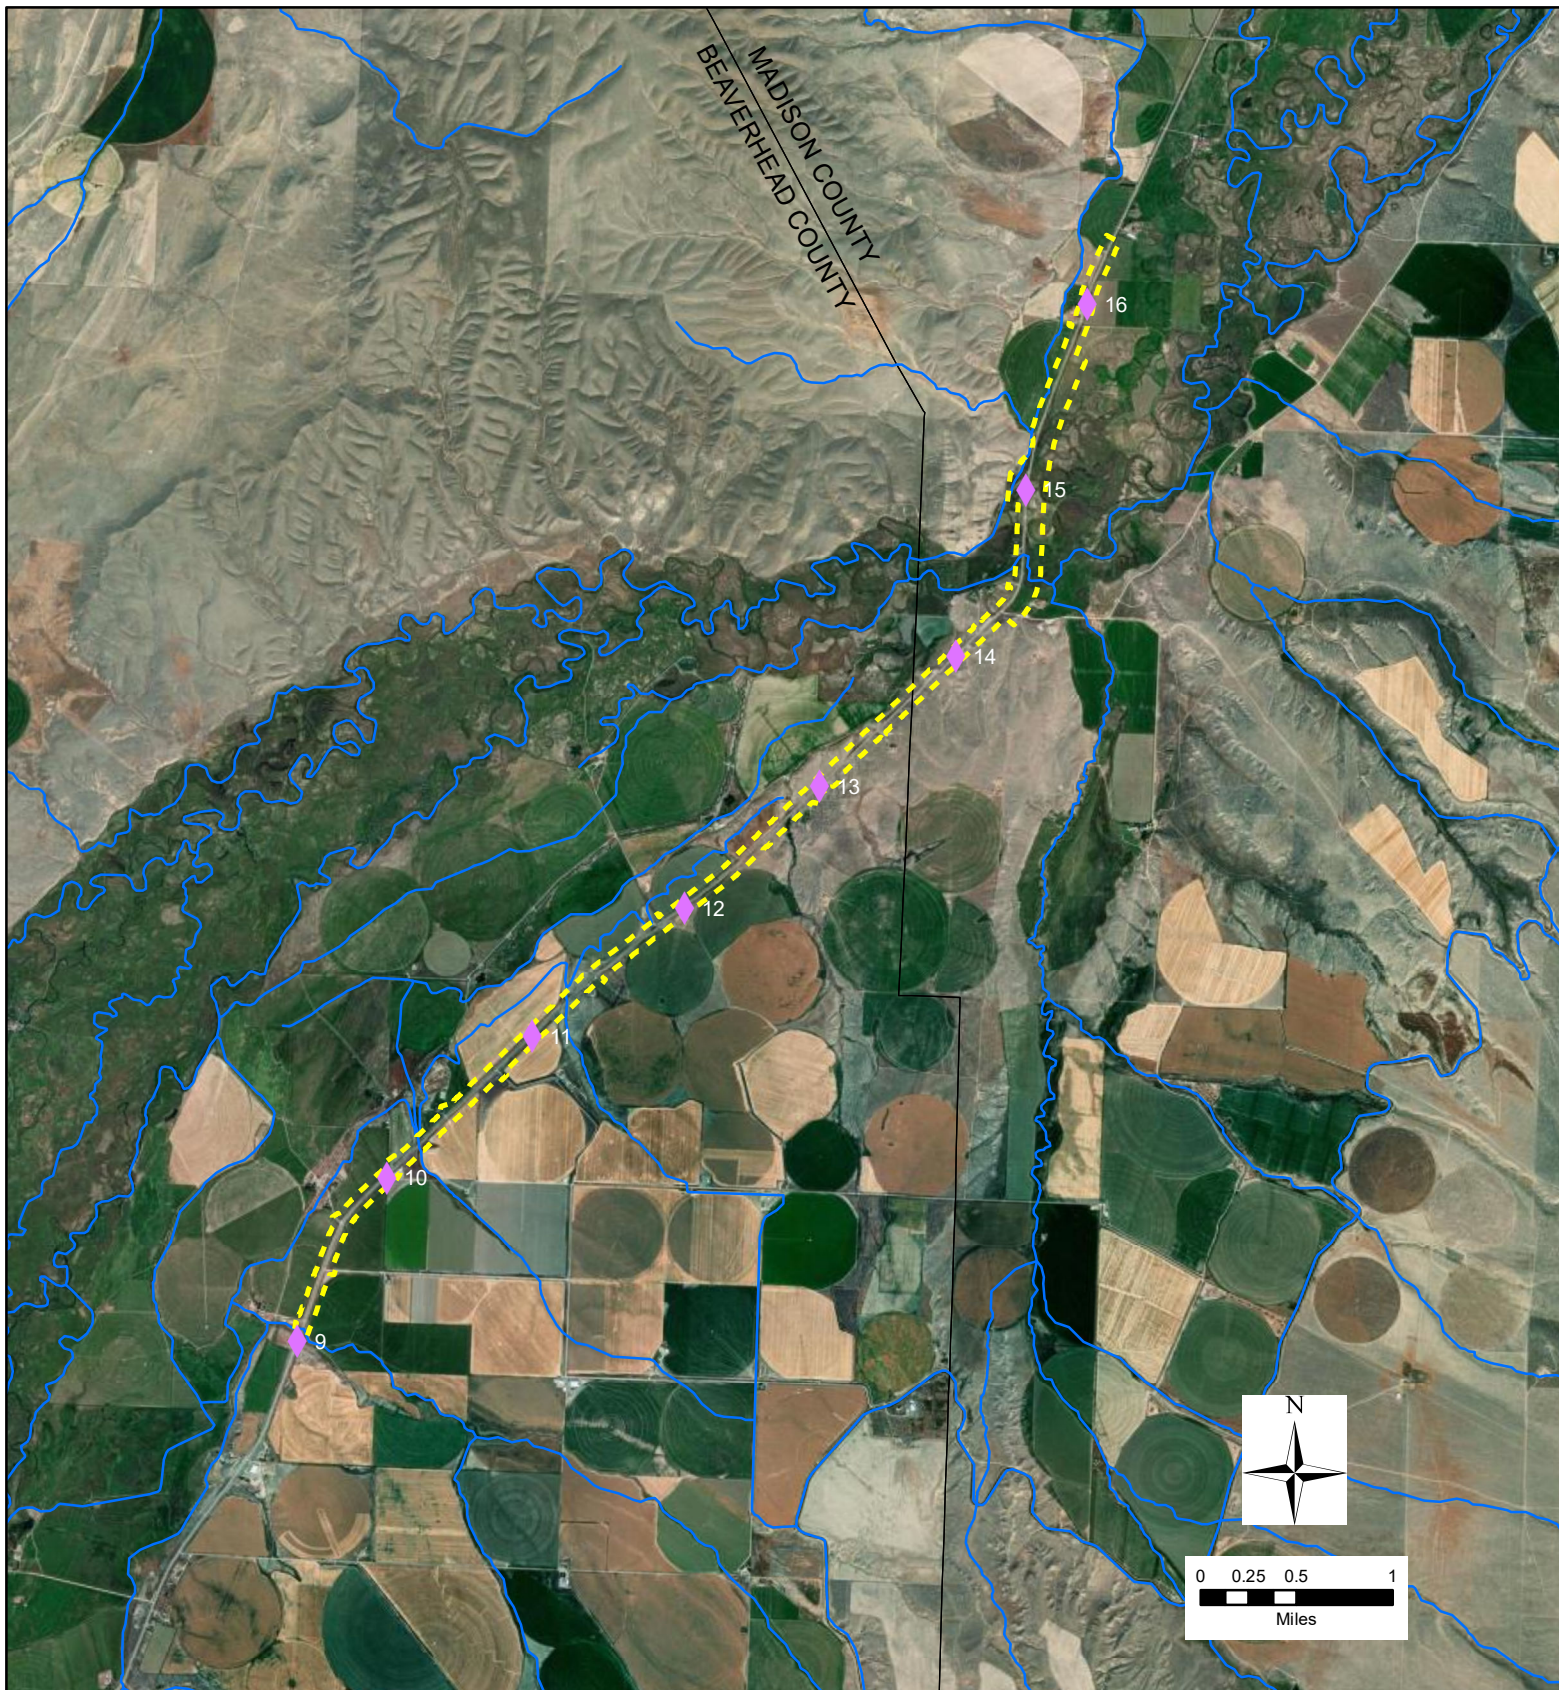THIS PAGE INTENTIONALLY LEFT BLANK



Legend

-  2023 Project Boundary
-  Stream (NHD)
-  Reference Mile Markers

STONE CREEK - NORTH
STPP 49-1(25)9, UPN 7931

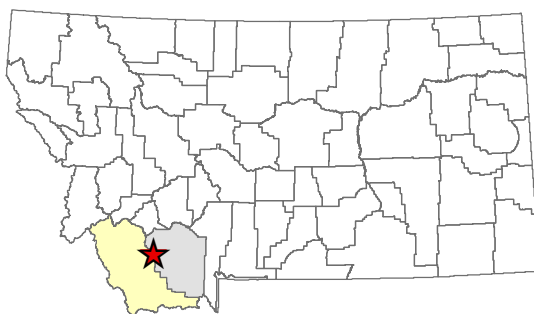


Figure 2



PROJECT VICINITY MAP

Stone Creek - North
MT. Dept. of Transportation
BEAVERHEAD AND
MADISON COUNTIES,
MONTANA



Legend

- Project Boundary
- Wetlands
- Channel
- Ditch
- Upland Data Point
- Wetland Data Point

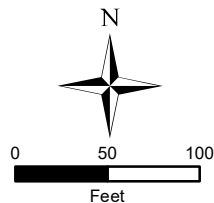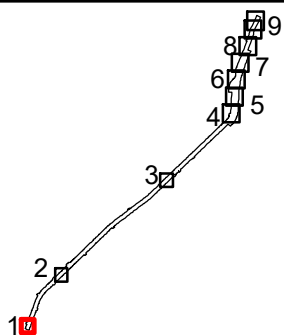

MAP 1

STONE CREEK - NORTH
WETLAND SITES

BEAVERHEAD AND
MADISON COUNTIES,
MONTANA



MT Dept. of Transportation

DECEMBER 2023



Legend

- Project Boundary
- Wetlands
- Channel
- Ditch
- Upland Data Point
- Wetland Data Point

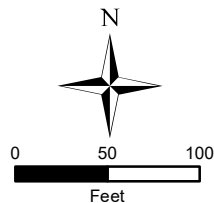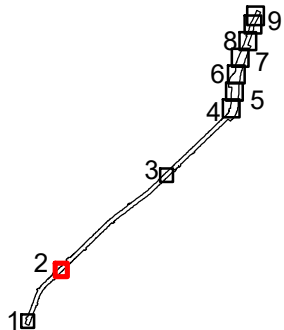

MAP 2

STONE CREEK - NORTH
WETLAND SITES







BEAVERHEAD AND
MADISON COUNTIES,
MONTANA



MT Dept. of Transportation

DECEMBER 2023



Legend

-  Project Boundary
-  Wetlands
-  Channel
-  Ditch
-  Upland Data Point
-  Wetland Data Point

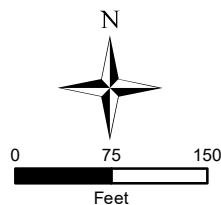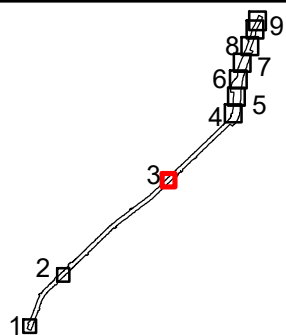


MAP 3

STONE CREEK - NORTH
WETLAND SITES







BEAVERHEAD AND
MADISON COUNTIES,
MONTANA


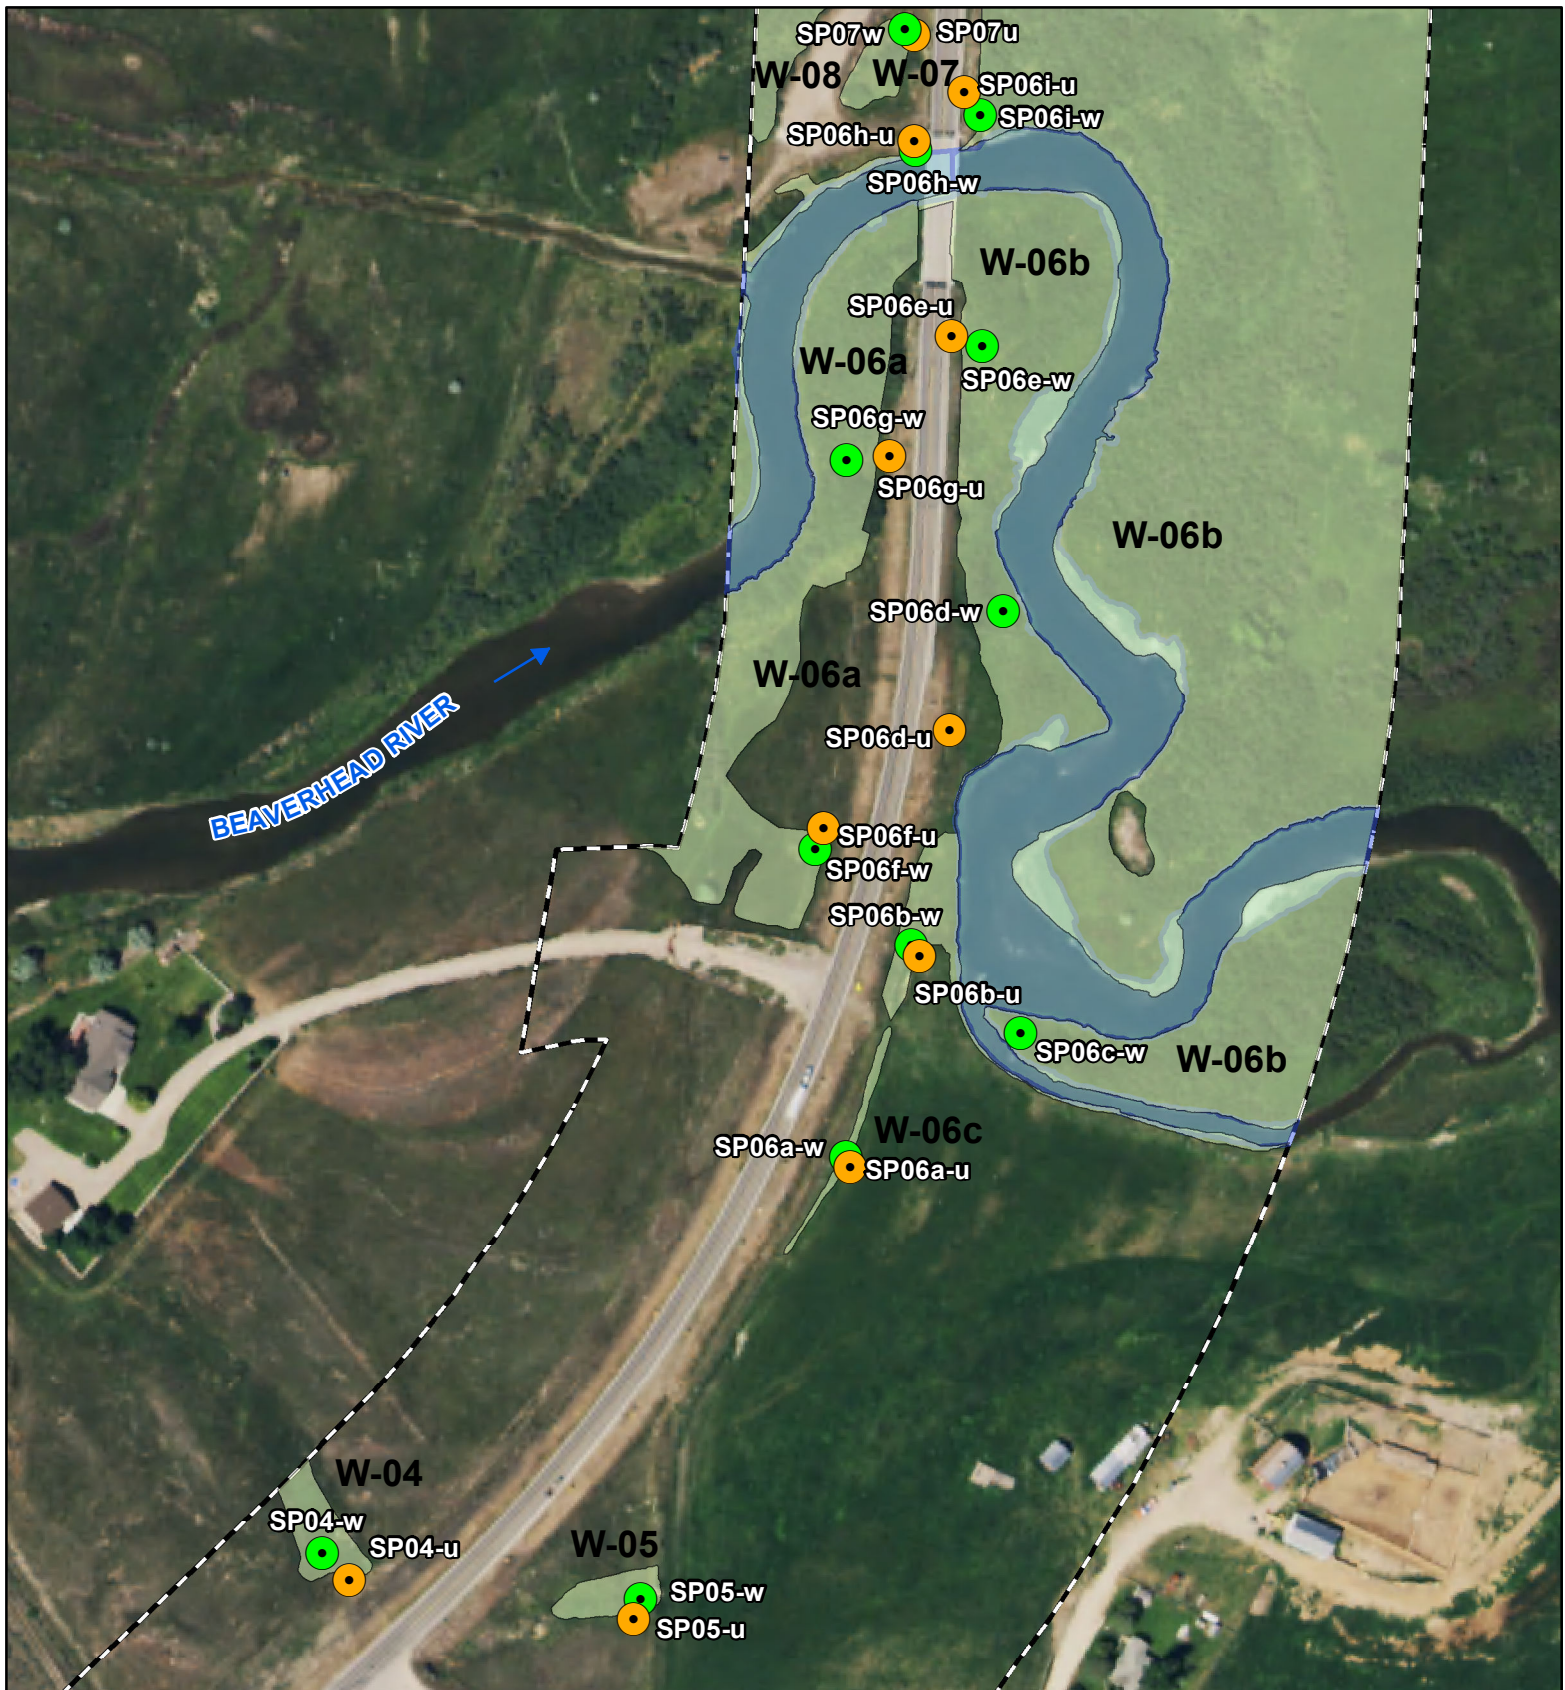
MT Dept. of Transportation

DECEMBER 2023



Legend

-  Project Boundary
-  Wetlands
-  Channel
-  Ditch
-  Upland Data Point
-  Wetland Data Point

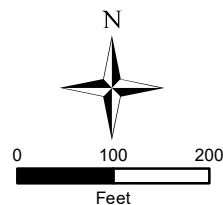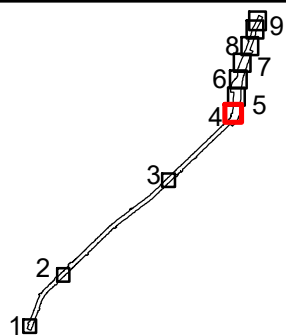


MAP 4

STONE CREEK - NORTH
WETLAND SITES







BEAVERHEAD AND
MADISON COUNTIES,
MONTANA


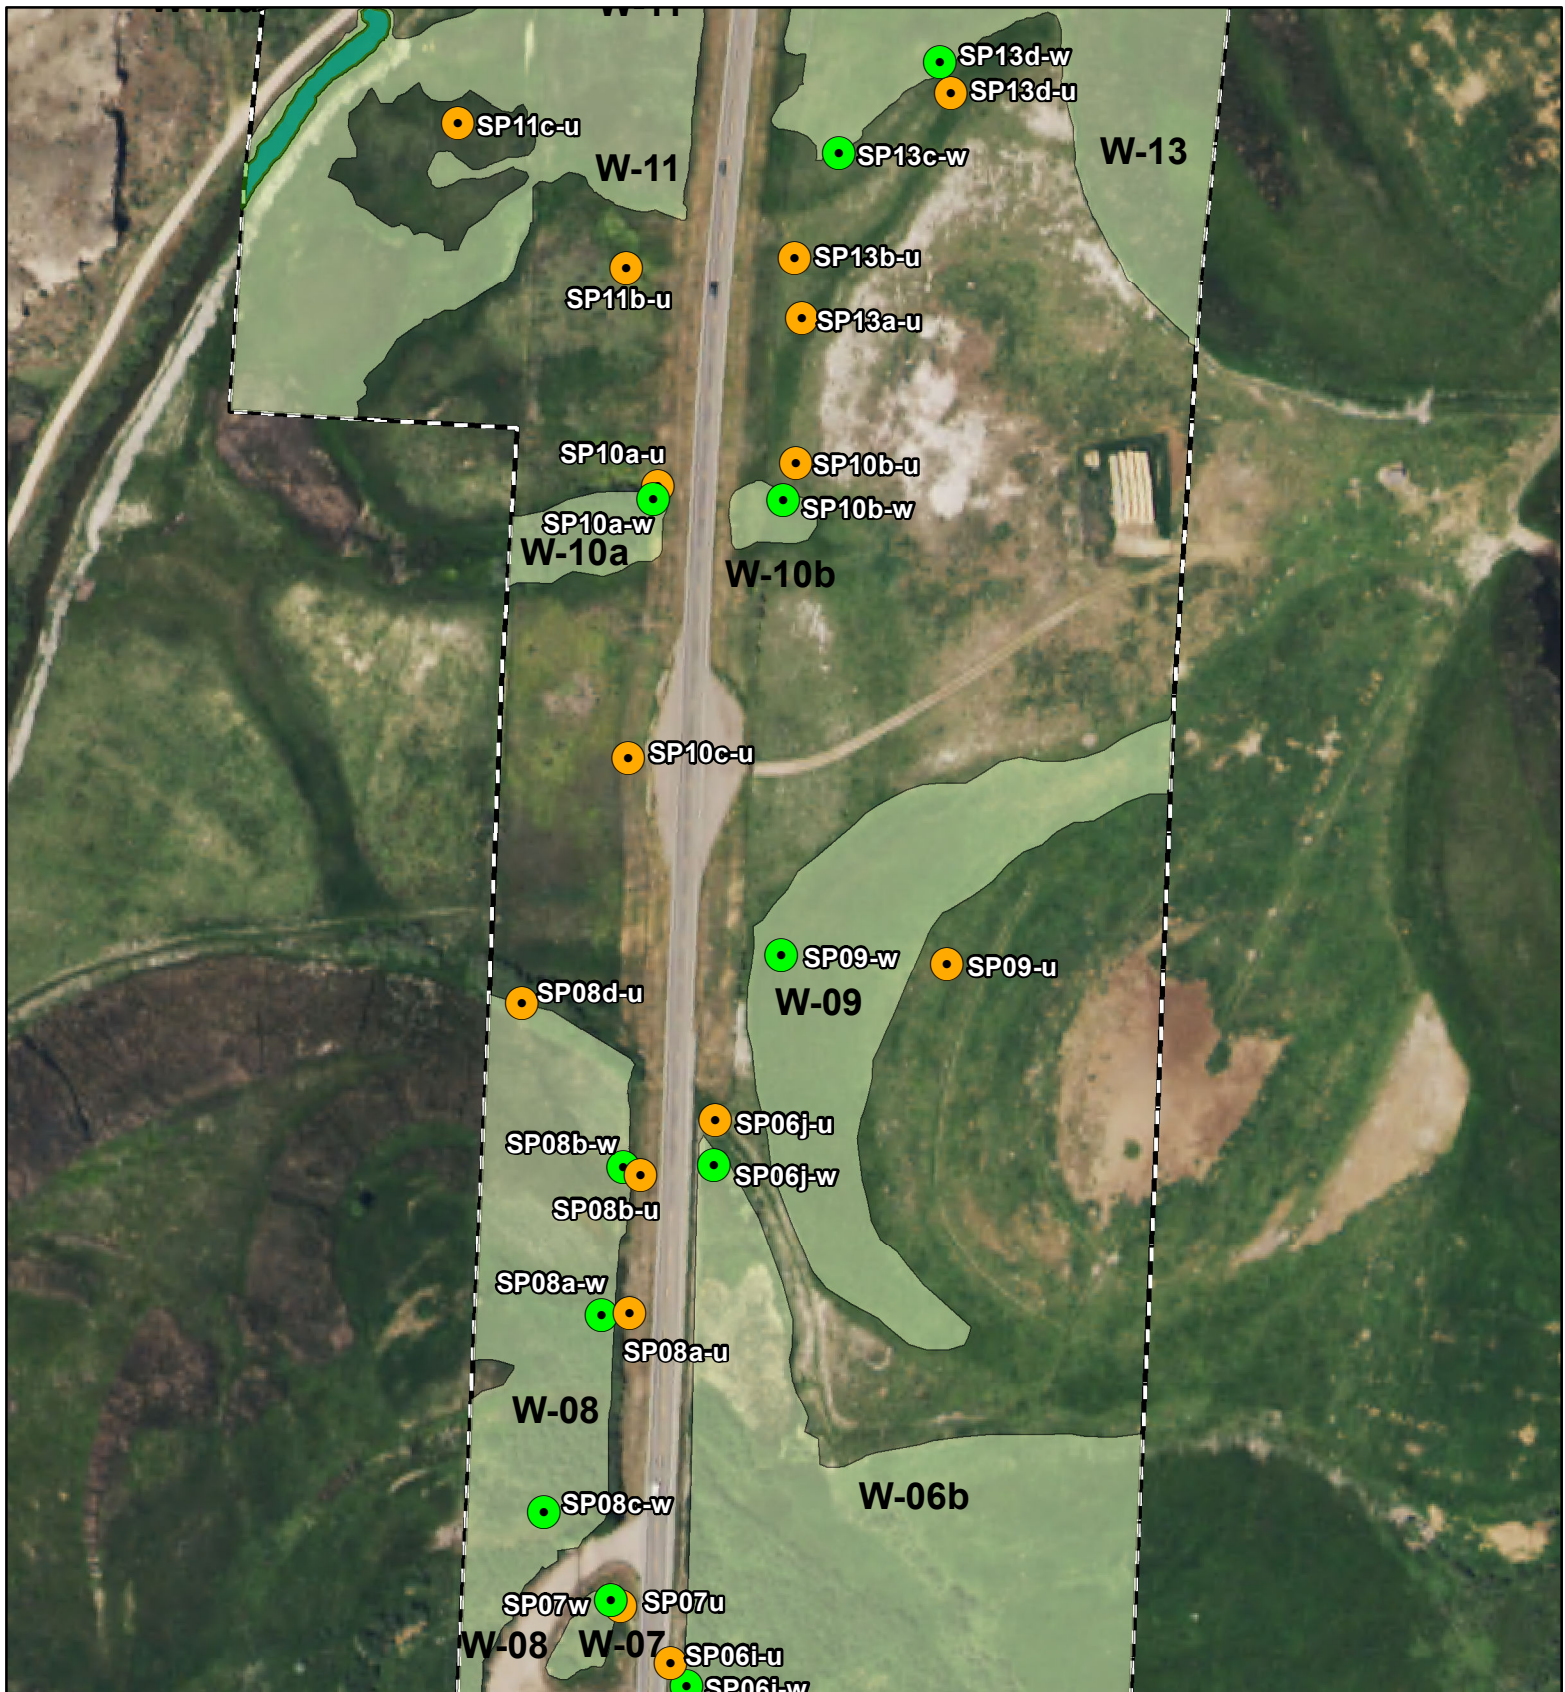
MT Dept. of Transportation

DECEMBER 2023



Legend

-  Project Boundary
-  Wetlands
-  Channel
-  Ditch
-  Upland Data Point
-  Wetland Data Point

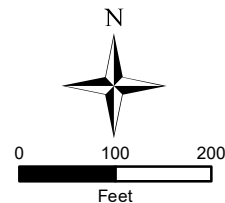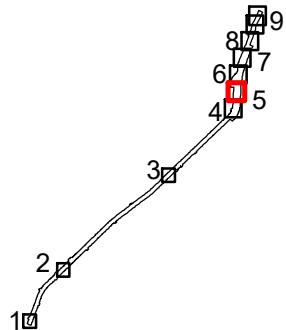

MAP 5

STONE CREEK - NORTH
WETLAND SITES







BEAVERHEAD AND
MADISON COUNTIES,
MONTANA



MT Dept. of Transportation

DECEMBER 2023



Legend

-  Project Boundary
-  Wetlands
-  Channel
-  Ditch
-  Upland Data Point
-  Wetland Data Point

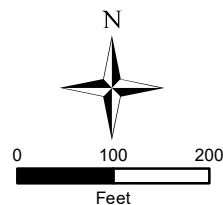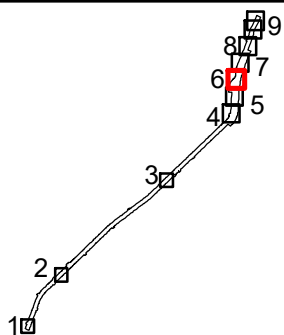


MAP 6

STONE CREEK - NORTH
WETLAND SITES







BEAVERHEAD AND
MADISON COUNTIES,
MONTANA


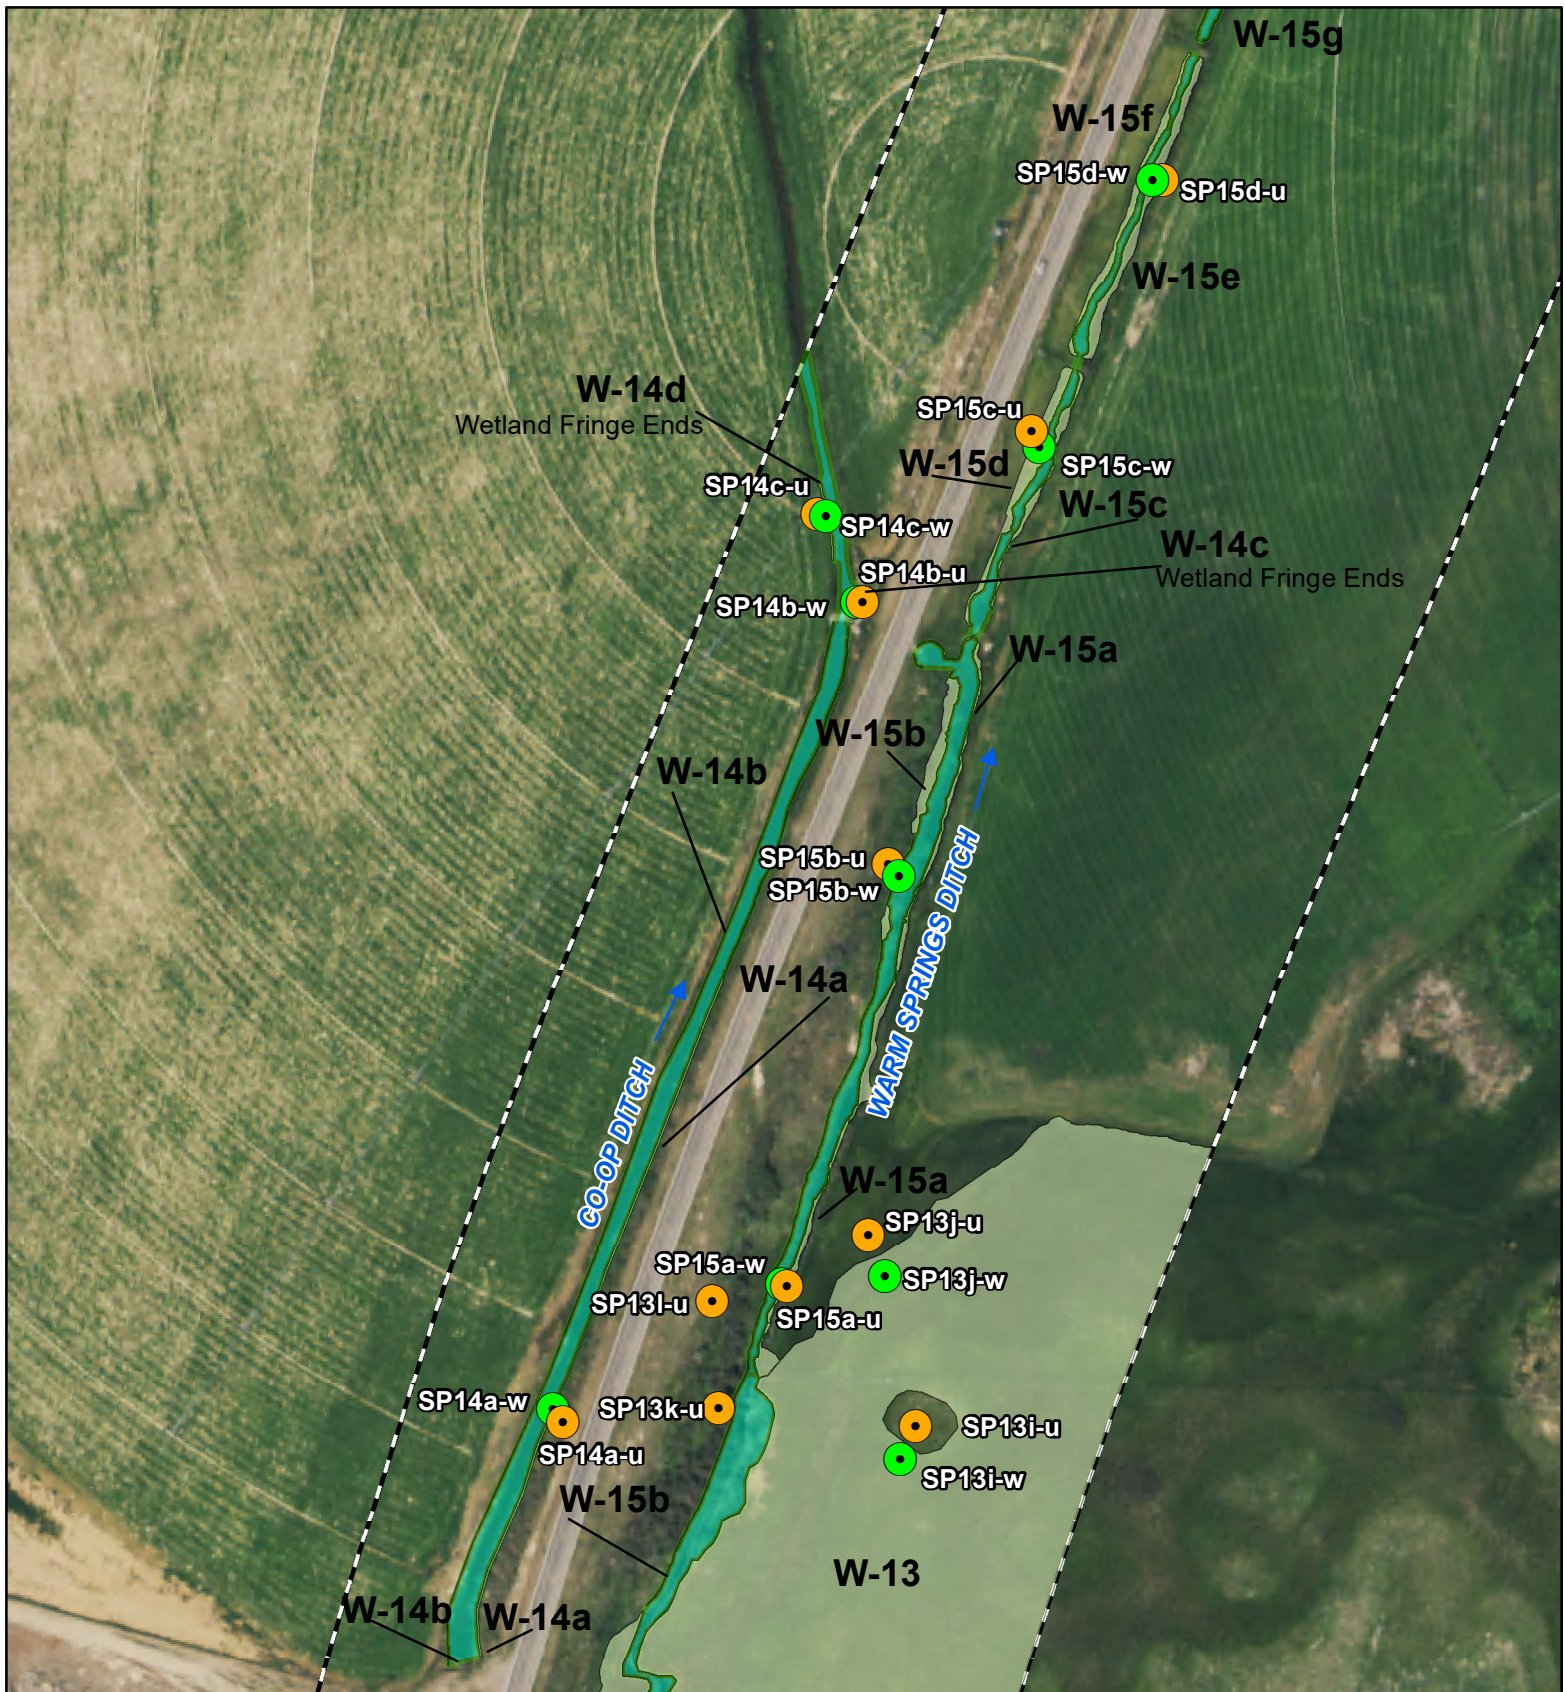
MT Dept. of Transportation

DECEMBER 2023



Legend

-  Project Boundary
-  Wetlands
-  Channel
-  Ditch
-  Upland Data Point
-  Wetland Data Point

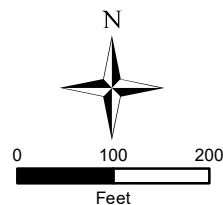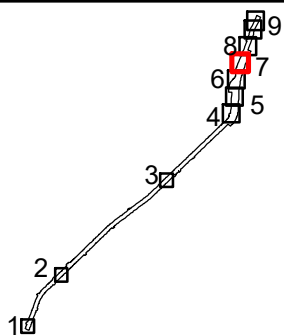


MAP 7

STONE CREEK - NORTH
WETLAND SITES







BEAVERHEAD AND
MADISON COUNTIES,
MONTANA


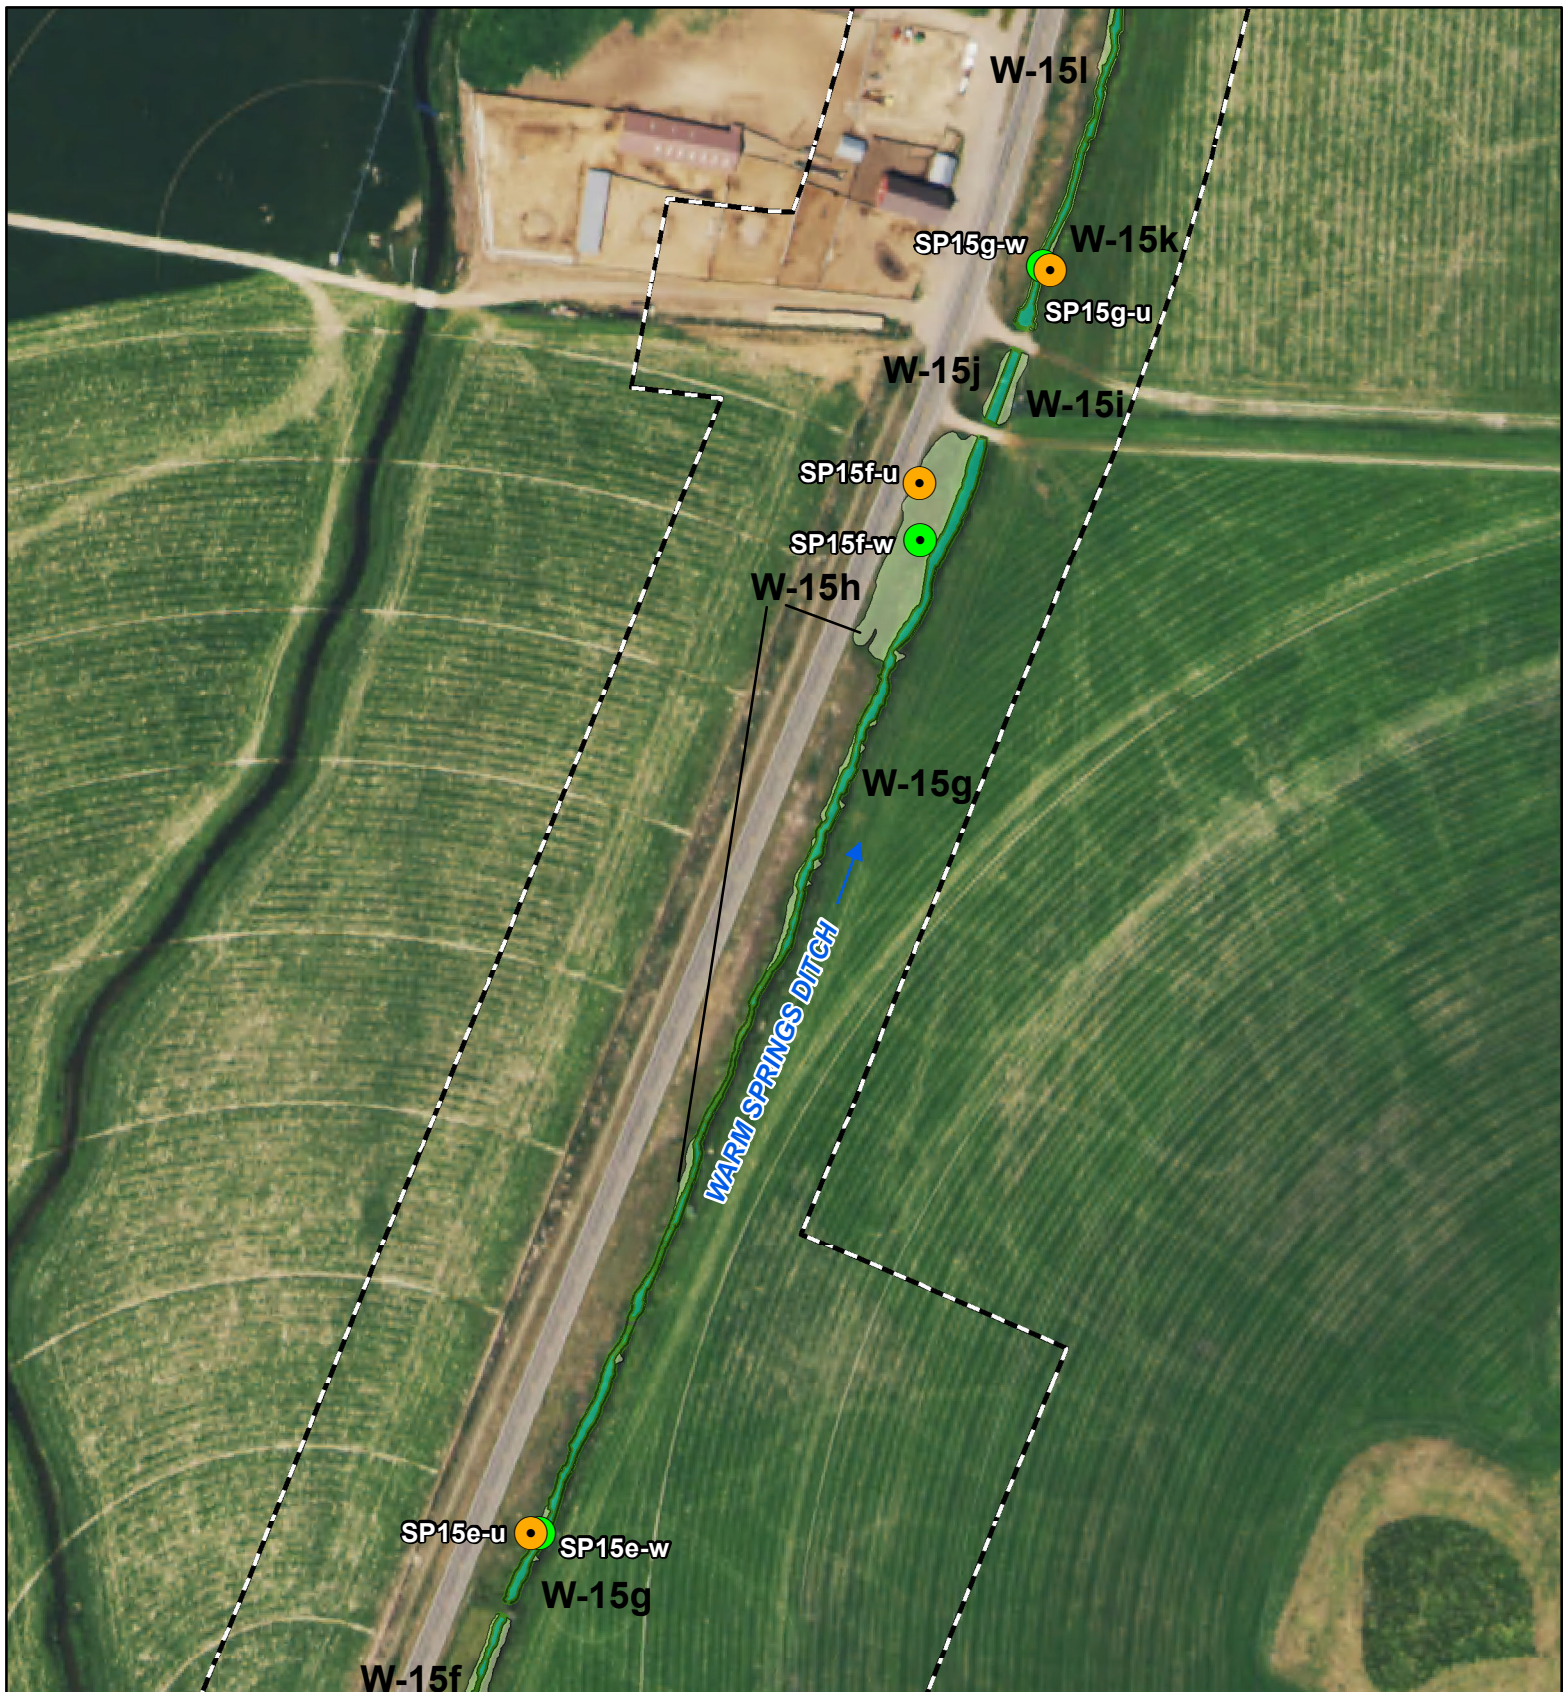
MT Dept. of Transportation

DECEMBER 2023



Legend

-  Project Boundary
-  Wetlands
-  Channel
-  Ditch
-  Upland Data Point
-  Wetland Data Point

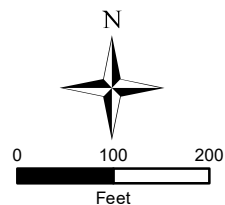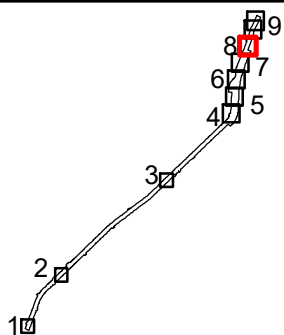


MAP 8

STONE CREEK - NORTH
WETLAND SITES

BEAVERHEAD AND
MADISON COUNTIES,
MONTANA



MT Dept. of Transportation

DECEMBER 2023

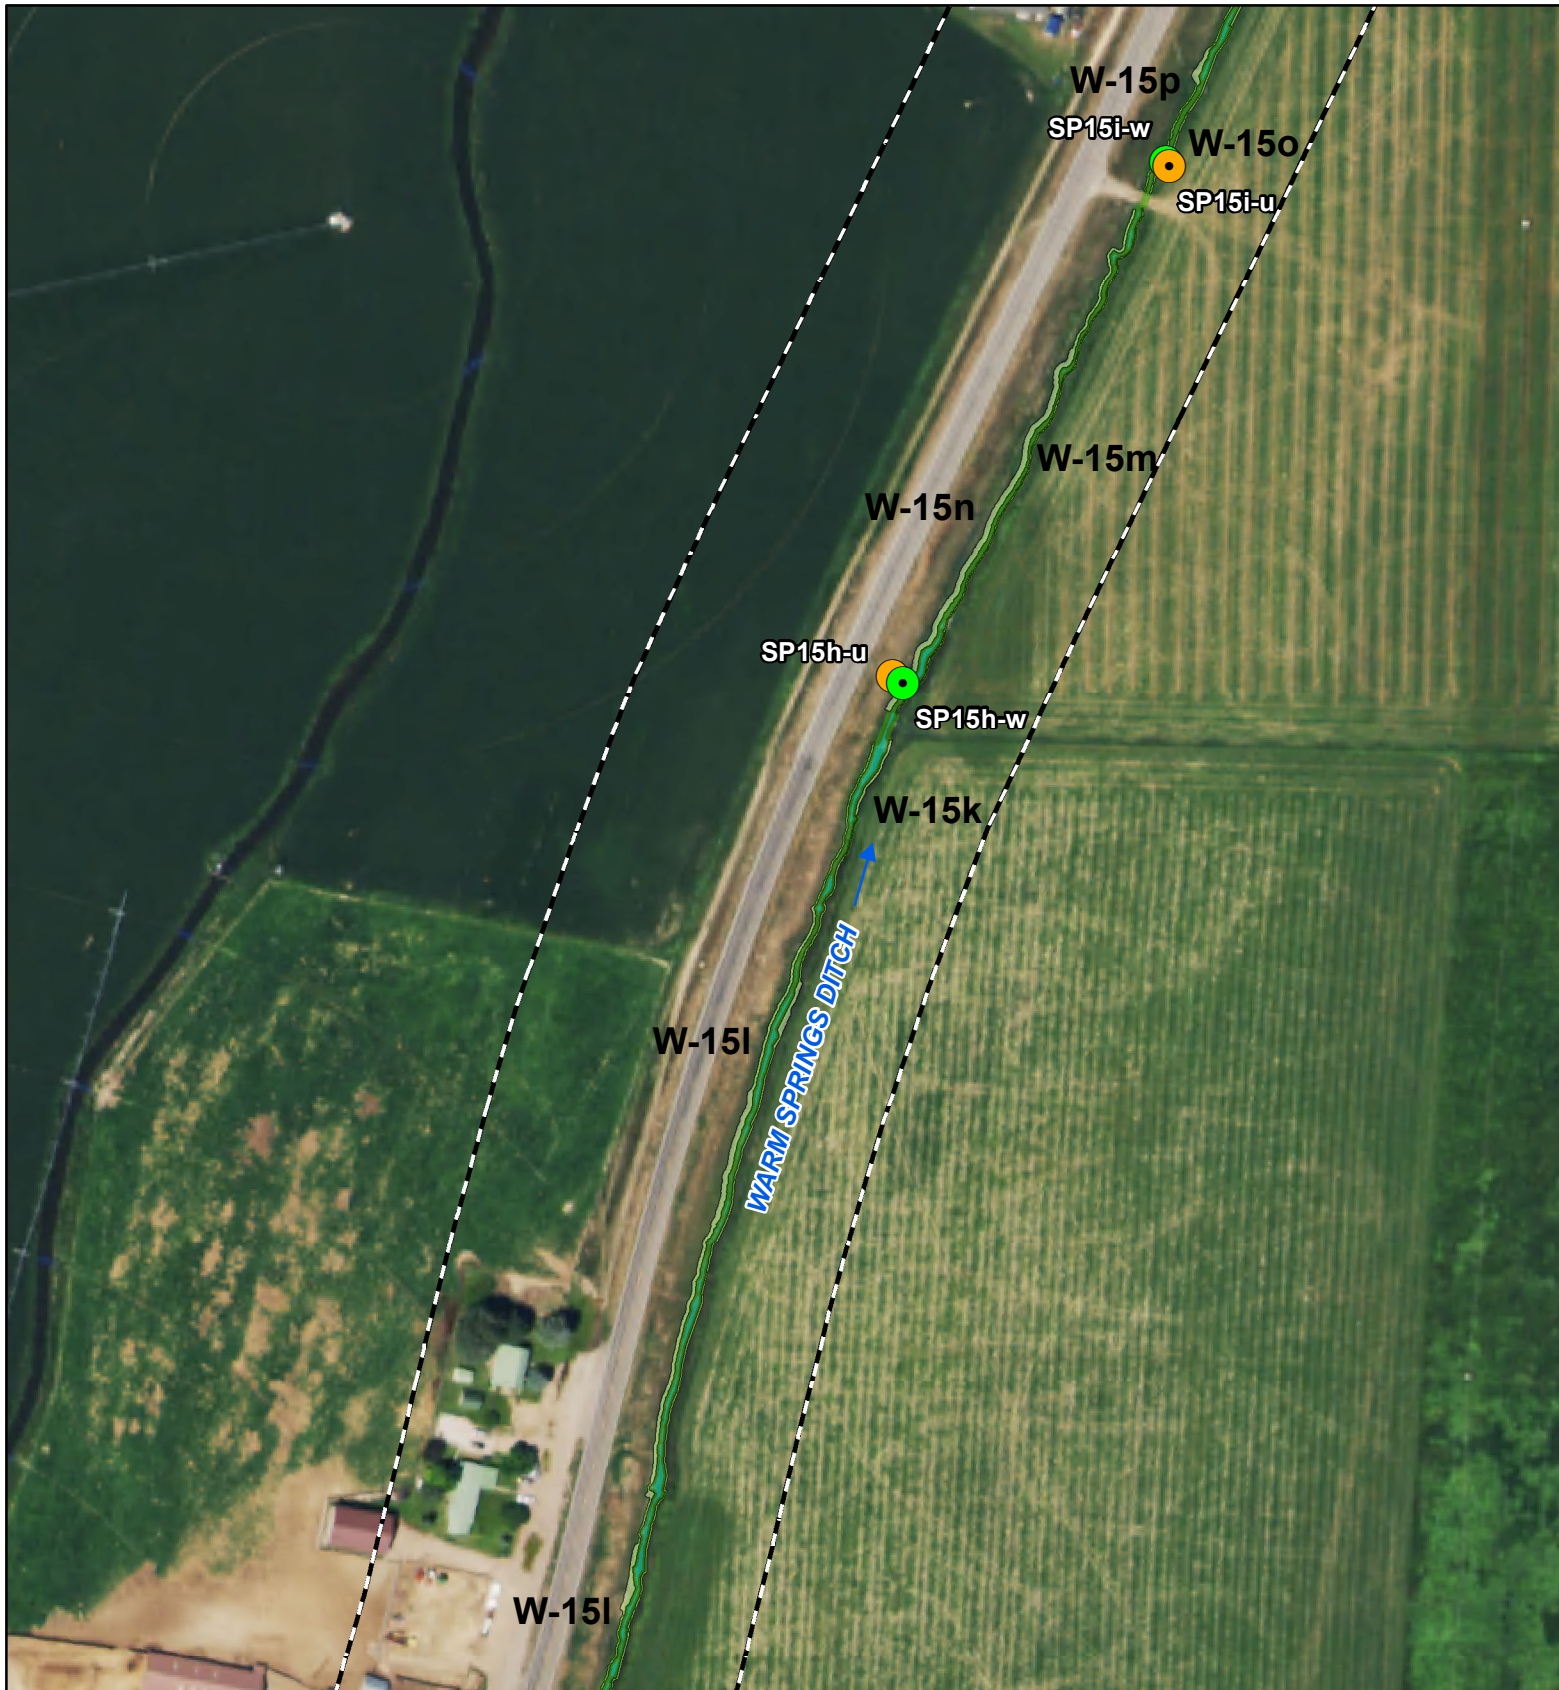

Legend

- Project Boundary
- Wetlands
- Channel
- Ditch
- Upland Data Point
- Wetland Data Point

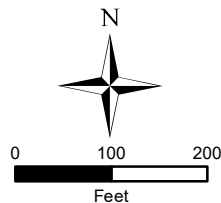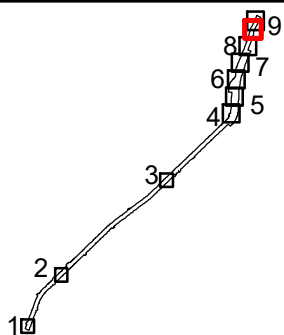

MAP 9

STONE CREEK - NORTH
WETLAND SITES







BEAVERHEAD AND
MADISON COUNTIES,
MONTANA



MT Dept. of Transportation

DECEMBER 2023



Legend

-  Project Boundary
-  Wetlands
-  Channel
-  Ditch
-  Upland Data Point
-  Wetland Data Point

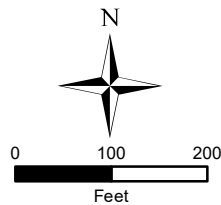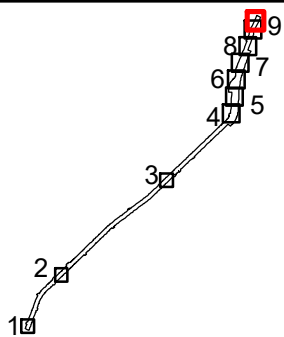

MAP 10

STONE CREEK - NORTH
WETLAND SITES

BEAVERHEAD AND
MADISON COUNTIES,
MONTANA

MT Dept. of Transportation

DECEMBER 2023



Legend

- 2023 Project Boundary
- Wetlands
- ◆ Reference Mile Markers
- W-13 Sample Pts.
- Fen Wetlands

STONE CREEK - NORTH
STPP 49-1(25)9, UPN 7931



0 75 150 300
Feet

Figure 3

MAPPED FEN WETLANDS

Stone Creek - North
MT. Dept. of Transportation

BEAVERHEAD AND
MADISON COUNTIES,
MONTANA

Appendix B

Data Forms

AQUATIC RESOURCE DELINEATION REPORT
Stone Creek – North
STPP 49-1(25)9
UPN 7931

Beaverhead and Madison Counties, Montana
December 2023

THIS PAGE INTENTIONALLY LEFT BLANK

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/10/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP01a-u
 Investigator(s): B Sandefur Section, Township, Range: S 12 T 6S R 8W
 Landform (hillslope, terrace, etc.): Lowland Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.323023 Long: -112.52683 Datum: WGS84
 Soil Map Unit Name: Havre-Glendive complex NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	

Remarks:

DP approx 20ft from Stone Creek in upland.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
0 = Total Cover			
Sapling/Shrub Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
0 = Total Cover			
Herb Stratum (Plot size: <u>5ft</u>)	Absolute % Cover	Dominant Species?	Indicator Status
1. <u>Ambrosia sp.</u>	80	<input checked="" type="checkbox"/>	NL
2. <u>Sisymbrium altissimum</u>	5	<input type="checkbox"/>	FACU
3. <u>Bassia scoparia</u>	5	<input type="checkbox"/>	FAC
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
6. _____	0	<input type="checkbox"/>	
7. _____	0	<input type="checkbox"/>	
8. _____	0	<input type="checkbox"/>	
9. _____	0	<input type="checkbox"/>	
10. _____	0	<input type="checkbox"/>	
11. _____	0	<input type="checkbox"/>	
90 = Total Cover			
Woody Vine Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
0 = Total Cover			
% Bare Ground in Herb Stratum <u>0</u>			

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:
OBL species <u>0</u>	x 1 = <u>0</u>
FACW species <u>0</u>	x 2 = <u>0</u>
FAC species <u>5</u>	x 3 = <u>15</u>
FACU species <u>5</u>	x 4 = <u>20</u>
UPL species <u>0</u>	x 5 = <u>0</u>
Column Totals: <u>10</u> (A)	<u>35</u> (B)

Prevalence Index = B/A = 3.5

Hydrophytic Vegetation Indicators:

☐ 1 - Rapid Test for Hydrophytic Vegetation

☐ 2 - Dominance Test is >50%

☐ 3 - Prevalence Index is ≤3.0¹

☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)

☐ 5 - Wetland Non-Vascular Plants

☐ Problematic Hydrophytic Vegetation¹ (Explain)

¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
---------------------------------	------------------------------	--

Remarks:

Upland sample point dominated by ragweed.

SOIL

Sampling Point: SP01a-u

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-6	10YR	4/4					Silt Loam	
6-14	10YR	5/3					Sandy Loam	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|---|
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒

Remarks:

No redox in upper 14in.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Outside influence of Stone Creek water table, potentially with occasional flooding of very short duration.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/11/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP01a-w
 Investigator(s): B Sandefur Section, Township, Range: S 12 T 6S R 8W
 Landform (hillslope, terrace, etc.): Shoreline Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.32306 Long: -112.526928 Datum: WGS84
 Soil Map Unit Name: Havre-Glendive complex NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	

Remarks:
 DP in approx 5ft wide emergent riparian wetland along Stone Creek.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
		0 = Total Cover		
Sapling/Shrub Stratum (Plot size: _____)	0	<input type="checkbox"/>		
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
5. _____	0	<input type="checkbox"/>		
		0 = Total Cover		
Herb Stratum (Plot size: 5ft)	90	<input checked="" type="checkbox"/>	FAC	
1. <u>Alopecurus arundinaceus</u>	90	<input checked="" type="checkbox"/>	FAC	
2. <u>Veronica anagallis-aquatica</u>	5	<input type="checkbox"/>	OBL	
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
5. _____	0	<input type="checkbox"/>		
6. _____	0	<input type="checkbox"/>		
7. _____	0	<input type="checkbox"/>		
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
		95 = Total Cover		
Woody Vine Stratum (Plot size: _____)	0	<input type="checkbox"/>		
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
		0 = Total Cover		
% Bare Ground in Herb Stratum	0			

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 1 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:
OBL species <u>5</u>	x 1 = <u>5</u>
FACW species <u>0</u>	x 2 = <u>0</u>
FAC species <u>90</u>	x 3 = <u>270</u>
FACU species <u>0</u>	x 4 = <u>0</u>
UPL species <u>0</u>	x 5 = <u>0</u>
Column Totals: <u>95</u> (A)	<u>275</u> (B)
Prevalence Index = B/A = <u>2.89474</u>	

Hydrophytic Vegetation Indicators:

☐ 1 - Rapid Test for Hydrophytic Vegetation

☒ 2 - Dominance Test is >50%

☒ 3 - Prevalence Index is ≤3.0¹

☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)

☐ 5 - Wetland Non-Vascular Plants¹

☐ Problematic Hydrophytic Vegetation¹ (Explain)

¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☒ No ☐

Remarks:
 Emergent wetland adjacent to the creek.

Sampling Point: SP01a-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Soil rocky at 12in

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☒ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Wetland Hydrology Present? Yes ☒ No ☐

Saturated to surface. Stone Creek is flowing to the north a few feet from the sample point.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Beaverhead County Sampling Date: 2023-07-31
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP01b-U
 Investigator(s): McEldowney Section, Township, Range: S12 T6S R8W
 Landform (hillslope, terrace, etc.): Alluvial Terrace Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.322942 Long: -112.527641 Datum: WGS 84
 Soil Map Unit Name: 217B - Havre-Glendive complex, 0 to 4 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland point.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>35</u> x 3 = <u>105</u> FACU species <u>35</u> x 4 = <u>140</u> UPL species <u>5</u> x 5 = <u>25</u> Column Totals: <u>75</u> (A) <u>270</u> (B) Prevalence Index = B/A = <u>3.60</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Iva axillaris</u>	<u>35</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Bassia scoparia</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
3. <u>Agropyron cristatum</u>	<u>5</u>		<u>UPL</u>	
4. <u>Elymus repens</u>	<u>5</u>		<u>FAC</u>	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>75</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>25</u>				
Remarks: Upland point dominated by weedy species.				

SOIL

Sampling Point: SP01b-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 15	10YR 4/2	100					Sandy Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present?	Yes _____ No <input checked="" type="checkbox"/>	Depth (inches): _____
Water Table Present?	Yes _____ No <input checked="" type="checkbox"/>	Depth (inches): _____
Saturation Present?	Yes _____ No <input checked="" type="checkbox"/>	Depth (inches): _____

(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Beaverhead County Sampling Date: 2023-07-31
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP01b-W
 Investigator(s): McEldowney Section, Township, Range: S12 T6S R8W
 Landform (hillslope, terrace, etc.): Structural Bench Local relief (concave, convex, none): Convex Slope (%): 25
 Subregion (LRR): E 44 Lat: 45.322971 Long: -112.527707 Datum: WGS 84
 Soil Map Unit Name: 217B - Havre-Glendive complex, 0 to 4 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes _____ No _____ (If no, explain in Remarks.)
 Are Vegetation _____, Soil _____, or Hydrology _____ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No _____
 Are Vegetation _____, Soil _____, or Hydrology _____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No _____	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No _____
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No _____	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No _____	
Remarks: Bank full bench adjacent to Stone Creek.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
_____ = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>85</u> x 2 = <u>170</u> FAC species <u>62</u> x 3 = <u>186</u> FACU species <u>2</u> x 4 = <u>8</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>149</u> (A) <u>364</u> (B) Prevalence Index = B/A = <u>2.44</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Salix exigua</u>	<u>85</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	Hydrophytic Vegetation Indicators: _____ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ _____ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) _____ 5 - Wetland Non-Vascular Plants ¹ _____ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
5. _____	_____	_____	_____	
_____ = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				
1. <u>Elymus repens</u>	<u>45</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
2. <u>Bassia scoparia</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No _____
3. <u>Alopecurus pratensis</u>	<u>2</u>	_____	<u>FAC</u>	
4. <u>Chenopodium album</u>	<u>1</u>	_____	<u>FACU</u>	
5. <u>Cynoglossum officinale</u>	<u>1</u>	_____	<u>FACU</u>	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
_____ = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
_____ = Total Cover				
% Bare Ground in Herb Stratum <u>36</u>				
Remarks:				
PSS wetland dominated by coyote willow.				

SOIL

Sampling Point: SP01b-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 2								Litter
2 - 16	10YR 4/2	98	10YR 4/6	2	C	PL	Sandy Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix with oxidized rhizospheres.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input checked="" type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 12

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Narrow bankfull bench adjacent to Stone Creek. Stone Creek is flowing 2 feet North of the soil pit.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Beaverhead County Sampling Date: 2023-07-31
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP02-U
 Investigator(s): McEldowney Section, Township, Range: S06 T6S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.336914 Long: -112.515477 Datum: WGS 84
 Soil Map Unit Name: 335E - Kalsted-Scravo, stony-Cabbart complex, 15 to 45 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point at toe of road fill slope.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>15</u> x 3 = <u>45</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>20</u> x 5 = <u>100</u> Column Totals: <u>35</u> (A) <u>145</u> (B) Prevalence Index = B/A = <u>4.14</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Bassia scoparia</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Bromus inermis</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>UPL</u>	
3. <u>Agropyron cristatum</u>	<u>5</u>	<input type="checkbox"/>	<u>UPL</u>	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>35</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>65</u>				
Remarks: Upland point dominated by kochia and smooth brome.				

SOIL

Sampling Point: SP02-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 14	10YR 4/2						Loamy Sand	Gravelly
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Beaverhead Sampling Date: 6/10/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP02-w
 Investigator(s): B Sandefur Section, Township, Range: S 6 T 6S R 7W
 Landform (hillslope, terrace, etc.): Gulch or Gully Local relief (concave, convex, none): concave Slope (%): 1.74
 Subregion (LRR): LRR E Lat: 45.3369216666667 Long: -112.515448333333 Datum: WGS84
 Soil Map Unit Name: Kalsted-Scravo, stony Cabbart complex NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
---	---

Remarks:

DP in 2ft wide swale with very narrow wetland buffer.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:																
1. _____	0	<input type="checkbox"/>	_____	Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A/B)																
2. _____	0	<input type="checkbox"/>	_____																	
3. _____	0	<input type="checkbox"/>	_____																	
4. _____	0	<input type="checkbox"/>	_____																	
0 = Total Cover																				
Sapling/Shrub Stratum (Plot size: _____)				Prevalence Index worksheet: <table style="width: 100%; border-collapse: collapse;"> <tr> <th style="width: 40%;">Total % Cover of:</th> <th style="width: 60%;">Multiply by:</th> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>100</u></td> <td>x 3 = <u>300</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>100</u></td> <td>(A) <u>300</u> (B)</td> </tr> <tr> <td colspan="2" style="text-align: center;">Prevalence Index = B/A = <u>3</u></td> </tr> </table>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>100</u>	x 3 = <u>300</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>100</u>	(A) <u>300</u> (B)	Prevalence Index = B/A = <u>3</u>	
Total % Cover of:	Multiply by:																			
OBL species <u>0</u>	x 1 = <u>0</u>																			
FACW species <u>0</u>	x 2 = <u>0</u>																			
FAC species <u>100</u>	x 3 = <u>300</u>																			
FACU species <u>0</u>	x 4 = <u>0</u>																			
UPL species <u>0</u>	x 5 = <u>0</u>																			
Column Totals: <u>100</u>	(A) <u>300</u> (B)																			
Prevalence Index = B/A = <u>3</u>																				
1. _____	0	<input type="checkbox"/>	_____																	
2. _____	0	<input type="checkbox"/>	_____																	
3. _____	0	<input type="checkbox"/>	_____																	
4. _____	0	<input type="checkbox"/>	_____																	
5. _____	0	<input type="checkbox"/>	_____																	
0 = Total Cover																				
Herb Stratum (Plot size: <u>5ft</u>)				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.																
1. <u>Alopecurus arundinaceus</u>	100	<input checked="" type="checkbox"/>	FAC																	
2. <u>Ranunculus sp.</u>	1	<input type="checkbox"/>	NL																	
3. _____	0	<input type="checkbox"/>	_____																	
4. _____	0	<input type="checkbox"/>	_____																	
5. _____	0	<input type="checkbox"/>	_____																	
6. _____	0	<input type="checkbox"/>	_____																	
7. _____	0	<input type="checkbox"/>	_____																	
8. _____	0	<input type="checkbox"/>	_____																	
9. _____	0	<input type="checkbox"/>	_____																	
10. _____	0	<input type="checkbox"/>	_____																	
11. _____	0	<input type="checkbox"/>	_____																	
101 = Total Cover																				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>																
1. _____	0	<input type="checkbox"/>	_____																	
2. _____	0	<input type="checkbox"/>	_____																	
0 = Total Cover																				
% Bare Ground in Herb Stratum <u>0</u>																				

Remarks:

Emergent wetland in a drainage.

[illegible]

Wetland Hydrology Indicators:		
Primary Indicators (minimum of one required; check all that apply)		
<input type="checkbox"/> Surface Water (A1) <input type="checkbox"/> High Water Table (A2) <input type="checkbox"/> Saturation (A3) <input type="checkbox"/> Water Marks (B1) <input checked="" type="checkbox"/> Sediment Deposits (B2) <input checked="" type="checkbox"/> Drift Deposits (B3) <input type="checkbox"/> Algal Mat or Crust (B4) <input type="checkbox"/> Iron Deposits (B5) <input checked="" type="checkbox"/> Surface Soil Cracks (B6) <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) <input type="checkbox"/> Salt Crust (B11) <input type="checkbox"/> Aquatic Invertebrates (B13) <input type="checkbox"/> Hydrogen Sulfide Odor (C1) <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) <input type="checkbox"/> Presence of Reduced Iron (C4) <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) <input type="checkbox"/> Other (Explain in Remarks)	Secondary Indicators (2 or more required) <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) <input checked="" type="checkbox"/> Drainage Patterns (B10) <input type="checkbox"/> Dry-Season Water Table (C2) <input checked="" type="checkbox"/> Saturation Visible on Aerial Imagery (C9) <input checked="" type="checkbox"/> Geomorphic Position (D2) <input type="checkbox"/> Shallow Aquitard (D3) <input type="checkbox"/> FAC-Neutral Test (D5) <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) <input type="checkbox"/> Frost-Heave Hummocks (D7)
Field Observations:		
Surface Water Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Depth (inches): _____ Water Table Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Depth (inches): _____ Saturation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Depth (inches): _____ (includes capillary fringe)	Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:		
Remarks:		
Site receives and accumulates runoff from the adjacent hillsides.		

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek-North City/County: Beaverhead Sampling Date: 8/22/2015
 Applicant/Owner: MDT State: Montana Sampling Point: SP03a-u
 Investigator(s): R McEldowney Section, Township, Range: S 33 T 5S R 7W
 Landform (hillslope, terrace, etc.): Hillside Local relief (concave, convex, none): concave Slope (%): 5
 Subregion (LRR): LRR E Lat: 45.362995 Long: -112.476945 Datum: NAD83
 Soil Map Unit Name: 37E - Crago-Scrago complex, 15-45% slopes NWI classification: none

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	

Remarks: Confirmed in 2023.

Upland sample point near toe of slope, upgradient from the wetland boundary.

VEGETATION - Use scientific names of plant

Tree Stratum	Plot size (30 Foot Radius)	Absolute % Cover:	Dominant Species?	Indicator Status	Dominance Test worksheet Number of Dominant Species that are OBL, FACW or FAC: 0 (A) Total Number of Dominant Species Across All Strata: 1 (B) Percent of Dominant Species That Are OBL, FACW, or FAC: 0 % (A/B)														
Sapling/Shrub Stratum	Plot size (15 Foot Radius)					Prevalence Index worksheet <table border="1"> <thead> <tr> <th>Total % Cover of:</th> <th>Multiply by:</th> </tr> </thead> <tbody> <tr> <td>OBL species 0 X 1</td> <td>0</td> </tr> <tr> <td>FACW species 0 X 2</td> <td>0</td> </tr> <tr> <td>FAC species 1 X 3</td> <td>3</td> </tr> <tr> <td>FACU species 61 X 4</td> <td>244</td> </tr> <tr> <td>UPL species 0 X 5</td> <td>0</td> </tr> <tr> <td>Column Totals 62 (A)</td> <td>247 (B)</td> </tr> </tbody> </table> Prevalence Index = B/A = 3.98387	Total % Cover of:	Multiply by:	OBL species 0 X 1	0	FACW species 0 X 2	0	FAC species 1 X 3	3	FACU species 61 X 4	244	UPL species 0 X 5	0	Column Totals 62 (A)
Total % Cover of:	Multiply by:																		
OBL species 0 X 1	0																		
FACW species 0 X 2	0																		
FAC species 1 X 3	3																		
FACU species 61 X 4	244																		
UPL species 0 X 5	0																		
Column Totals 62 (A)	247 (B)																		
Herbaceous Stratum	Plot size (5 Foot Radius)				Hydrophytic Vegetation Indicators <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is <= 3.0 <input type="checkbox"/> 4 - Morphological Adaptations (Provide supporting data in remarks or on separate sheet. <input type="checkbox"/> 5 - Wetland Non-Vascular Plants <input type="checkbox"/> Problematic Hydrophytic Vegetation (Explain) Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic for #3, 4, 5. Hydrophytic Vegetation Present? Yes <input type="checkbox"/> NO <input checked="" type="checkbox"/>														
Agropyron cristatum		10	<input type="checkbox"/>	NL															
Cirsium arvense		1	<input type="checkbox"/>	FAC															
Pascopyrum smithii		60	<input checked="" type="checkbox"/>	FACU															
Poa secunda		1	<input type="checkbox"/>	FACU															
unidentified forb		1	<input type="checkbox"/>																
Woody Vine Stratum	Plot size (30 Foot Radius)																		
Percent Bare Ground	0																		

Remarks:

Sample point is dominated by western wheatgrass.

SOIL

Sampling Point: SP03a-u

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-16	10YR	5/4	100				Sandy Loam	Soil was dry.

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒

Remarks:

No hydric indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? (includes capillary fringe) Yes ☐ No ☒ Depth (inches): _____

Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek-North City/County: Beaverhead Sampling Date: 8/22/2015
 Applicant/Owner: MDT State: Montana Sampling Point: SP03a-w 1
 Investigator(s): R McEldowney Section, Township, Range: S 33 T 5S R 7W
 Landform (hillslope, terrace, etc.): Flat Local relief (concave, convex, none): concave Slope (%):
 Subregion (LRR): LRR E Lat: 45.362982 Long: -112.47697 Datum: NAD83
 Soil Map Unit Name: 37E - Crago-Scrago complex, 15-45% slopes NWI classification: none

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	

Remarks:

PEM, Depressional/Riverine. Sample point is in the cattail marsh portion of a pond on south side of road near 5 Rivers Lodge. Confirmed in 2023.

VEGETATION - Use scientific names of plant

Tree Stratum	Plot size (30 Foot Radius)	Absolute % Cover:	Dominant Species?	Indicator Status	Dominance Test worksheet Number of Dominant Species that are OBL, FACW or FAC: 2 (A) Total Number of Dominant Species Across All Strata: 2 (B) Percent of Dominant Species That Are OBL, FACW, or FAC: 100 % (A/B)
Sapling/Shrub Stratum Plot size 60 Foot Radius)					
Herbaceous Stratum Plot size (3 Foot Radius)					
Alopecurus arundinaceus	5	<input type="checkbox"/>	FAC		Hydrophytic Vegetation Indicators <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is <= 3.0 <input type="checkbox"/> 4 - Morphological Adaptations (Provide supporting data in remarks or on separate sheet. <input type="checkbox"/> 5 - Wetland Non-Vascular Plants <input type="checkbox"/> Problematic Hydrophytic Vegetation (Explain) Indicators of hydric sil and wetland hydrology must be present, unless disturbed or problematic for #3, 4, 5.
Cirsium arvense	5	<input type="checkbox"/>	FAC		
Epilobium ciliatum	1	<input type="checkbox"/>	FACW		
Mentha arvensis	20	<input checked="" type="checkbox"/>	FACW		
Typha latifolia	60	<input checked="" type="checkbox"/>	OBL		
Woody Vine Stratum Plot size (30 Foot Radius)					Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> NO <input type="checkbox"/>
Percent Bare Ground 0					

Remarks:

Fringe around pond.

SOIL

Sampling Point: SP03a-w1

Profile Description: (Describe to the depth needed to document the Indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-16	10YR	4/2		100			Clay Loam	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Sulfidic odor detected.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

Secondary Indicators (2 or more required)

- | | | |
|--|---|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) | <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) | <input type="checkbox"/> Drainage Patterns (B10) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) | <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) | <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) | <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) | <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) | <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) | <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) | <input type="checkbox"/> Frost-Heave Hummocks (D7) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | | |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? (includes capillary fringe) Yes ☒ No ☐ Depth (inches): 0

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

This site exhibits several primary indicators of wetland hydrology.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Beaverhead County Sampling Date: 2023-07-31
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP03a-W2
 Investigator(s): McEldowney Section, Township, Range: S33 T5S R7W
 Landform (hillslope, terrace, etc.): Alluvial Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.362546 Long: -112.47702 Datum: WGS 84
 Soil Map Unit Name: 37E - Crago-Scravo complex, 15 to 45 percent slopes NWI classification: PUSC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: Island in pond. Island not accessible.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: <u>30 ft r</u>)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:	
1. <u>Salix X fragilis</u>	<u>90</u>	<input checked="" type="checkbox"/>	<u>FAC</u>		Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A)
2. _____	_____	_____	_____	Total Number of Dominant Species Across All Strata: <u>4</u> (B)	
3. _____	_____	_____	_____	Percent of Dominant Species That Are OBL, FACW, or FAC: <u>75.00</u> (A/B)	
4. _____	<u>90</u>	_____	_____	Prevalence Index worksheet:	
<u>90</u> = Total Cover					
Sapling/Shrub Stratum (Plot size: _____)	_____	_____	_____	Total % Cover of: _____ Multiply by: _____	
1. _____	_____	_____	_____	OBL species <u>0</u> x 1 = <u>0</u>	
2. _____	_____	_____	_____	FACW species <u>25</u> x 2 = <u>50</u>	
3. _____	_____	_____	_____	FAC species <u>130</u> x 3 = <u>390</u>	
4. _____	_____	_____	_____	FACU species <u>20</u> x 4 = <u>80</u>	
5. _____	_____	_____	_____	UPL species <u>0</u> x 5 = <u>0</u>	
Herb Stratum (Plot size: <u>5 ft r</u>)	<u>0</u>	_____	_____	Column Totals: <u>175</u> (A) <u>520</u> (B)	
1. <u>Alopecurus arundinaceus</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Prevalence Index = B/A = <u>2.97</u>	
2. <u>Phalaris arundinacea</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.	
3. <u>Sonchus arvensis</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>FACU</u>		
4. _____	_____	_____	_____		
5. _____	_____	_____	_____		
6. _____	_____	_____	_____		
7. _____	_____	_____	_____		
8. _____	_____	_____	_____		
9. _____	_____	_____	_____		
10. _____	_____	_____	_____		
11. _____	_____	_____	_____		
Woody Vine Stratum (Plot size: _____)	<u>85</u>	_____	_____		Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
1. _____	_____	_____	_____		
2. _____	<u>0</u>	_____	_____		
% Bare Ground in Herb Stratum <u>15</u>	<u>0</u>	_____	_____		
Remarks: PFO wetland dominated by crack willow.					

SOIL

Sampling Point: SP03a-W2

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
-								
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☒ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Island not accessible- hydric soils assumed based on elevation of the island relative to the water level in the pond.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (**MLRA 1, 2, 4A, and 4B**)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☒ Saturation Visible on Aerial Imagery (C9)
- ☒ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (**LRR A**)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 48

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Island in a pond.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Beaverhead County Sampling Date: 2023-07-31
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP03b-U
 Investigator(s): McEldowney Section, Township, Range: S33 T5S R7W
 Landform (hillslope, terrace, etc.): Alluvial Flat Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.363236 Long: -112.477472 Datum: WGS 84
 Soil Map Unit Name: 37E - Crago-Scravo complex, 15 to 45 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>8</u></td> <td>x 3 = <u>24</u></td> </tr> <tr> <td>FACU species <u>55</u></td> <td>x 4 = <u>220</u></td> </tr> <tr> <td>UPL species <u>20</u></td> <td>x 5 = <u>100</u></td> </tr> <tr> <td>Column Totals: <u>83</u> (A)</td> <td><u>344</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>4.14</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>8</u>	x 3 = <u>24</u>	FACU species <u>55</u>	x 4 = <u>220</u>	UPL species <u>20</u>	x 5 = <u>100</u>	Column Totals: <u>83</u> (A)	<u>344</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>8</u>	x 3 = <u>24</u>																	
FACU species <u>55</u>	x 4 = <u>220</u>																	
UPL species <u>20</u>	x 5 = <u>100</u>																	
Column Totals: <u>83</u> (A)	<u>344</u> (B)																	
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
1. <u>Pascopyrum smithii</u>	<u>55</u>	<input checked="" type="checkbox"/>	<u>FACU</u>															
2. <u>Agropyron cristatum</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>UPL</u>															
3. <u>Bassia scoparia</u>	<u>5</u>		<u>FAC</u>															
4. <u>Cirsium arvense</u>	<u>3</u>		<u>FAC</u>															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>83</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>17</u>																		
Remarks: Upland sample point dominated by western wheatgrass.																		

SOIL

Sampling Point: SP03b-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 10	10YR 4/2	100					Sandy Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: Cobbles
Depth (inches): 10

Hydric Soil Present? Yes ☐ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____
Water Table Present? Yes ☐ No ☒ Depth (inches): _____
Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Beaverhead County Sampling Date: 2023-07-31
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP03b-W
 Investigator(s): McEldowney Section, Township, Range: S33 T5S R7W
 Landform (hillslope, terrace, etc.): Bench Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.363234 Long: -112.477452 Datum: WGS 84
 Soil Map Unit Name: 37E - Crago-Scravo complex, 15 to 45 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: Narrow fringe adjacent to a flowing channel. Channel is vegetated.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>45</u></td> <td>x 1 = <u>45</u></td> </tr> <tr> <td>FACW species <u>40</u></td> <td>x 2 = <u>80</u></td> </tr> <tr> <td>FAC species <u>10</u></td> <td>x 3 = <u>30</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>95</u> (A)</td> <td><u>155</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>1.63</u>	Total % Cover of:	Multiply by:	OBL species <u>45</u>	x 1 = <u>45</u>	FACW species <u>40</u>	x 2 = <u>80</u>	FAC species <u>10</u>	x 3 = <u>30</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>95</u> (A)	<u>155</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>45</u>	x 1 = <u>45</u>																	
FACW species <u>40</u>	x 2 = <u>80</u>																	
FAC species <u>10</u>	x 3 = <u>30</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>95</u> (A)	<u>155</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Veronica americana</u>	<u>45</u>	<input checked="" type="checkbox"/>	<u>OBL</u>	Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Phalaris arundinacea</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
3. <u>Cirsium arvense</u>	<u>10</u>		<u>FAC</u>															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>95</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>5</u>																		
Remarks: Channel is vegetated. Site is dominated by reed canarygrass and speedwell.																		

SOIL

Sampling Point: SP03b-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3	10YR 2/2	100					Loam	
3 - 16	10YR 5/2	100					Sandy Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Sulfidic odor in second layer.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input checked="" type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 6

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Saturated to surface. Flowing water in vegetated channel.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP04-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Hillslope Local relief (concave, convex, none): Convex Slope (%): 15
 Subregion (LRR): E 44 Lat: 45.379381 Long: -112.455313 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point on the edge of the wetland swale and near the toe of the road fill slope.	

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
_____ = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>12</u> x 3 = <u>36</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>21</u> x 5 = <u>105</u> Column Totals: <u>33</u> (A) <u>141</u> (B) Prevalence Index = B/A = <u>4.27</u>
_____ = Total Cover				
_____ = Total Cover				
_____ = Total Cover				
_____ = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Bromus inermis</u> <u>20</u> <input checked="" type="checkbox"/> <u>UPL</u> 2. <u>Elymus repens</u> <u>10</u> <input checked="" type="checkbox"/> <u>FAC</u> 3. <u>Bassia scoparia</u> <u>1</u> <input type="checkbox"/> <u>FAC</u> 4. <u>Descurainia sophia</u> <u>1</u> <input type="checkbox"/> <u>UPL</u> 5. <u>Equisetum arvense</u> <u>1</u> <input type="checkbox"/> <u>FAC</u> 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ _____ = Total Cover				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ _____ = Total Cover				
% Bare Ground in Herb Stratum <u>67</u>				
Remarks:				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
Remarks:				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Upland sample point dominated by smooth brome.				

SOIL

Sampling Point: SP04-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3	10YR 4/2	100					Loam	
3 - 16	5Y 6/4	100					Silty Clay	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP04-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 2
 Subregion (LRR): E 44 Lat: 45.379455 Long: -112.455424 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped.

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: A swale across highway from E. Bench Road. PEM. Riverine. Site has been hayed.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>70</u> x 3 = <u>210</u> FACU species <u>1</u> x 4 = <u>4</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>71</u> (A) <u>214</u> (B) Prevalence Index = B/A = <u>3.01</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Elymus repens</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Alopecurus arundinaceus</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
3. <u>Sonchus arvensis</u>	<u>1</u>		<u>FACU</u>	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>71</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>30</u>				

Remarks:
Hayed hayfield. Swale is dominated by quackgrass and creeping meadow foxtail. Some Nebraska sedge also noted scattered throughout the swale.

SOIL

Sampling Point: SP04-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 1								Organic - roots, fibric.
1 - 7	10YR 3/1	53					Silty Clay	
1 - 7	5Y 6/4	40						
7 - 15	10YR 4/1	100	10YR 4/6	7	C		Silty Clay	CaCO3 crystals.
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Soil has a depleted matrix.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Lower swale area. This area is indicated as an irrigation ditch on the USGS 7.5' topographic quadrangles.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP05-u
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.3793 Long: -112.454155 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point on the edge of a depressional area dominated by smooth brome.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>2</u></td> <td>x 2 = <u>4</u></td> </tr> <tr> <td>FAC species <u>11</u></td> <td>x 3 = <u>33</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>50</u></td> <td>x 5 = <u>250</u></td> </tr> <tr> <td>Column Totals: <u>63</u> (A)</td> <td><u>287</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>4.56</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>2</u>	x 2 = <u>4</u>	FAC species <u>11</u>	x 3 = <u>33</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>50</u>	x 5 = <u>250</u>	Column Totals: <u>63</u> (A)	<u>287</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>2</u>	x 2 = <u>4</u>																	
FAC species <u>11</u>	x 3 = <u>33</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>50</u>	x 5 = <u>250</u>																	
Column Totals: <u>63</u> (A)	<u>287</u> (B)																	
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) <small>¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.</small>														
1. <u>Bromus inermis</u>	<u>50</u>	<input checked="" type="checkbox"/>	<u>UPL</u>															
2. <u>Elymus repens</u>	<u>10</u>		<u>FAC</u>															
3. <u>Juncus balticus</u>	<u>2</u>		<u>FACW</u>															
4. <u>Bassia scoparia</u>	<u>1</u>		<u>FAC</u>															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>63</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>37</u>																		
Remarks: Site is dominated by smooth brome.																		

SOIL

Sampling Point: SP05-u**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 1								Litter
1 - 16	10YR 3/1	100					Silty Clay	Salt crystals in matrix.
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> 2 cm Muck (A10)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Red Parent Material (TF2)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input type="checkbox"/> Depleted Matrix (F3)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Redox Depressions (F8)	

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

<input type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Salt Crust (B11)
<input type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Aquatic Invertebrates (B13)
<input type="checkbox"/> Water Marks (B1)	<input type="checkbox"/> Hydrogen Sulfide Odor (C1)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A)
<input type="checkbox"/> Surface Soil Cracks (B6)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	

Secondary Indicators (2 or more required)

<input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> Drainage Patterns (B10)
<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Shallow Aquitard (D3)
<input type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Raised Ant Mounds (D6) (LRR A)
<input type="checkbox"/> Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes _____ No ☒ Depth (inches): _____Water Table Present? Yes _____ No ☒ Depth (inches): _____Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP05-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.379356 Long: -112.45413 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: Isolated depressional wetland. PEM. Site is drier compared to previous delineation and the overall size of the wetland polygon has gotten smaller.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ 0 = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>20</u></td> <td>x 1 = <u>20</u></td> </tr> <tr> <td>FACW species <u>26</u></td> <td>x 2 = <u>52</u></td> </tr> <tr> <td>FAC species <u>1</u></td> <td>x 3 = <u>3</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>47</u> (A)</td> <td><u>75</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>1.60</u>	Total % Cover of:	Multiply by:	OBL species <u>20</u>	x 1 = <u>20</u>	FACW species <u>26</u>	x 2 = <u>52</u>	FAC species <u>1</u>	x 3 = <u>3</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>47</u> (A)	<u>75</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>20</u>	x 1 = <u>20</u>																	
FACW species <u>26</u>	x 2 = <u>52</u>																	
FAC species <u>1</u>	x 3 = <u>3</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>47</u> (A)	<u>75</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Chenopodium rubrum</u> <u>25</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. <u>Schoenoplectus acutus</u> <u>10</u> <input checked="" type="checkbox"/> <u>OBL</u> 3. <u>Schoenoplectus pungens</u> <u>10</u> <input checked="" type="checkbox"/> <u>OBL</u> 4. <u>Hordeum jubatum</u> <u>1</u> <input type="checkbox"/> <u>FAC</u> 5. <u>Puccinellia nuttalliana</u> <u>1</u> <input type="checkbox"/> <u>FACW</u> 6. <u>Unidentified forb</u> <u>1</u> <input type="checkbox"/> <u>_____</u> 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ 48 = Total Cover				Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ 0 = Total Cover																		
% Bare Ground in Herb Stratum <u>52</u>																		
Remarks: Site is dominated by FACW and OBL vegetation.																		
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>																		

SOIL

Sampling Point: SP05-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 4/1	97	10YR 4/6	3	C	M	Silty Clay	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Site has a depleted matrix.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input checked="" type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____

(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

A depressional area that collects water. Embedded hoof prints also indicate previous inundation.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06a-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.380615 Long: -112.453346 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Sample point is located on the edge of the irrigation ditch.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>2</u></td> <td>x 2 = <u>4</u></td> </tr> <tr> <td>FAC species <u>10</u></td> <td>x 3 = <u>30</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>60</u></td> <td>x 5 = <u>300</u></td> </tr> <tr> <td>Column Totals: <u>72</u> (A)</td> <td><u>334</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>4.64</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>2</u>	x 2 = <u>4</u>	FAC species <u>10</u>	x 3 = <u>30</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>60</u>	x 5 = <u>300</u>	Column Totals: <u>72</u> (A)	<u>334</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>2</u>	x 2 = <u>4</u>																	
FAC species <u>10</u>	x 3 = <u>30</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>60</u>	x 5 = <u>300</u>																	
Column Totals: <u>72</u> (A)	<u>334</u> (B)																	
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u> _____)																		
1. <u>Bromus inermis</u>	<u>60</u>	<input checked="" type="checkbox"/>	<u>UPL</u>															
2. <u>Poa pratensis</u>	<u>10</u>		<u>FAC</u>															
3. <u>Juncus balticus</u>	<u>2</u>		<u>FACW</u>															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>72</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>28</u>																		
Remarks:																		
Hay field dominated by smooth brome.																		

SOIL

Sampling Point: SP06a-U**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 4/1	100					Sandy Clay Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)**

- ☐ Histosol (A1) ☐ Sandy Redox (S5)
☐ Histic Epipedon (A2) ☐ Stripped Matrix (S6)
☐ Black Histic (A3) ☐ Loamy Mucky Mineral (F1) (**except MLRA 1**)
☐ Hydrogen Sulfide (A4) ☐ Loamy Gleyed Matrix (F2)
☐ Depleted Below Dark Surface (A11) ☐ Depleted Matrix (F3)
☐ Thick Dark Surface (A12) ☐ Redox Dark Surface (F6)
☐ Sandy Mucky Mineral (S1) ☐ Depleted Dark Surface (F7)
☐ Sandy Gleyed Matrix (S4) ☐ Redox Depressions (F8)

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

- ☐ Surface Water (A1) ☐ Water-Stained Leaves (B9) (**except MLRA 1, 2, 4A, and 4B**)
☐ High Water Table (A2) ☐ Salt Crust (B11)
☐ Saturation (A3) ☐ Aquatic Invertebrates (B13)
☐ Water Marks (B1) ☐ Hydrogen Sulfide Odor (C1)
☐ Sediment Deposits (B2) ☐ Oxidized Rhizospheres along Living Roots (C3)
☐ Drift Deposits (B3) ☐ Presence of Reduced Iron (C4)
☐ Algal Mat or Crust (B4) ☐ Recent Iron Reduction in Tilled Soils (C6)
☐ Iron Deposits (B5) ☐ Stunted or Stressed Plants (D1) (**LRR A**)
☐ Surface Soil Cracks (B6) ☐ Other (Explain in Remarks)
☐ Inundation Visible on Aerial Imagery (B7)
☐ Sparsely Vegetated Concave Surface (B8)

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (**MLRA 1, 2, 4A, and 4B**)
☐ Drainage Patterns (B10)
☐ Dry-Season Water Table (C2)
☐ Saturation Visible on Aerial Imagery (C9)
☐ Geomorphic Position (D2)
☐ Shallow Aquitard (D3)
☐ FAC-Neutral Test (D5)
☐ Raised Ant Mounds (D6) (**LRR A**)
☐ Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes _____ No ☒ Depth (inches): _____Water Table Present? Yes _____ No ☒ Depth (inches): _____Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06a-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.380642 Long: -112.453364 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes _____ No ☒ (If no, explain in Remarks.)
 Are Vegetation _____, Soil _____, or Hydrology _____ significantly disturbed? Are "Normal Circumstances" present? Yes _____ No ☒
 Are Vegetation _____, Soil _____, or Hydrology _____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No _____	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No _____
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No _____	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No _____	
Remarks: PEM wetland in an old irrigation ditch.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
_____ = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>50</u></td> <td>x 1 = <u>50</u></td> </tr> <tr> <td>FACW species <u>3</u></td> <td>x 2 = <u>6</u></td> </tr> <tr> <td>FAC species <u>14</u></td> <td>x 3 = <u>42</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>67</u> (A)</td> <td><u>98</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>1.46</u>	Total % Cover of:	Multiply by:	OBL species <u>50</u>	x 1 = <u>50</u>	FACW species <u>3</u>	x 2 = <u>6</u>	FAC species <u>14</u>	x 3 = <u>42</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>67</u> (A)	<u>98</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>50</u>	x 1 = <u>50</u>																	
FACW species <u>3</u>	x 2 = <u>6</u>																	
FAC species <u>14</u>	x 3 = <u>42</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>67</u> (A)	<u>98</u> (B)																	
_____ = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
_____ = Total Cover																		
Herb Stratum (Plot size: _____)																		
1. <u>Carex nebrascensis</u>	<u>50</u>	<input checked="" type="checkbox"/>	<u>OBL</u>															
2. <u>Agrostis stolonifera</u>	<u>5</u>		<u>FAC</u>															
3. <u>Alopecurus arundinaceus</u>	<u>5</u>		<u>FAC</u>															
4. <u>Juncus balticus</u>	<u>3</u>		<u>FACW</u>															
5. <u>Elymus repens</u>	<u>2</u>		<u>FAC</u>															
6. <u>Sporobolus airoides</u>	<u>2</u>		<u>FAC</u>															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
_____ = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
_____ = Total Cover																		
% Bare Ground in Herb Stratum <u>33</u>																		
Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.																		
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No _____																		
Remarks: Site is dominated by Nebraska sedge.																		

SOIL

Sampling Point: SP06a-W**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 5	10YR 3/2	100					Silty Clay Loam	High organics.
5 - 10	10YR 5/1	95	10YR 4/6	5	C	PL / M	Sandy Loam	Cobbles >10 inches
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> 2 cm Muck (A10)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Red Parent Material (TF2)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input checked="" type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input checked="" type="checkbox"/> Depleted Matrix (F3)	³ Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Redox Depressions (F8)	

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Sulfidic odor in second horizon. Cobbles prevent digging below 10 inches.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

<input type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Salt Crust (B11)
<input checked="" type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Aquatic Invertebrates (B13)
<input type="checkbox"/> Water Marks (B1)	<input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A)
<input type="checkbox"/> Surface Soil Cracks (B6)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	

Secondary Indicators (2 or more required)

<input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> Drainage Patterns (B10)
<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input checked="" type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Shallow Aquitard (D3)
<input checked="" type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Raised Ant Mounds (D6) (LRR A)
<input type="checkbox"/> Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☒ No ☐ Depth (inches): 5
(includes capillary fringe)Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Sulfidic odor and saturation found at this site.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-03
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06b-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Convex Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.381226 Long: -112.453098 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Hydric Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point roughly 2 ft above the paired wetland point, and dominated by FAC vegetation.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
_____ = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>1</u> x 1 = <u>1</u> FACW species <u>10</u> x 2 = <u>20</u> FAC species <u>55</u> x 3 = <u>165</u> FACU species <u>7</u> x 4 = <u>28</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>73</u> (A) <u>214</u> (B) Prevalence Index = B/A = <u>2.93</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
_____ = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Elymus repens</u>	<u>45</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Cirsium arvense</u>	<u>5</u>		<u>FAC</u>	
3. <u>Glycyrrhiza lepidota</u>	<u>5</u>		<u>FAC</u>	
4. <u>Muhlenbergia asperifolia</u>	<u>5</u>		<u>FACW</u>	
5. <u>Plantago eriopoda</u>	<u>5</u>		<u>FACW</u>	
6. <u>Sonchus arvensis</u>	<u>5</u>		<u>FACU</u>	
7. <u>Medicago lupulina</u>	<u>2</u>		<u>FACU</u>	
8. <u>Schoenoplectus pungens</u>	<u>1</u>		<u>OBL</u>	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
_____ = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
_____ = Total Cover				
% Bare Ground in Herb Stratum <u>27</u>				
Remarks: Site is dominated by FAC vegetation.				

SOIL

Sampling Point: SP06b-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 4	10YR 3/2	100					Silty Clay Loam	Lots of salt crystals.
4 - 16	10YR 4/1	100					Silty Clay	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-03
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06b-w
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 1
 Subregion (LRR): E 44 Lat: 45.381253 Long: -112.453133 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped.

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM, riverine. Installation of a new jack leg fence caused some disturbance in this area earlier this year.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ 0 = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>30</u></td> <td>x 1 = <u>30</u></td> </tr> <tr> <td>FACW species <u>5</u></td> <td>x 2 = <u>10</u></td> </tr> <tr> <td>FAC species <u>37</u></td> <td>x 3 = <u>111</u></td> </tr> <tr> <td>FACU species <u>5</u></td> <td>x 4 = <u>20</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>77</u> (A)</td> <td><u>171</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.22</u>	Total % Cover of:	Multiply by:	OBL species <u>30</u>	x 1 = <u>30</u>	FACW species <u>5</u>	x 2 = <u>10</u>	FAC species <u>37</u>	x 3 = <u>111</u>	FACU species <u>5</u>	x 4 = <u>20</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>77</u> (A)	<u>171</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>30</u>	x 1 = <u>30</u>																	
FACW species <u>5</u>	x 2 = <u>10</u>																	
FAC species <u>37</u>	x 3 = <u>111</u>																	
FACU species <u>5</u>	x 4 = <u>20</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>77</u> (A)	<u>171</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Alopecurus arundinaceus</u> <u>35</u> <input checked="" type="checkbox"/> <u>FAC</u> 2. <u>Carex nebrascensis</u> <u>25</u> <input checked="" type="checkbox"/> <u>OBL</u> 3. <u>Juncus balticus</u> <u>5</u> <input type="checkbox"/> <u>FACW</u> 4. <u>Schoenoplectus pungens</u> <u>5</u> <input type="checkbox"/> <u>OBL</u> 5. <u>Sonchus arvensis</u> <u>5</u> <input type="checkbox"/> <u>FACU</u> 6. <u>Cirsium arvense</u> <u>2</u> <input type="checkbox"/> <u>FAC</u> 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ 77 = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ 0 = Total Cover																		
% Bare Ground in Herb Stratum <u>23</u>																		
Remarks: Vegetation has been disturbed by the installation of a jacket fence.																		
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>																		

SOIL

Sampling Point: SP06b-w**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features			Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹		
0 - 9	N 5/0	95	7.5YR 3/3	5	C	PL	Clay
9 - 16	2.5Y 5/1	90	10YR 4/6	10	C	M	Loamy Sand
-							
-							
-							
-							
-							
-							

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> 2 cm Muck (A10)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Red Parent Material (TF2)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input type="checkbox"/> Hydrogen Sulfide (A4)	<input checked="" type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input type="checkbox"/> Depleted Matrix (F3)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Redox Depressions (F8)	

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Gleyed matrix with redox.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

<input type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Salt Crust (B11)
<input checked="" type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Aquatic Invertebrates (B13)
<input type="checkbox"/> Water Marks (B1)	<input type="checkbox"/> Hydrogen Sulfide Odor (C1)
<input type="checkbox"/> Sediment Deposits (B2)	<input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A)
<input type="checkbox"/> Surface Soil Cracks (B6)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	

Secondary Indicators (2 or more required)

<input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> Drainage Patterns (B10)
<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input checked="" type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Shallow Aquitard (D3)
<input checked="" type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Raised Ant Mounds (D6) (LRR A)
<input type="checkbox"/> Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Soil is saturated to the surface, has oxidized rhizospheres, is located on the Beaverhead floodplain, and passes the FAC-neutral test.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-03
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06c-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Island Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.381015 Long: -112.452676 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: PSS, riverine island between side channel and the mainstem Beaverhead River.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>4</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>75.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
_____ = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>28</u></td> <td>x 1 = <u>28</u></td> </tr> <tr> <td>FACW species <u>52</u></td> <td>x 2 = <u>104</u></td> </tr> <tr> <td>FAC species <u>36</u></td> <td>x 3 = <u>108</u></td> </tr> <tr> <td>FACU species <u>18</u></td> <td>x 4 = <u>72</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>134</u> (A)</td> <td><u>312</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.33</u>	Total % Cover of:	Multiply by:	OBL species <u>28</u>	x 1 = <u>28</u>	FACW species <u>52</u>	x 2 = <u>104</u>	FAC species <u>36</u>	x 3 = <u>108</u>	FACU species <u>18</u>	x 4 = <u>72</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>134</u> (A)	<u>312</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>28</u>	x 1 = <u>28</u>																	
FACW species <u>52</u>	x 2 = <u>104</u>																	
FAC species <u>36</u>	x 3 = <u>108</u>																	
FACU species <u>18</u>	x 4 = <u>72</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>134</u> (A)	<u>312</u> (B)																	
Sapling/Shrub Stratum (Plot size: 15 ft r _____)																		
1. <u>Salix exigua</u>	<u>50</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
2. <u>Elaeagnus commutata</u>	<u>1</u>	_____	<u>FAC</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
_____ = Total Cover				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Herb Stratum (Plot size: 5 ft r _____)																		
1. <u>Cirsium arvense</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Carex nebrascensis</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>OBL</u>															
3. <u>Sonchus arvensis</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FACU</u>															
4. <u>Schoenoplectus pungens</u>	<u>10</u>	_____	<u>OBL</u>															
5. <u>Agrostis stolonifera</u>	<u>5</u>	_____	<u>FAC</u>															
6. <u>Alopecurus arundinaceus</u>	<u>5</u>	_____	<u>FAC</u>															
7. <u>Cynoglossum officinale</u>	<u>3</u>	_____	<u>FACU</u>															
8. <u>Potentilla anserina</u>	<u>3</u>	_____	<u>OBL</u>															
9. <u>Juncus balticus</u>	<u>2</u>	_____	<u>FACW</u>															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
_____ = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
_____ = Total Cover																		
% Bare Ground in Herb Stratum <u>17</u>																		
Remarks: PSS dominated by coyote willow.																		

SOIL

Sampling Point: SP06c-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 6	10YR 4/1	100					Sandy Clay Loam	
6 - 16	10YR 5/1	95	10YR 4/4	5	C	M	Sandy Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Site has a depleted matrix.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input checked="" type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 6
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Sample point is on an island. Soil saturation observed at 6 inches below ground surface.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/11/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP06d-u
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Terrace Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.381872 Long: -112.45301 Datum: WGS84
 Soil Map Unit Name: Havre loam NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		

Remarks:

DP well above water table and river level on abandoned terrace.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
0 = Total Cover			
Sapling/Shrub Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
0 = Total Cover			
Herb Stratum (Plot size: <u>5ft</u>)	Absolute % Cover	Dominant Species?	Indicator Status
1. <u>Juncus arcticus</u>	20	<input checked="" type="checkbox"/>	FACW
2. <u>Equisetum hyemale</u>	5	<input type="checkbox"/>	FACW
3. <u>Bromus inermis</u>	75	<input checked="" type="checkbox"/>	UPL
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
6. _____	0	<input type="checkbox"/>	
7. _____	0	<input type="checkbox"/>	
8. _____	0	<input type="checkbox"/>	
9. _____	0	<input type="checkbox"/>	
10. _____	0	<input type="checkbox"/>	
11. _____	0	<input type="checkbox"/>	
100 = Total Cover			
Woody Vine Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
0 = Total Cover			
% Bare Ground in Herb Stratum <u>0</u>			

Dominance Test worksheet:
 Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)
 Total Number of Dominant Species Across All Strata: 2 (B)
 Percent of Dominant Species That Are OBL, FACW, or FAC: 1 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:
OBL species <u>0</u>	x 1 = <u>0</u>
FACW species <u>25</u>	x 2 = <u>50</u>
FAC species <u>0</u>	x 3 = <u>0</u>
FACU species <u>0</u>	x 4 = <u>0</u>
UPL species <u>75</u>	x 5 = <u>375</u>
Column Totals: <u>100</u> (A)	<u>425</u> (B)

 Prevalence Index = B/A = 4.25

Hydrophytic Vegetation Indicators:
☐ 1 - Rapid Test for Hydrophytic Vegetation
☐ 2 - Dominance Test is >50%
☐ 3 - Prevalence Index is ≤3.0¹
☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
☐ 5 - Wetland Non-Vascular Plants
☐ Problematic Hydrophytic Vegetation¹ (Explain)
¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☐ No ☒

Remarks:

Site is dominated by smooth brome.

SOIL

Sampling Point: SP06d-u

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type	Loc ²		
0-5	10YR 3/2	100					Clay Loam	
5-12	10YR 4/2	95	10YR 2/2	5	D	M	Clay Loam	
12-16	10YR 5/2	99	10YR 3/4	1	C	M	Clay	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒

Remarks:

Soils appear to have been historically hydric, situated approx 6ft above water level in river. Area may receive seasonal groundwater from west side of highway.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
☐ Drainage Patterns (B10)
☐ Dry-Season Water Table (C2)
☐ Saturation Visible on Aerial Imagery (C9)
☐ Geomorphic Position (D2)
☐ Shallow Aquitard (D3)
☒ FAC-Neutral Test (D5)
☐ Raised Ant Mounds (D6) (LRR A)
☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? (includes capillary fringe) Yes ☐ No ☒ Depth (inches): _____Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No signs of wetland hydrology

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/11/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP06d-w
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Terrace Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.382225 Long: -112.452808 Datum: WGS84
 Soil Map Unit Name: Rivra NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: DP on river terrace in active floodplain. Confirmed in 2023.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: <u>30ft</u>)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.6667</u> (A/B)
1. <u>Prunus virginiana</u>	<u>5</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
2. _____	<u>0</u>	<input type="checkbox"/>	_____	
3. _____	<u>0</u>	<input type="checkbox"/>	_____	
4. _____	<u>0</u>	<input type="checkbox"/>	_____	
<u>5</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: <u>15ft</u>)	Absolute % Cover	Dominant Species?	Indicator Status	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>40</u> x 2 = <u>80</u> FAC species <u>70</u> x 3 = <u>210</u> FACU species <u>10</u> x 4 = <u>40</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>120</u> (A) <u>330</u> (B) Prevalence Index = B/A = <u>2.75</u>
1. <u>Salix exigua</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. <u>Rosa woodsii</u>	<u>5</u>	<input type="checkbox"/>	<u>FACU</u>	
3. <u>Elaeagnus angustifolia</u>	<u>5</u>	<input type="checkbox"/>	<u>FAC</u>	
4. _____	<u>0</u>	<input type="checkbox"/>	_____	
<u>55</u> = Total Cover				
Herb Stratum (Plot size: <u>5ft</u>)	Absolute % Cover	Dominant Species?	Indicator Status	Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants <input type="checkbox"/> Problematic Hydrophytic Vegetation* (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Alopecurus arundinaceus</u>	<u>60</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
2. <u>Carex sp.</u>	<u>5</u>	<input type="checkbox"/>	<u>NL</u>	
3. <u>Cirsium arvense</u>	<u>5</u>	<input type="checkbox"/>	<u>FAC</u>	
4. _____	<u>0</u>	<input type="checkbox"/>	_____	
<u>70</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
1. _____	<u>0</u>	<input type="checkbox"/>	_____	
2. _____	<u>0</u>	<input type="checkbox"/>	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				

Remarks:
 PSS dominated by coyote willow and creeping meadow foxtail.

SOIL

Sampling Point: SP06d-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		%	Redox Features				Texture	Remarks
	Color (moist)			Color (moist)	%	Type	Loc ²		
0-8	10YR	4/2	95	10YR	4/6	5	C	M	Sandy Loam
8-14	10YR	3/2	95	10YR	4/4	5	C	M	Sandy Clay

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Soils with occasional deposition from river.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input checked="" type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|--|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input checked="" type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? (includes capillary fringe) Yes ☐ No ☒ Depth (inches): _____Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

DP is in the active floodplain as demonstrated by the sediment deposits observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06e-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Road Bed Local relief (concave, convex, none): Convex Slope (%): 100
 Subregion (LRR): E 44 Lat: 45.382998 Long: -112.453064 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point on road sideslope.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____)		<u>0</u> = Total Cover		Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>65</u></td> <td>x 3 = <u>195</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>65</u> (A)</td> <td><u>195</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.00</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>65</u>	x 3 = <u>195</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>65</u> (A)	<u>195</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>65</u>	x 3 = <u>195</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>65</u> (A)	<u>195</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>)		<u>0</u> = Total Cover																
1. <u>Bassia scoparia</u>	<u>65</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
Woody Vine Stratum (Plot size: _____)		<u>65</u> = Total Cover		Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
% Bare Ground in Herb Stratum <u>35</u>		<u>0</u> = Total Cover																
Remarks: Disturbed roadside site dominated by kochia.		Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>																

SOIL

Sampling Point: SP06e-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10YR 4/2	100					Sandy Loam	Gravelly
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06e-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.382973 Long: -112.452937 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped.

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	
Remarks: <div style="font-size: 1.2em; margin-top: 10px;">PSS, riverine wetland in the floodplain of the Beaverhead River.</div>			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:																
1. _____	_____	_____	_____	Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)																
2. _____	_____	_____	_____																	
3. _____	_____	_____	_____																	
4. _____	_____	_____	_____																	
0 = Total Cover				Prevalence Index worksheet: <table style="width: 100%; border-collapse: collapse;"> <tr> <th style="width: 50%;">Total % Cover of:</th> <th style="width: 50%;">Multiply by:</th> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>115</u></td> <td>x 2 = <u>230</u></td> </tr> <tr> <td>FAC species <u>10</u></td> <td>x 3 = <u>30</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>125</u> (A)</td> <td><u>260</u> (B)</td> </tr> <tr> <td colspan="2" style="text-align: center;">Prevalence Index = B/A = <u>2.08</u></td> </tr> </table>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>115</u>	x 2 = <u>230</u>	FAC species <u>10</u>	x 3 = <u>30</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>125</u> (A)	<u>260</u> (B)	Prevalence Index = B/A = <u>2.08</u>	
Total % Cover of:	Multiply by:																			
OBL species <u>0</u>	x 1 = <u>0</u>																			
FACW species <u>115</u>	x 2 = <u>230</u>																			
FAC species <u>10</u>	x 3 = <u>30</u>																			
FACU species <u>0</u>	x 4 = <u>0</u>																			
UPL species <u>0</u>	x 5 = <u>0</u>																			
Column Totals: <u>125</u> (A)	<u>260</u> (B)																			
Prevalence Index = B/A = <u>2.08</u>																				
Sapling/Shrub Stratum (Plot size: 15 ft r _____) 1. <u>Salix exigua</u> <u>65</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. _____ 3. _____ 4. _____ 5. _____ 65 = Total Cover																				
Herb Stratum (Plot size: 5 ft r _____) 1. <u>Phalaris arundinacea</u> <u>50</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. <u>Cirsium arvense</u> <u>10</u> <input type="checkbox"/> <u>FAC</u> 3. _____ 4. _____ 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ 60 = Total Cover																				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ 0 = Total Cover % Bare Ground in Herb Stratum <u>30</u>																				
Remarks: <div style="font-size: 1.2em; margin-top: 10px;">Site is dominated by coyote willow and reed canarygrass.</div>																				

SOIL

Sampling Point: SP06e-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features			Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹		
0 - 16	10YR 4/1	98	10YR 4/4	2	C	PL	Clay
-							
-							
-							
-							
-							
-							
-							
-							

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Site has a depleted matrix.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____
Water Table Present? Yes ☐ No ☒ Depth (inches): _____
Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Site has oxidized rhizospheres and occurs in the floodplain of the Beaverhead River, and passes the FAC-neutral test.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06f-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 10
 Subregion (LRR): E 44 Lat: 45.381581 Long: -112.453507 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland point on slope adjacent to wetland.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>5</u></td> <td>x 3 = <u>15</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>75</u></td> <td>x 5 = <u>375</u></td> </tr> <tr> <td>Column Totals: <u>80</u> (A)</td> <td><u>390</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>4.88</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>5</u>	x 3 = <u>15</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>75</u>	x 5 = <u>375</u>	Column Totals: <u>80</u> (A)	<u>390</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>5</u>	x 3 = <u>15</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>75</u>	x 5 = <u>375</u>																	
Column Totals: <u>80</u> (A)	<u>390</u> (B)																	
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>53 ft r</u> _____)																		
1. <u>Bromus inermis</u>	<u>75</u>	<input checked="" type="checkbox"/>	<u>UPL</u>															
2. <u>Elymus repens</u>	<u>5</u>		<u>FAC</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>80</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>20</u>																		
Remarks: Almost a monoculture of smooth brome.																		

SOIL

Sampling Point: SP06f-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 4	10YR 3/2	100					Clay Loam	
4 - 16	10YR 4/1	99	10YR 4/6	1	C	PL	Clay	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed. Minor redox in second horizon, but does not qualify as hydric.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06f-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.381518 Long: -112.453537 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM, depressional. In ditch adjacent to highway.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>61</u></td> <td>x 1 = <u>61</u></td> </tr> <tr> <td>FACW species <u>20</u></td> <td>x 2 = <u>40</u></td> </tr> <tr> <td>FAC species <u>11</u></td> <td>x 3 = <u>33</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>92</u> (A)</td> <td><u>134</u> (B)</td> </tr> </table>	Total % Cover of:	Multiply by:	OBL species <u>61</u>	x 1 = <u>61</u>	FACW species <u>20</u>	x 2 = <u>40</u>	FAC species <u>11</u>	x 3 = <u>33</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>92</u> (A)	<u>134</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>61</u>	x 1 = <u>61</u>																	
FACW species <u>20</u>	x 2 = <u>40</u>																	
FAC species <u>11</u>	x 3 = <u>33</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>92</u> (A)	<u>134</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Carex nebrascensis</u>	<u>60</u>	<input checked="" type="checkbox"/>	<u>OBL</u>	Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Juncus balticus</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
3. <u>Alopecurus arundinaceus</u>	<u>10</u>		<u>FAC</u>															
4. <u>Alopecurus pratensis</u>	<u>1</u>		<u>FAC</u>															
5. <u>Asclepias incarnata</u>	<u>1</u>		<u>OBL</u>															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>92</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>8</u>																		
Remarks: Site is dominated by OBL and FACW vegetation.																		

SOIL

Sampling Point: SP06f-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 1.5	10YR 4/2	100					Sandy Loam	
1.5 - 16	N 5/0	65	10YR 4/6	5	C	PL	Silty Clay	
1.5 - 16	N 2.5/0	30						
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input checked="" type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Gleyed soil.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____
Water Table Present? Yes ☐ No ☒ Depth (inches): _____
Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Depressional area near highway supported by groundwater.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06g-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Hillside Local relief (concave, convex, none): Convex Slope (%): 15
 Subregion (LRR): E 44 Lat: 45.38265 Long: -112.453295 Datum: WGS 84
 Soil Map Unit Name: 59 - Havre loam, cool, wet, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Hydic Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland point on side of road.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>66.67</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: _____)		<u>0</u> = Total Cover		Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>32</u> x 3 = <u>96</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>25</u> x 5 = <u>125</u> Column Totals: <u>57</u> (A) <u>221</u> (B) Prevalence Index = B/A = <u>3.88</u>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Herb Stratum (Plot size: <u>5 ft r</u>)		<u>0</u> = Total Cover		Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Agropyron cristatum</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>UPL</u>	
2. <u>Bassia scoparia</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
3. <u>Elymus repens</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
4. <u>Equisetum arvense</u>	<u>2</u>	<input type="checkbox"/>	<u>FAC</u>	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
Woody Vine Stratum (Plot size: _____)		<u>57</u> = Total Cover		Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
% Bare Ground in Herb Stratum <u>43</u>		<u>0</u> = Total Cover		
Remarks: Upland sample point dominated by crested wheatgrass and kochia.				

SOIL

Sampling Point: SP06g-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 14	10YR 4/2	100					Loamy Sand	Gravelly.
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/11/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP06g-w
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Terrace Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.382633 Long: -112.453468 Datum: WGS84
 Soil Map Unit Name: Havre loam NWI classification: PEM

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
---	---

Remarks:

DP along lower river terrace with periodic overbank flows and high water table during spring.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:
1. _____	0	<input type="checkbox"/>		Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A)
2. _____	0	<input type="checkbox"/>		Total Number of Dominant Species Across All Strata: <u>2</u> (B)
3. _____	0	<input type="checkbox"/>		Percent of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A/B)
4. _____	0	<input type="checkbox"/>		
	0 = Total Cover			
Sapling/Shrub Stratum (Plot size: <u>15ft</u>)				Prevalence Index worksheet:
1. <u>Salix exigua</u>	30	<input checked="" type="checkbox"/>	FACW	Total % Cover of: _____ Multiply by: _____
2. _____	0	<input type="checkbox"/>		OBL species <u>0</u> x 1 = <u>0</u>
3. _____	0	<input type="checkbox"/>		FACW species <u>35</u> x 2 = <u>70</u>
4. _____	0	<input type="checkbox"/>		FAC species <u>95</u> x 3 = <u>285</u>
5. _____	0	<input type="checkbox"/>		FACU species <u>0</u> x 4 = <u>0</u>
	30 = Total Cover			UPL species <u>0</u> x 5 = <u>0</u>
Herb Stratum (Plot size: <u>5ft</u>)				Column Totals: <u>130</u> (A) <u>355</u> (B)
1. <u>Phalaris arundinacea</u>	95	<input checked="" type="checkbox"/>	FACW	Prevalence Index = B/A = <u>2.73077</u>
2. <u>Juncus arcticus</u>	5	<input type="checkbox"/>	FACW	
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
5. _____	0	<input type="checkbox"/>		
6. _____	0	<input type="checkbox"/>		
7. _____	0	<input type="checkbox"/>		
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
	100 = Total Cover			
Woody Vine Stratum (Plot size: _____)				
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
	0 = Total Cover			
% Bare Ground in Herb Stratum <u>0</u>				

Hydrophytic Vegetation Indicators:
☐ 1 - Rapid Test for Hydrophytic Vegetation
☒ 2 - Dominance Test is >50%
☒ 3 - Prevalence Index is ≤3.0¹
☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
☐ 5 - Wetland Non-Vascular Plants¹
☐ Problematic Hydrophytic Vegetation¹ (Explain)
¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☒ No ☐

Remarks:

Vegetation updated in 2023 by R. McElDowney.

SOIL

Sampling Point: SP06g-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Type	Loc ²	Texture	Remarks
	Color (moist)	%	Color (moist)	%						
0-5	10YR 3/2	100							Clay Loam	
5-10	10YR 4/2	95	10YR 4/4	5	C	M			Clay	
10-16	10YR 5/1	95	7.5YR 4/6	5	C	M			Sandy Clay	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix in the second and third soil horizons.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input checked="" type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☒ Saturation Visible on Aerial Imagery (C9)
- ☒ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☒ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? (includes capillary fringe) Yes ☐ No ☒ Depth (inches): _____

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Soils moist at 16in., seasonal high water table.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06h-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.383552 Long: -112.453242 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point on the left bank of the Beaverhead River at the bridge.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: <u>15 ft r</u>) 1. <u>Symphoricarpos albus</u> <u>20</u> <input checked="" type="checkbox"/> <u>FACU</u>				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>40</u> x 3 = <u>120</u> FACU species <u>20</u> x 4 = <u>80</u> UPL species <u>5</u> x 5 = <u>25</u> Column Totals: <u>65</u> (A) <u>225</u> (B) Prevalence Index = B/A = <u>3.46</u>
0 = Total Cover Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Bassia scoparia</u> <u>35</u> <input checked="" type="checkbox"/> <u>FAC</u>				
2. <u>Descurainia sophia</u> <u>5</u> <input type="checkbox"/> <u>UPL</u>				
3. <u>Glycyrrhiza lepidota</u> <u>5</u> <input type="checkbox"/> <u>FAC</u>				
4. _____ 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____				
45 = Total Cover Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ 0 = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
% Bare Ground in Herb Stratum <u>55</u>				
Remarks: Upland sample point dominated by a weedy FAC species - kochia.				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

SOIL

Sampling Point: SP06h-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10YR 3/2						Loamy Sand	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed. Compacted soil. Difficult digging.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence if wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06h-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Convex Slope (%): 5
 Subregion (LRR): E 44 Lat: 45.383525 Long: -112.453236 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☒, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM, riverine. Wetland fringe on left bank of Beaverhead River, immediately upstream of the highway bridge.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>95</u></td> <td>x 2 = <u>190</u></td> </tr> <tr> <td>FAC species <u>0</u></td> <td>x 3 = <u>0</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>95</u> (A)</td> <td><u>190</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.00</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>95</u>	x 2 = <u>190</u>	FAC species <u>0</u>	x 3 = <u>0</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>95</u> (A)	<u>190</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>95</u>	x 2 = <u>190</u>																	
FAC species <u>0</u>	x 3 = <u>0</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>95</u> (A)	<u>190</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Phalaris arundinacea</u>	<u>95</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>95</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>5</u>																		
Remarks: Monoculture of reed canarygrass on left bank of Beaverhead.																		

SOIL

Sampling Point: SP06h-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 3/2	100					Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|--|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input checked="" type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: Cobble
Depth (inches): 16

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Hydric soils assumed based on location on the bank of the river, and the dominance by FACW vegetation.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input checked="" type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Depth (inches): <u> </u>
Water Table Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Depth (inches): <u> </u>
Saturation Present? (includes capillary fringe)	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Depth (inches): <u> </u>

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Wetland fringe on left bank of Beaverhead River on upstream side of bridge.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06i-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Hillslope Local relief (concave, convex, none): Concave Slope (%): 50
 Subregion (LRR): E 44 Lat: 45.383695 Long: -112.453048 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland point on the road side slope.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____)		<u>0</u> = Total Cover		Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>35</u></td> <td>x 3 = <u>105</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>35</u> (A)</td> <td><u>105</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.00</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>35</u>	x 3 = <u>105</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>35</u> (A)	<u>105</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>35</u>	x 3 = <u>105</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>35</u> (A)	<u>105</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>)		<u>0</u> = Total Cover																
1. <u>Bassia scoparia</u>	<u>35</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
Woody Vine Stratum (Plot size: _____)		<u>35</u> = Total Cover		Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
% Bare Ground in Herb Stratum <u>65</u>		<u>0</u> = Total Cover		Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
Remarks: Pure stand of kochia.																		

SOIL

Sampling Point: SP06i-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10YR 4/1	100					Loamy Sand	Gravelly
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____
Water Table Present? Yes _____ No ☒ Depth (inches): _____
Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

On a sideslope to the highway. No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06i-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.383631 Long: -112.452979 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PSS, riverine wetland in the north floodplain north of the river, downstream of the bridge, east of the highway.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
0 = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>50</u> x 2 = <u>100</u> FAC species <u>82</u> x 3 = <u>246</u> FACU species <u>14</u> x 4 = <u>56</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>146</u> (A) <u>402</u> (B) Prevalence Index = B/A = <u>2.75</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Salix exigua</u>	<u>50</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. <u>Rosa woodsii</u>	<u>5</u>		<u>FACU</u>	
3. <u>Ribes aureum</u>	<u>2</u>		<u>FAC</u>	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
57 = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Alopecurus arundinaceus</u>	<u>70</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
2. <u>Cirsium arvense</u>	<u>10</u>		<u>FAC</u>	
3. <u>Schedonorus pratensis</u>	<u>5</u>		<u>FACU</u>	
4. <u>Cynoglossum officinale</u>	<u>2</u>		<u>FACU</u>	
5. <u>Sonchus arvensis</u>	<u>2</u>		<u>FACU</u>	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
89 = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
0 = Total Cover				
% Bare Ground in Herb Stratum <u>11</u>				
Remarks: Site has been lightly grazed by cattle.				

SOIL

Sampling Point: SP06i-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features			Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹		
0 - 4	10YR 4/2	95	10YR 4/6	5	C	PL	Clay Loam
8 - 16	10YR 3/2	100					Loam
-							
-							
-							
-							
-							
-							

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix in first horizon. Alluvial deposition evident in soil profile.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input checked="" type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input checked="" type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

- | | | |
|--|---|-----------------------|
| Surface Water Present? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> | Depth (inches): _____ |
| Water Table Present? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> | Depth (inches): _____ |
| Saturation Present?
(includes capillary fringe) | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> | Depth (inches): _____ |

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Site has classic features of a floodplain with sediments deposits and drainage patterns.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP06j-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.38525 Long: -112.452951 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Sample point is in an abandoned irrigation ditch. The site has been grazed recently.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>10</u> x 3 = <u>30</u> FACU species <u>78</u> x 4 = <u>312</u> UPL species <u>10</u> x 5 = <u>50</u> Column Totals: <u>98</u> (A) <u>392</u> (B) Prevalence Index = B/A = <u>4.00</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Symphoricarpos albus</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
<u>30</u> = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Poa secunda</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
2. <u>Taraxacum officinale</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
3. <u>Bromus inermis</u>	<u>10</u>	_____	<u>UPL</u>	
4. <u>Elymus repens</u>	<u>5</u>	_____	<u>FAC</u>	
5. <u>Glycyrrhiza lepidota</u>	<u>5</u>	_____	<u>FAC</u>	
6. <u>Medicago lupulina</u>	<u>2</u>	_____	<u>FACU</u>	
7. <u>Grindelia squarrosa</u>	<u>1</u>	_____	<u>FACU</u>	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
<u>68</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>32</u>				
Remarks: Site has been grazed.				

SOIL

Sampling Point: SP06j-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3	10YR 3/1	100					Clay Loam	
3 - 16	10YR 4/1	100					Silty Clay	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/11/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP06j-w
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Swale Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.391312 Long: -112.452183 Datum: WGS84
 Soil Map Unit Name: Rivra, cool-Fluvaquents complex NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes ☒ No ☐
 Hydric Soil Present? Yes ☒ No ☐
 Wetland Hydrology Present? Yes ☒ No ☐

Is the Sampled Area within a Wetland? Yes ☒ No ☐

Remarks:

DP in emergent wetland, not mapped as wetland by NWI.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: _____)			
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
	0 = Total Cover		
Herb Stratum (Plot size: 5ft)			
1. <u>Schoenoplectus acutus</u>	80	<input checked="" type="checkbox"/>	OBL
2. <u>Ranunculus cymbalaria</u>	5	<input type="checkbox"/>	OBL
3. <u>Eleocharis palustris</u>	5	<input type="checkbox"/>	OBL
4. <u>Polygonum sp.</u>	2	<input type="checkbox"/>	NL
5. _____	0	<input type="checkbox"/>	
6. _____	0	<input type="checkbox"/>	
7. _____	0	<input type="checkbox"/>	
8. _____	0	<input type="checkbox"/>	
9. _____	0	<input type="checkbox"/>	
10. _____	0	<input type="checkbox"/>	
11. _____	0	<input type="checkbox"/>	
	92 = Total Cover		
Woody Vine Stratum (Plot size: _____)			
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
	0 = Total Cover		
% Bare Ground in Herb Stratum <u>8</u>			

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)
 Total Number of Dominant Species Across All Strata: 1 (B)
 Percent of Dominant Species That Are OBL, FACW, or FAC: 1 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:	
OBL species <u>10</u>	x 1 =	<u>10</u>
FACW species <u>0</u>	x 2 =	<u>0</u>
FAC species <u>60</u>	x 3 =	<u>180</u>
FACU species <u>0</u>	x 4 =	<u>0</u>
UPL species <u>0</u>	x 5 =	<u>0</u>
Column Totals: <u>70</u> (A)		<u>190</u> (B)
Prevalence Index = B/A = <u>2.71429</u>		

Hydrophytic Vegetation Indicators:

☐ 1 - Rapid Test for Hydrophytic Vegetation
☒ 2 - Dominance Test is >50%
☒ 3 - Prevalence Index is ≤3.0¹
☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
☐ 5 - Wetland Non-Vascular Plants¹
☐ Problematic Hydrophytic Vegetation¹ (Explain)
¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☒ No ☐

Remarks:

Vegetation updated in 2023.

Sampling Point: SP06j-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Indicators for Problematic Hydric Soils³:

- ³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Gleyed in second horizon.

Wetland Hydrology Indicators:

Secondary Indicators (2 or more required)

- Field Observations:**

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Soil is saturated at 12 inches. The site also has three secondary hydrologic indicators.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP07-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Sideslope Local relief (concave, convex, none): Convex Slope (%): 100
 Subregion (LRR): E 44 Lat: 45.383852 Long: -112.453258 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point on roadside fill slope.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>52</u></td> <td>x 3 = <u>156</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>15</u></td> <td>x 5 = <u>75</u></td> </tr> <tr> <td>Column Totals: <u>67</u> (A)</td> <td><u>231</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.45</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>52</u>	x 3 = <u>156</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>15</u>	x 5 = <u>75</u>	Column Totals: <u>67</u> (A)	<u>231</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>52</u>	x 3 = <u>156</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>15</u>	x 5 = <u>75</u>																	
Column Totals: <u>67</u> (A)	<u>231</u> (B)																	
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
1. <u>Bassia scoparia</u>	<u>45</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Bromus tectorum</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>UPL</u>															
3. <u>Elymus repens</u>	<u>7</u>		<u>FAC</u>															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>67</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>33</u>																		
Remarks: Site is dominated by kochia and cheatgrass.																		

SOIL

Sampling Point: SP07-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10YR 4/2						Loamy Sand	Gravelly.
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/11/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP07-w
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Lowland Local relief (concave, convex, none): concave Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.383868 Long: -112.4533 Datum: WGS84
 Soil Map Unit Name: Rivra NWI classification: PSS

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: DP in depression with shallow groundwater, surrounded by man-made upland grades. Confirmed in 2023.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A/B)
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
0 = Total Cover				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>10</u> x 1 = <u>10</u> FACW species <u>100</u> x 2 = <u>200</u> FAC species <u>15</u> x 3 = <u>45</u> FACU species <u>12</u> x 4 = <u>48</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>162</u> (A) <u>303</u> (B) Prevalence Index = B/A = <u>1.87</u>
Sapling/Shrub Stratum (Plot size: <u>15ft</u>)				
1. <u>Salix exigua</u>	35	<input checked="" type="checkbox"/>	FACW	
2. <u>Ribes aureum</u>	10	<input type="checkbox"/>	FAC	
3. <u>Rosa woodsii</u>	10	<input type="checkbox"/>	FACU	
4. _____	0	<input type="checkbox"/>		
5. _____	0	<input type="checkbox"/>		
55 = Total Cover				
Herb Stratum (Plot size: <u>5ft</u>)				
1. <u>Phalaris arundinacea</u>	65	<input checked="" type="checkbox"/>	FACW	
2. <u>Cirsium arvense</u>	15	<input type="checkbox"/>	FAC	
3. <u>Carex nebrascensis</u>	10	<input type="checkbox"/>	OBL	
4. <u>Cynoglossum officinale</u>	2	<input type="checkbox"/>	FACU	
5. _____	0	<input type="checkbox"/>		
6. _____	0	<input type="checkbox"/>		
7. _____	0	<input type="checkbox"/>		
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
92 = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
0 = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants <input type="checkbox"/> Problematic Hydrophytic Vegetation (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>				

Remarks:
 Vegetation updated in 2023 by R. McElDowney.

Sampling Point: SP07-w

[illegible]²Location: PL=Pore Lining, M=Matrix.

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Depleted matrix in second horizon.

Wetland Hydrology Indicators:

Secondary Indicators (2 or more required)

- | Primary Indicators (2 or more required) | | | Secondary Indicators (2 or more required) |
|--|---|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) | <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) | |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) | <input type="checkbox"/> Drainage Patterns (B10) | |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) | <input type="checkbox"/> Dry-Season Water Table (C2) | |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) | <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) | |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) | <input type="checkbox"/> Geomorphic Position (D2) | |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) | <input type="checkbox"/> Shallow Aquitard (D3) | |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) | <input checked="" type="checkbox"/> FAC-Neutral Test (D5) | |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) | <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) | |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) | <input type="checkbox"/> Frost-Heave Hummocks (D7) | |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | | | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | | | |

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Wetland Hydrology Present? Yes ☒ No ☐

Closed depression with shallow groundwater.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP08a-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Hillslope Local relief (concave, convex, none): Convex Slope (%): 5
 Subregion (LRR): E 44 Lat: 45.38469 Long: -112.453267 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland point on roadside fill slope.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>33.33</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>5</u> x 2 = <u>10</u> FAC species <u>0</u> x 3 = <u>0</u> FACU species <u>15</u> x 4 = <u>60</u> UPL species <u>23</u> x 5 = <u>115</u> Column Totals: <u>43</u> (A) <u>185</u> (B) Prevalence Index = B/A = <u>4.30</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Salix exigua</u>	<u>5</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>5</u> = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Bromus inermis</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>UPL</u>	
2. <u>Pascopyrum smithii</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
3. <u>Agropyron cristatum</u>	<u>3</u>	_____	<u>UPL</u>	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>38</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>62</u>				
Remarks: Site is dominated by smooth brome and western wheatgrass.				

SOIL

Sampling Point: SP08a-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 13	10YR 4/2						Loamy Sand	Gravelly.
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP08a-w
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.384681 Long: -112.453381 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: PSS, riverine sample point in a meander scar west of the highway.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>28</u> x 1 = <u>28</u> FACW species <u>80</u> x 2 = <u>160</u> FAC species <u>10</u> x 3 = <u>30</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>118</u> (A) <u>218</u> (B) Prevalence Index = B/A = <u>1.85</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Salix exigua</u>	<u>70</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
<u>70</u> = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Carex nebrascensis</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>OBL</u>	
2. <u>Phalaris arundinacea</u>	<u>10</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
3. <u>Alopecurus arundinaceus</u>	<u>5</u>	_____	<u>FAC</u>	
4. <u>Apocynum cannabinum</u>	<u>5</u>	_____	<u>FAC</u>	
5. <u>Typha latifolia</u>	<u>3</u>	_____	<u>OBL</u>	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
<u>48</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>52</u>				
Remarks: Site is dominated by coyote willow, Nebraska sedge, and reed canarygrass.				

SOIL

Sampling Point: SP08a-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 6	10YR 2/1	100					Clay Loam	
6 - 17	10YR 5/1	100					Sandy Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix in second horizon.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input checked="" type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Soils are saturated to the surface.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP08b-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Hillslope Local relief (concave, convex, none): Convex Slope (%): 10
 Subregion (LRR): E 44 Lat: 45.385085 Long: -112.453244 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Roadside upland sample point west of the highway.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>0</u></td> <td>x 3 = <u>0</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>60</u></td> <td>x 5 = <u>300</u></td> </tr> <tr> <td>Column Totals: <u>60</u> (A)</td> <td><u>300</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>5.00</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>0</u>	x 3 = <u>0</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>60</u>	x 5 = <u>300</u>	Column Totals: <u>60</u> (A)	<u>300</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>0</u>	x 3 = <u>0</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>60</u>	x 5 = <u>300</u>																	
Column Totals: <u>60</u> (A)	<u>300</u> (B)																	
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ <u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Bromus inermis</u> <u>60</u> <input checked="" type="checkbox"/> <u>UPL</u> 2. _____ 3. _____ 4. _____ 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ <u>60</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ <u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>40</u>																		
Remarks:																		
Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.																		
Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>																		
Site is dominated by smooth brome.																		

SOIL

Sampling Point: SP08b-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10YR 4/2						Loamy Sand	Gravelly
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-01
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP08b-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.385105 Long: -112.453316 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM, riverine/depressional.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>71</u> x 1 = <u>71</u> FACW species <u>5</u> x 2 = <u>10</u> FAC species <u>5</u> x 3 = <u>15</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>81</u> (A) <u>96</u> (B) Prevalence Index = B/A = <u>1.19</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Schoenoplectus acutus</u>	<u>65</u>	<input checked="" type="checkbox"/>	<u>OBL</u>	Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Alopecurus arundinaceus</u>	<u>5</u>	_____	<u>FAC</u>	
3. <u>Phalaris arundinacea</u>	<u>5</u>	_____	<u>FACW</u>	
4. <u>Typha latifolia</u>	<u>5</u>	_____	<u>OBL</u>	
5. <u>Asclepias incarnata</u>	<u>1</u>	_____	<u>OBL</u>	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>81</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>19</u>				
Remarks: PEM marsh dominated by hardstem bulrush.				

SOIL

Sampling Point: SP08b-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 1								Fibric
1 - 15	10YR 5/1	100					Loamy Sand	Gravelly
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix in second horizon.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input checked="" type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input checked="" type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Soil is saturated to the surface.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/11/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP08c-w
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Terrace Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.382633 Long: -112.453468 Datum: WGS84
 Soil Map Unit Name: Havre loam NWI classification: PEM

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
---	---

Remarks:

DP along lower river terrace with periodic overbank flows and high water table during spring.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:
1. _____	0	<input type="checkbox"/>		Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A)
2. _____	0	<input type="checkbox"/>		Total Number of Dominant Species Across All Strata: <u>2</u> (B)
3. _____	0	<input type="checkbox"/>		Percent of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A/B)
4. _____	0	<input type="checkbox"/>		
	0	= Total Cover		
Sapling/Shrub Stratum (Plot size: <u>15ft</u>)				Prevalence Index worksheet:
1. <u>Salix exigua</u>	30	<input checked="" type="checkbox"/>	FACW	Total % Cover of: _____ Multiply by: _____
2. _____	0	<input type="checkbox"/>		OBL species <u>0</u> x 1 = <u>0</u>
3. _____	0	<input type="checkbox"/>		FACW species <u>35</u> x 2 = <u>70</u>
4. _____	0	<input type="checkbox"/>		FAC species <u>95</u> x 3 = <u>285</u>
5. _____	0	<input type="checkbox"/>		FACU species <u>0</u> x 4 = <u>0</u>
	30	= Total Cover		UPL species <u>0</u> x 5 = <u>0</u>
Herb Stratum (Plot size: <u>5ft</u>)				Column Totals: <u>130</u> (A) <u>355</u> (B)
1. <u>Alopecurus arundinaceus</u>	95	<input checked="" type="checkbox"/>	FAC	Prevalence Index = B/A = <u>2.73077</u>
2. <u>Juncus arcticus</u>	5	<input type="checkbox"/>	FACW	
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
5. _____	0	<input type="checkbox"/>		
6. _____	0	<input type="checkbox"/>		
7. _____	0	<input type="checkbox"/>		
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
	100	= Total Cover		
Woody Vine Stratum (Plot size: _____)				
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
	0	= Total Cover		
% Bare Ground in Herb Stratum <u>0</u>				

Hydrophytic Vegetation Indicators:

- ☐ 1 - Rapid Test for Hydrophytic Vegetation
☒ 2 - Dominance Test is >50%
☒ 3 - Prevalence Index is ≤3.0¹
☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
☐ 5 - Wetland Non-Vascular Plants¹
☐ Problematic Hydrophytic Vegetation¹ (Explain)

¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☒ No ☐

Remarks:

Site is dominated by coyote willow and creeping meadow foxtail.

SOIL

Sampling Point: SP08c-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type	Loc ²		
0-5	10YR	3/2	100				Clay Loam	
5-10	10YR	4/2	95	10YR 4/4	5	C	M	Clay
10-16	10YR	5/1	95	7.5YR 4/6	5	C	M	Sandy Clay

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Site has a depleted matrix.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input checked="" type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☒ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☒ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Soils moist at 16in., seasonal high water table.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP08d-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Undulating Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.385553 Long: -112.453754 Datum: WGS 84
 Soil Map Unit Name: 327 - Chaffee, occasionally flooded-Beavrock, rarely flooded, Dillon families, complex 0 to 2 percent slopes NWI classification: PEM1C

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Check point to determine status of the site. The sample point is on a manmade berm that lacks wetland hydrology and hydric soils, despite being dominated by coyote willow.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>80</u></td> <td>x 2 = <u>160</u></td> </tr> <tr> <td>FAC species <u>80</u></td> <td>x 3 = <u>240</u></td> </tr> <tr> <td>FACU species <u>5</u></td> <td>x 4 = <u>20</u></td> </tr> <tr> <td>UPL species <u>5</u></td> <td>x 5 = <u>25</u></td> </tr> <tr> <td>Column Totals: <u>170</u> (A)</td> <td><u>445</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.62</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>80</u>	x 2 = <u>160</u>	FAC species <u>80</u>	x 3 = <u>240</u>	FACU species <u>5</u>	x 4 = <u>20</u>	UPL species <u>5</u>	x 5 = <u>25</u>	Column Totals: <u>170</u> (A)	<u>445</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>80</u>	x 2 = <u>160</u>																	
FAC species <u>80</u>	x 3 = <u>240</u>																	
FACU species <u>5</u>	x 4 = <u>20</u>																	
UPL species <u>5</u>	x 5 = <u>25</u>																	
Column Totals: <u>170</u> (A)	<u>445</u> (B)																	
Sapling/Shrub Stratum (Plot size: 15 ft r _____)																		
1. <u>Salix exigua</u>	<u>75</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
2. <u>Rosa woodsii</u>	<u>5</u>		<u>FACU</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>80</u> = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Herb Stratum (Plot size: 5 ft r _____)																		
1. <u>Cirsium arvense</u>	<u>80</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Elymus cinereus</u>	<u>5</u>		<u>UPL</u>															
3. <u>Phalaris arundinacea</u>	<u>5</u>		<u>FACW</u>															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>90</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>10</u>																		
Remarks:																		

Site is on a berm. Salix exigua has become established, but the understory is FAC to FACU.

SOIL

Sampling Point: SP08d-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 22	10YR 3/1	100					Clay Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology.

Sample point is on a berm adjacent to a marsh, and does not appear to have frequent enough saturation for long enough time to have wetland hydrology.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek-North City/County: Madison Sampling Date: 8/23/2015
 Applicant/Owner: MDT State: Montana Sampling Point: SP09-U
 Investigator(s): R McElowney Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.385721 Long: -112.452035 Datum: NAD83
 Soil Map Unit Name: 106 - Rivra, cool-fluvaquents complex, 0-2% slopes NWI classification: none

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	
Remarks: Upland pasture. Confirmed in 2023.			

VEGETATION - Use scientific names of plant

<u>Tree Stratum</u>	Plot size (30 Foot Radius)	Absolute % Cover:	Dominant Species?	Indicator Status	Dominance Test worksheet Number of Dominant Species that are OBL, FACW or FAC: <input type="text" value="2"/> (A) Total Number of Dominant Species Across All Strata: <input type="text" value="2"/> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <input type="text" value="100"/> % (A/B)														
<u>Sapling/Shrub Stratum</u>	Plot size (30 Foot Radius)					Prevalence Index worksheet <table border="1"> <thead> <tr> <th>Total % Cover of:</th> <th>Multiply by:</th> </tr> </thead> <tbody> <tr> <td>OBL species 0 X 1</td> <td><input type="text" value="0"/></td> </tr> <tr> <td>FACW species 25 X 2</td> <td><input type="text" value="50"/></td> </tr> <tr> <td>FAC species 75 X 3</td> <td><input type="text" value="225"/></td> </tr> <tr> <td>FACU species 0 X 4</td> <td><input type="text" value="0"/></td> </tr> <tr> <td>UPL species 0 X 5</td> <td><input type="text" value="0"/></td> </tr> <tr> <td>Column Totals <input type="text" value="100"/> (A)</td> <td><input type="text" value="275"/> (B)</td> </tr> </tbody> </table> Prevalence Index = B/A = 2.75	Total % Cover of:	Multiply by:	OBL species 0 X 1	<input type="text" value="0"/>	FACW species 25 X 2	<input type="text" value="50"/>	FAC species 75 X 3	<input type="text" value="225"/>	FACU species 0 X 4	<input type="text" value="0"/>	UPL species 0 X 5	<input type="text" value="0"/>	Column Totals <input type="text" value="100"/> (A)
Total % Cover of:	Multiply by:																		
OBL species 0 X 1	<input type="text" value="0"/>																		
FACW species 25 X 2	<input type="text" value="50"/>																		
FAC species 75 X 3	<input type="text" value="225"/>																		
FACU species 0 X 4	<input type="text" value="0"/>																		
UPL species 0 X 5	<input type="text" value="0"/>																		
Column Totals <input type="text" value="100"/> (A)	<input type="text" value="275"/> (B)																		
<u>Herbaceous Stratum</u>	Plot size (3 Foot Radius)				Hydrophytic Vegetation Indicators <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is <= 3.0 <input type="checkbox"/> 4 - Morphological Adaptations (Provide supporting data in remarks or on separate sheet.) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants <input type="checkbox"/> Problematic Hydrophytic Vegetation (Explain) Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic for #3, 4, 5.														
<table border="1"> <tbody> <tr> <td>Elymus repens</td> <td>75</td> <td><input checked="" type="checkbox"/></td> <td>FAC</td> </tr> <tr> <td>Plantago eriopoda</td> <td>25</td> <td><input checked="" type="checkbox"/></td> <td>FACW</td> </tr> </tbody> </table>	Elymus repens	75	<input checked="" type="checkbox"/>	FAC		Plantago eriopoda	25	<input checked="" type="checkbox"/>	FACW										
Elymus repens	75	<input checked="" type="checkbox"/>	FAC																
Plantago eriopoda	25	<input checked="" type="checkbox"/>	FACW																
<u>Woody Vine Stratum</u>	Plot size (30 Foot Radius)				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> NO <input type="checkbox"/>														
Percent Bare Ground	<u>0</u>																		

Remarks:
 Site has been heavily grazed.
 The site is primarily dominated by a FAC species, but shows no evidence of hydric soils or wetland hydrology.

SOIL

Sampling Point: SP09-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix			Redox Features				Texture	Remarks
	Color (moist)		%	Color (moist)	%	Type ¹	Loc ²		
0-2								fibric	
02-11	10YR	3/1	0		0			Silty Clay	
11-18	10YR	4/2	75	7.5YR	2.5/3	25	C M	Sandy Loam	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|---|
| <input type="checkbox"/> Histic Sol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒

Remarks:

No hydric soil indicators observed. Soil is dry throughout profile. Second horizon has white particles, possibly gypsum or calcium carbonate.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
☐ Drainage Patterns (B10)
☐ Dry-Season Water Table (C2)
☐ Saturation Visible on Aerial Imagery (C9)
☐ Geomorphic Position (D2)
☐ Shallow Aquitard (D3)
☐ FAC-Neutral Test (D5)
☐ Raised Ant Mounds (D6) (LRR A)
☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek-North City/County: Madison Sampling Date: 8/23/2015
 Applicant/Owner: MDT State: Montana Sampling Point: SP09-W
 Investigator(s): R McEldowney Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: -112.452708 Long: 45.385729 Datum: NAD83
 Soil Map Unit Name: 106 - Rivra, cool-fluvaquents complex, 0-2% slopes NWI classification: none

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: Palustrine emergent wetland, recently grazed. Site is in an old meander scar. Confirmed in 2023.		

VEGETATION - Use scientific names of plant

<u>Tree Stratum</u>	Plot size (30 Foot Radius)	Absolute % Cover:	Dominant Species?	Indicator Status
<u>Sapling/Shrub Stratum</u> Plot size (30 Foot Radius)				
<u>Herbaceous Stratum</u> Plot size (3 Foot Radius)				
Calamagrostis stricta	75	<input checked="" type="checkbox"/>	FACW	
Carex nebrascensis	2	<input type="checkbox"/>	OBL	
Carex sp.	5	<input type="checkbox"/>	NL	
Elymus glaucus	1	<input type="checkbox"/>	FACU	
Iris missouriensis	8	<input type="checkbox"/>	FACW	
Juncus balticus	10	<input type="checkbox"/>	FACW	
Potentilla anserina	3	<input type="checkbox"/>	OBL	
Sonchus arvensis	1	<input type="checkbox"/>	FACU	
Trifolium fragiferum	2	<input type="checkbox"/>	FACU	
Triglochin maritima	1	<input type="checkbox"/>	OBL	
unidentified forb	3	<input type="checkbox"/>		
<u>Woody Vine Stratum</u> Plot size (30 Foot Radius)				
Percent Bare Ground 0				

Dominance Test worksheet

Number of Dominant Species that are OBL, FACW or FAC: (A)

Total Number of Dominant Species Across All Strata: (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: % (A/B)

Prevalence Index worksheet

Total % Cover of:	Multiply by:
OBL species 6 X 1	<input type="text" value="6"/>
FACW species 93 X 2	<input type="text" value="186"/>
FAC species 0 X 3	<input type="text" value="0"/>
FACU species 4 X 4	<input type="text" value="16"/>
UPL species 8 X 5	<input type="text" value="40"/>
Column Totals <input type="text" value="111"/> (A)	<input type="text" value="248"/> (B)

Prevalence Index = B/A = 2.23423

Hydrophytic Vegetation Indicators

☐ 1 - Rapid Test for Hydrophytic Vegetation

☒ 2 - Dominance Test is >50%

☒ 3 - Prevalence Index is <= 3.0

☐ 4 - Morphological Adaptations (Provide supporting data in remarks or on separate sheet.)

☐ 5 - Wetland Non-Vascular Plants

☐ Problematic Hydrophytic Vegetation (Explain)

Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic for #3, 4, 5.

Hydrophytic Vegetation Present? Yes ☒ NO ☐

Remarks:
Site has been grazed.

US Army Corps of Engineers Western Mountains, Valleys, and Coasts - Version 2.0

SOIL

Sampling Point: SP09-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		%	Redox Features				Type ¹	Loc ²	Texture	Remarks
	Color (moist)			Color (moist)		%					
0-2	10YR	4/4	100							fibric	
2-8	2.5Y	4/1	97	7.5YR	4/6	3		C	PL	Silty Clay	
8-15	10YR	4/1	95	10YR	5/6	5		C	PL	Silty Clay	third layer is moist

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|---|
| <input type="checkbox"/> Histic Sol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix in second and third horizons.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
☐ Drainage Patterns (B10)
☐ Dry-Season Water Table (C2)
☐ Saturation Visible on Aerial Imagery (C9)
☒ Geomorphic Position (D2)
☐ Shallow Aquitard (D3)
☒ FAC-Neutral Test (D5)
☐ Raised Ant Mounds (D6) (LRR A)
☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Seasonally wet meadow. Expect this area to be saturated in upper 12 inches in spring and early summer

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP10a-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.387055 Long: -112.453279 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point roughly 16 inches higher in elevation than its paired wetland point.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>3</u> x 2 = <u>6</u> FAC species <u>3</u> x 3 = <u>9</u> FACU species <u>55</u> x 4 = <u>220</u> UPL species <u>2</u> x 5 = <u>10</u> Column Totals: <u>63</u> (A) <u>245</u> (B) Prevalence Index = B/A = <u>3.89</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				
1. <u>Pascopyrum smithii</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Elymus lanceolatus</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
3. <u>Bromus inermis</u>	<u>2</u>	<input type="checkbox"/>	<u>UPL</u>	
4. <u>Muhlenbergia asperifolia</u>	<u>2</u>	<input type="checkbox"/>	<u>FACW</u>	
5. <u>Asclepias fascicularis</u>	<u>1</u>	<input type="checkbox"/>	<u>FAC</u>	
6. <u>Asclepias speciosa</u>	<u>1</u>	<input type="checkbox"/>	<u>FAC</u>	
7. <u>Equisetum arvense</u>	<u>1</u>	<input type="checkbox"/>	<u>FAC</u>	
8. <u>Juncus balticus</u>	<u>1</u>	<input type="checkbox"/>	<u>FACW</u>	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>63</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>37</u>				
Remarks: Site is dominated by western wheatgrass.				

SOIL

Sampling Point: SP10a-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 1								Litter
1 - 15	10YR 2/1	100					Silt Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/12/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP10a-w
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Swale Local relief (concave, convex, none): concave Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.387017 Long: -112.453295 Datum: WGS84
 Soil Map Unit Name: Villy silty clay loam NWI classification: PSS

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
---	---

Remarks:
 DP in cattail/willow depression, culvert under road at drain point.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:
1. _____	0	<input type="checkbox"/>		Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A)
2. _____	0	<input type="checkbox"/>		Total Number of Dominant Species Across All Strata: <u>3</u> (B)
3. _____	0	<input type="checkbox"/>		Percent of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A/B)
4. _____	0	<input type="checkbox"/>		
0 = Total Cover				
Sapling/Shrub Stratum (Plot size: <u>15ft</u>)				Prevalence Index worksheet:
1. <u>Ribes inerme</u>	5	<input type="checkbox"/>	FAC	Total % Cover of: _____ Multiply by: _____
2. <u>Salix exigua</u>	45	<input checked="" type="checkbox"/>	FACW	OBL species <u>15</u> x 1 = <u>15</u>
3. _____	0	<input type="checkbox"/>		FACW species <u>85</u> x 2 = <u>170</u>
4. _____	0	<input type="checkbox"/>		FAC species <u>5</u> x 3 = <u>15</u>
5. _____	0	<input type="checkbox"/>		FACU species <u>0</u> x 4 = <u>0</u>
50 = Total Cover				UPL species <u>0</u> x 5 = <u>0</u>
Herb Stratum (Plot size: <u>5ft</u>)				Column Totals: <u>151</u> (A) <u>230</u> (B)
1. <u>Phalaris arundinacea</u>	40	<input checked="" type="checkbox"/>	FACW	Prevalence Index = B/A = <u>1.5232</u>
2. <u>Carex nebrascensis</u>	5	<input type="checkbox"/>	OBL	
3. <u>Schoenoplectus acutus</u>	10	<input type="checkbox"/>	OBL	
4. _____		<input type="checkbox"/>		
5. _____		<input type="checkbox"/>		
6. _____		<input type="checkbox"/>		
7. _____	0	<input type="checkbox"/>		
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
55 = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
0 = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				

Hydrophytic Vegetation Present? Yes ☒ No ☐

Remarks:
 PSS dominated by coyote willow and reed canarygrass.

SOIL

Sampling Point: **SP10a-w**

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type	Loc ²		
0-10	10YR 2/1	100					Clay Loam	
10-16	10YR 4/2	95	10YR 3/3	5	C	M	Clay	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix in second horizon.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☒ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☒ Saturation Visible on Aerial Imagery (C9)
- ☒ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☒ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): **12**

(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Soil saturated at 12 inches. Passes four secondary hydrologic indicators.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP10b-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 2
 Subregion (LRR): E 44 Lat: 45.387133 Long: -112.452723 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point. Sample point is roughly 2 feet higher in elevation compared to the paired wetland point.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
_____ = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>42</u></td> <td>x 2 = <u>84</u></td> </tr> <tr> <td>FAC species <u>20</u></td> <td>x 3 = <u>60</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>62</u> (A)</td> <td><u>144</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.32</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>42</u>	x 2 = <u>84</u>	FAC species <u>20</u>	x 3 = <u>60</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>62</u> (A)	<u>144</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>42</u>	x 2 = <u>84</u>																	
FAC species <u>20</u>	x 3 = <u>60</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>62</u> (A)	<u>144</u> (B)																	
_____ = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ _____ = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u> _____) 1. <u>Spartina gracilis</u> <u>40</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. <u>Sporobolus airoides</u> <u>15</u> <input checked="" type="checkbox"/> <u>FAC</u> 3. <u>Bassia scoparia</u> <u>5</u> <input type="checkbox"/> <u>FAC</u> 4. <u>Plantago eriopoda</u> <u>2</u> <input type="checkbox"/> <u>FACW</u> 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ _____ = Total Cover																		
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ _____ = Total Cover																		
% Bare Ground in Herb Stratum <u>38</u>																		
Remarks: Sample point is dominated by FAC and FACW species, though it lacks wetland hydrology.																		

SOIL

Sampling Point: SP10b-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 2/1	100					Silty Clay Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____
Water Table Present? Yes _____ No ☒ Depth (inches): _____
Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed. Site is approx. 2 ft higher in elevation compared to the paired wetland point.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP10b-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Meander Scar Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.387029 Long: -112.452768 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM, riverine. Sample point is in old meander scar east of teh highway. The highway cut off this part of the meander scar, from the rest of it west of the highway.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>5</u></td> <td>x 1 = <u>5</u></td> </tr> <tr> <td>FACW species <u>2</u></td> <td>x 2 = <u>4</u></td> </tr> <tr> <td>FAC species <u>80</u></td> <td>x 3 = <u>240</u></td> </tr> <tr> <td>FACU species <u>1</u></td> <td>x 4 = <u>4</u></td> </tr> <tr> <td>UPL species <u>5</u></td> <td>x 5 = <u>25</u></td> </tr> <tr> <td>Column Totals: <u>93</u> (A)</td> <td><u>278</u> (B)</td> </tr> </table>	Total % Cover of:	Multiply by:	OBL species <u>5</u>	x 1 = <u>5</u>	FACW species <u>2</u>	x 2 = <u>4</u>	FAC species <u>80</u>	x 3 = <u>240</u>	FACU species <u>1</u>	x 4 = <u>4</u>	UPL species <u>5</u>	x 5 = <u>25</u>	Column Totals: <u>93</u> (A)	<u>278</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>5</u>	x 1 = <u>5</u>																	
FACW species <u>2</u>	x 2 = <u>4</u>																	
FAC species <u>80</u>	x 3 = <u>240</u>																	
FACU species <u>1</u>	x 4 = <u>4</u>																	
UPL species <u>5</u>	x 5 = <u>25</u>																	
Column Totals: <u>93</u> (A)	<u>278</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u> _____)																		
1. <u>Muhlenbergia richardsonis</u>	<u>45</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Agrostis stolonifera</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
3. <u>Cirsium arvense</u>	<u>5</u>		<u>FAC</u>															
4. <u>Medicago sativa</u>	<u>5</u>		<u>UPL</u>															
5. <u>Carex nebrascensis</u>	<u>3</u>		<u>OBL</u>															
6. <u>Juncus balticus</u>	<u>2</u>		<u>FACW</u>															
7. <u>Schoenoplectus pungens</u>	<u>2</u>		<u>OBL</u>															
8. <u>Sonchus arvensis</u>	<u>1</u>		<u>FACU</u>															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>93</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>7</u>																		
Remarks: PEM, dominated by FAC vegetation.																		

SOIL

Sampling Point: SP10b-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 4	10YR 3/1	98	10YR 4/6	2	C	PL	Clay	
4 - 16	10YR 4/1	100					Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input checked="" type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Hydric soils are indicated by the presence of the redox dark surface indicator.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Oxidized rhizospheres occur in the upper soil horizon. Site occurs in the bottom of a meander scar.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Beaverhead Co Sampling Date: 6/12/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP10c-u
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Lowland Local relief (concave, convex, none): flat Slope (%): 1.74
 Subregion (LRR): LRR E Lat: 45.386273 Long: -112.453295 Datum: WGS84
 Soil Map Unit Name: Villy silty clay loam NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	

Remarks:

DP along slight, subtle rise in topo.
Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
0 = Total Cover			
Sapling/Shrub Stratum (Plot size: _____)	0	<input type="checkbox"/>	
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
0 = Total Cover			
Herb Stratum (Plot size: <u>5ft</u>)	90	<input checked="" type="checkbox"/>	UPL
1. <u>Bromus inermis</u>	5	<input type="checkbox"/>	FAC
2. <u>Cirsium arvense</u>	5	<input type="checkbox"/>	FAC
3. <u>Asclepias speciosa</u>	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
6. _____	0	<input type="checkbox"/>	
7. _____	0	<input type="checkbox"/>	
8. _____	0	<input type="checkbox"/>	
9. _____	0	<input type="checkbox"/>	
10. _____	0	<input type="checkbox"/>	
11. _____	0	<input type="checkbox"/>	
100 = Total Cover			
Woody Vine Stratum (Plot size: _____)	0	<input type="checkbox"/>	
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
0 = Total Cover			
% Bare Ground in Herb Stratum	0		

Dominance Test worksheet:
 Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)
 Total Number of Dominant Species Across All Strata: 1 (B)
 Percent of Dominant Species That Are OBL, FACW, or FAC: 1 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:	
OBL species <u>0</u>	x 1 =	<u>0</u>
FACW species <u>0</u>	x 2 =	<u>0</u>
FAC species <u>10</u>	x 3 =	<u>30</u>
FACU species <u>0</u>	x 4 =	<u>0</u>
UPL species <u>90</u>	x 5 =	<u>450</u>
Column Totals: <u>100</u> (A)		<u>480</u> (B)

 Prevalence Index = B/A = 4.80

Hydrophytic Vegetation Indicators:
☐ 1 - Rapid Test for Hydrophytic Vegetation
☐ 2 - Dominance Test is >50%
☐ 3 - Prevalence Index is ≤3.0¹
☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
☐ 5 - Wetland Non-Vascular Plants
☐ Problematic Hydrophytic Vegetation (Explain)
¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☐ No ☒

Remarks:

Adjacent species in same community indicative of upland community.

SOILSampling Point: **SP10c-u****Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features						Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²				
0-5	10YR 2/2	100							Loam	
5-12	10YR 4/2	100							Silty Clay Loam	
12-16	10YR 6/1	95	10YR 6/2	5	C	M			Sandy Loam	Very faint redox at 14in.

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒

Remarks:

Redox below 12in.

HYDROLOGY**Wetland Hydrology Indicators:****Primary Indicators (minimum of one required; check all that apply)**

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Infrequent and short duration high water table, no signs of surface hydro.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP11a-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Hillslope Local relief (concave, convex, none): Concave Slope (%): 25
 Subregion (LRR): E 44 Lat: 45.388638 Long: -112.453124 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Hydic Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point on road fill sideslope.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____)		<u>0</u> = Total Cover		Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>70</u></td> <td>x 3 = <u>210</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>1</u></td> <td>x 5 = <u>5</u></td> </tr> <tr> <td>Column Totals: <u>71</u> (A)</td> <td><u>215</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.03</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>70</u>	x 3 = <u>210</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>1</u>	x 5 = <u>5</u>	Column Totals: <u>71</u> (A)	<u>215</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>70</u>	x 3 = <u>210</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>1</u>	x 5 = <u>5</u>																	
Column Totals: <u>71</u> (A)	<u>215</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>)		<u>0</u> = Total Cover																
1. <u>Elymus repens</u>	<u>70</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Bromus inermis</u>	<u>1</u>		<u>UPL</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
Woody Vine Stratum (Plot size: _____)		<u>71</u> = Total Cover		Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
% Bare Ground in Herb Stratum <u>30</u>		<u>0</u> = Total Cover																
Remarks: Site is dominated by quackgrass.		Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>																

SOIL

Sampling Point: SP11a-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3	10YR 4/3						Sandy Clay Loam	
3 - 12	10YR 5/3	100					Sandy Loam	Gravelly
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/13/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP11a-w
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Valley bottom Local relief (concave, convex, none): concave Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.388663 Long: -112.45332 Datum: WGS84
 Soil Map Unit Name: Villy silty clay loam NWI classification: PEM

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes ☒ No ☐
 Hydric Soil Present? Yes ☒ No ☐
 Wetland Hydrology Present? Yes ☒ No ☐

Is the Sampled Area within a Wetland? Yes ☒ No ☐

Remarks:

DP in bulrush/cattail com, saturated soil surface.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: _____)			
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
	0 = Total Cover		
Herb Stratum (Plot size: 5ft _____)			
1. <u>Schoenoplectus acutus</u>	80	<input checked="" type="checkbox"/>	OBL
2. <u>Typha latifolia</u>	20	<input checked="" type="checkbox"/>	OBL
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
6. _____	0	<input type="checkbox"/>	
7. _____	0	<input type="checkbox"/>	
8. _____	0	<input type="checkbox"/>	
9. _____	0	<input type="checkbox"/>	
10. _____	0	<input type="checkbox"/>	
11. _____	0	<input type="checkbox"/>	
	100 = Total Cover		
Woody Vine Stratum (Plot size: _____)			
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
	0 = Total Cover		
% Bare Ground in Herb Stratum _____	0		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)
 Total Number of Dominant Species Across All Strata: 2 (B)
 Percent of Dominant Species That Are OBL, FACW, or FAC: 1 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:	
OBL species <u>100</u>	x 1 =	<u>100</u>
FACW species <u>0</u>	x 2 =	<u>0</u>
FAC species <u>0</u>	x 3 =	<u>0</u>
FACU species <u>0</u>	x 4 =	<u>0</u>
UPL species <u>0</u>	x 5 =	<u>0</u>
Column Totals: <u>100</u> (A)		<u>100</u> (B)
Prevalence Index = B/A = <u>1</u>		

Hydrophytic Vegetation Indicators:

- ☐ 1 - Rapid Test for Hydrophytic Vegetation
☒ 2 - Dominance Test is >50%
☒ 3 - Prevalence Index is ≤3.0¹
☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
☐ 5 - Wetland Non-Vascular Plants
☐ Problematic Hydrophytic Vegetation (Explain)
¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☒ No ☐

Remarks:

PEM marsh.

Sampling Point: SP11a-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- ³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Sulfidic odor detected.

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- Secondary Indicators (2 or more required)**

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☒ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☒ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☒ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches):

Water Table Present? Yes ☒ No ☐ Depth (inches): 3

Saturation Present? Yes ☒ No ☐ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Site has multiple primary and secondary hydrologic indicators.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/12/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP11b-u
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Valley bottom Local relief (concave, convex, none): convex Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.387682 Long: -112.453533 Datum: WGS84
 Soil Map Unit Name: Villy silty clay loam NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Hydric Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
---	---

Remarks:
 DP in upland on slight rise above adjacent wetland.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:
1. _____	0	<input type="checkbox"/>		Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A)
2. _____	0	<input type="checkbox"/>		Total Number of Dominant Species Across All Strata: <u>4</u> (B)
3. _____	0	<input type="checkbox"/>		Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.5</u> (A/B)
4. _____	0	<input type="checkbox"/>		
0 = Total Cover				
Sapling/Shrub Stratum (Plot size: <u>15ft</u>)				Prevalence Index worksheet:
1. <u>Sarcobatus vermiculatus</u>	25	<input checked="" type="checkbox"/>	FACU	Total % Cover of: _____ Multiply by: _____
2. _____	0	<input type="checkbox"/>		OBL species <u>0</u> x 1 = <u>0</u>
3. _____	0	<input type="checkbox"/>		FACW species <u>0</u> x 2 = <u>0</u>
4. _____	0	<input type="checkbox"/>		FAC species <u>70</u> x 3 = <u>210</u>
5. _____	0	<input type="checkbox"/>		FACU species <u>25</u> x 4 = <u>100</u>
25 = Total Cover				UPL species <u>25</u> x 5 = <u>125</u>
				Column Totals: <u>120</u> (A) <u>435</u> (B)
				Prevalence Index = B/A = <u>3.625</u>
Herb Stratum (Plot size: <u>5ft</u>)				Hydrophytic Vegetation Indicators:
1. <u>Cardaria draba</u>	25	<input checked="" type="checkbox"/>	UPL	<input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation
2. <u>Poa pratensis</u>	20	<input checked="" type="checkbox"/>	FAC	<input type="checkbox"/> 2 - Dominance Test is >50%
3. <u>Bromus inermis</u>	40	<input checked="" type="checkbox"/>	FAC	<input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹
4. <u>Glycyrrhiza lepidota</u>	10	<input type="checkbox"/>	FAC	<input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet)
5. _____	0	<input type="checkbox"/>		<input type="checkbox"/> 5 - Wetland Non-Vascular Plants
6. _____	0	<input type="checkbox"/>		<input type="checkbox"/> Problematic Hydrophytic Vegetation (Explain)
7. _____	0	<input type="checkbox"/>		¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
95 = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
0 = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				

Remarks:
 Upland sample point dominated by greasewood and smooth brome.

SOIL

Sampling Point: SP-11b-u

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type	Loc ²		
0-6	10YR	2/3	100				Clay Loam	
6-12	10YR	4/3	100				Clay	
12-16	10YR	4/2	100				Clay	No redox

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No surface hydro indicators

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP11c-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.388069 Long: -112.454144 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland island.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>48</u> x 2 = <u>96</u> FAC species <u>17</u> x 3 = <u>51</u> FACU species <u>35</u> x 4 = <u>140</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>100</u> (A) <u>287</u> (B) Prevalence Index = B/A = <u>2.87</u>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Spartina gracilis</u>	<u>45</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. <u>Pascopyrum smithii</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
3. <u>Asclepias speciosa</u>	<u>10</u>	<input type="checkbox"/>	<u>FAC</u>	
4. <u>Elymus lanceolatus</u>	<u>10</u>	<input type="checkbox"/>	<u>FACU</u>	
5. <u>Sporobolus airoides</u>	<u>5</u>	<input type="checkbox"/>	<u>FAC</u>	
6. <u>Juncus balticus</u>	<u>3</u>	<input type="checkbox"/>	<u>FACW</u>	
7. <u>Equisetum arvense</u>	<u>1</u>	<input type="checkbox"/>	<u>FAC</u>	
8. <u>Glycyrrhiza lepidota</u>	<u>1</u>	<input type="checkbox"/>	<u>FAC</u>	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>100</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				
Remarks: Both FACU and FACW vegetation are dominate at this sample point, which suggests that something other than hydrology is driving plant tolerance/abundance, such as soil salinity and/or alkalinity.				

SOIL

Sampling Point: SP11c-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3								Fibric
3 - 9	10YR 3/1	100					Silty Clay Loam	CaCO3 crystals.
9 - 18	10YR 4/1	100					Silty Clay Loam	
18 - 22	10YR 4/1	99	10YR 4/4	1	C	M	Silty Clay Loam	
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

Soil does not qualify as hydric.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____

(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Despite being dominated by the rhizomatous alkali cord grass this Upland Island does not show enough evidence that it has the frequency and duration of soil saturation to qualify as a wetland.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-02
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP11d-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.388519 Long: -112.453874 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>0</u> x 3 = <u>0</u> FACU species <u>100</u> x 4 = <u>400</u> UPL species <u>1</u> x 5 = <u>5</u> Column Totals: <u>101</u> (A) <u>405</u> (B) Prevalence Index = B/A = <u>4.01</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u>)				
1. <u>Elymus lanceolatus</u>	<u>100</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Cardaria draba</u>	<u>1</u>		<u>UPL</u>	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>101</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				
Remarks: Monoculture of streamside wheatgrass. Very thick.				

SOIL

Sampling Point: SP11d-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3								Fibric
3 - 8	10YR 4/2						Sandy Clay Loam	
8 - 16	10YR 2/2						Silty Clay Loam	
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-04
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP12a-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Undulating Slope (%): 5
 Subregion (LRR): E 44 Lat: 45.388632 Long: -112.454887 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland point near irrigation canal.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____)		<u>0</u> = Total Cover		Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>90</u></td> <td>x 3 = <u>270</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>2</u></td> <td>x 5 = <u>10</u></td> </tr> <tr> <td>Column Totals: <u>92</u> (A)</td> <td><u>280</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.04</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>90</u>	x 3 = <u>270</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>2</u>	x 5 = <u>10</u>	Column Totals: <u>92</u> (A)	<u>280</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>90</u>	x 3 = <u>270</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>2</u>	x 5 = <u>10</u>																	
Column Totals: <u>92</u> (A)	<u>280</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>)		<u>0</u> = Total Cover																
1. <u>Elymus repens</u>	<u>90</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Cardaria draba</u>	<u>2</u>		<u>UPL</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
Woody Vine Stratum (Plot size: _____)		<u>92</u> = Total Cover		Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
% Bare Ground in Herb Stratum <u>8</u>		<u>0</u> = Total Cover																
Remarks: Upland point dominated by quackgrass.		Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>																

SOIL

Sampling Point: SP12a-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 2/1	100					Silt Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-04
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP12a-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Undulating Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.388774 Long: -112.454896 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: Moved point several times to avoid digging in spoil from canal cleaning, while still staying within the project boundary. PEM, riverine.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>66.67</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ _____ = Total Cover				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>20</u> x 1 = <u>20</u> FACW species <u>20</u> x 2 = <u>40</u> FAC species <u>0</u> x 3 = <u>0</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>10</u> x 5 = <u>50</u> Column Totals: <u>50</u> (A) <u>110</u> (B) Prevalence Index = B/A = <u>2.20</u>
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Helianthus nuttallii</u> <u>15</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. <u>Schoenoplectus acutus</u> <u>15</u> <input checked="" type="checkbox"/> <u>OBL</u> 3. <u>Cardaria draba</u> <u>10</u> <input checked="" type="checkbox"/> <u>UPL</u> 4. <u>Calamagrostis stricta</u> <u>5</u> <input type="checkbox"/> <u>FACW</u> 5. <u>Typha latifolia</u> <u>5</u> <input type="checkbox"/> <u>OBL</u> 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ _____ = Total Cover				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ _____ = Total Cover				
% Bare Ground in Herb Stratum <u>50</u>				
Remarks: PEM marsh.				

SOIL

Sampling Point: SP12a-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3	10YR 3/2	100					Silt Loam	
3 - 15	N 3/0	100					Silty Clay Loam	Gleyed
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input checked="" type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Sulfidic odor in second horizon. Soil very moist.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Sulfidic odor detected in second horizon.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-04
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP12b-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.388792 Long: -112.454317 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: Patch of PSS surrounded by a cattail marsh.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
_____ = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>21</u></td> <td>x 1 = <u>21</u></td> </tr> <tr> <td>FACW species <u>65</u></td> <td>x 2 = <u>130</u></td> </tr> <tr> <td>FAC species <u>0</u></td> <td>x 3 = <u>0</u></td> </tr> <tr> <td>FACU species <u>15</u></td> <td>x 4 = <u>60</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>101</u> (A)</td> <td><u>211</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.09</u>	Total % Cover of:	Multiply by:	OBL species <u>21</u>	x 1 = <u>21</u>	FACW species <u>65</u>	x 2 = <u>130</u>	FAC species <u>0</u>	x 3 = <u>0</u>	FACU species <u>15</u>	x 4 = <u>60</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>101</u> (A)	<u>211</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>21</u>	x 1 = <u>21</u>																	
FACW species <u>65</u>	x 2 = <u>130</u>																	
FAC species <u>0</u>	x 3 = <u>0</u>																	
FACU species <u>15</u>	x 4 = <u>60</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>101</u> (A)	<u>211</u> (B)																	
Sapling/Shrub Stratum (Plot size: _____) 1. <u>Salix exigua</u> <u>65</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. <u>Rosa woodsii</u> <u>15</u> <input type="checkbox"/> <u>FACU</u> 3. _____ 4. _____ 5. _____ _____ = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Typha latifolia</u> <u>20</u> <input checked="" type="checkbox"/> <u>OBL</u> 2. <u>Schoenoplectus acutus</u> <u>1</u> <input type="checkbox"/> <u>OBL</u> 3. _____ 4. _____ 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ _____ = Total Cover																		
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ _____ = Total Cover																		
% Bare Ground in Herb Stratum <u>80</u>																		
Remarks: Patch of coyote willow surrounded by a cattail marsh.																		

SOIL

Sampling Point: SP12b-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features			Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹		
0 - 6	10YR 4/1	98	10YR 4/6	2	C	PL	Silt Loam
6 - 16	N 2/0	100					Silty Clay
-							Gleyed.
-							
-							
-							
-							
-							

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input checked="" type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Gleyed in second horizon.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____
Water Table Present? Yes ☐ No ☒ Depth (inches): _____
Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Oxidized rhizospheres, geomorphic position and passing the FAC-neutral test are all indicative of wetland hydrology.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-04
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP12c-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Sideslope Local relief (concave, convex, none): Convex Slope (%): 50
 Subregion (LRR): E 44 Lat: 45.389997 Long: -112.452868 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Adjacent to guardrail. Upland sample point.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>3</u> x 2 = <u>6</u> FAC species <u>97</u> x 3 = <u>291</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>100</u> (A) <u>297</u> (B) Prevalence Index = B/A = <u>2.97</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u>)				
1. <u>Bassia scoparia</u>	<u>97</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Phragmites australis</u>	<u>3</u>		<u>FACW</u>	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>100</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				
Remarks: Site is dominated by kochia.				

SOIL

Sampling Point: SP12c-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10YR 3/2	100					Sandy Loam	Gravelly
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/13/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP12c-w
 Investigator(s): B Sandefur Section, Township, Range: S T R
 Landform (hillslope, terrace, etc.): Valley bottom Local relief (concave, convex, none): concave Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.389992 Long: -112.452952 Datum: WGS84
 Soil Map Unit Name: Villy silty clay loam NWI classification: PEM

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	

Remarks:

DP in common reed veg community, surface water present in lowest depressions.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
0 = Total Cover			
Sapling/Shrub Stratum (Plot size: _____)			
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
0 = Total Cover			
Herb Stratum (Plot size: 5ft)			
1. <u>Phragmites australis</u>	95	<input checked="" type="checkbox"/>	FACW
2. <u>Schoenoplectus acutus</u>	5	<input type="checkbox"/>	OBL
3. _____	0	<input type="checkbox"/>	
4. _____	0	<input type="checkbox"/>	
5. _____	0	<input type="checkbox"/>	
6. _____	0	<input type="checkbox"/>	
7. _____	0	<input type="checkbox"/>	
8. _____	0	<input type="checkbox"/>	
9. _____	0	<input type="checkbox"/>	
10. _____	0	<input type="checkbox"/>	
11. _____	0	<input type="checkbox"/>	
100 = Total Cover			
Woody Vine Stratum (Plot size: _____)			
1. _____	0	<input type="checkbox"/>	
2. _____	0	<input type="checkbox"/>	
0 = Total Cover			
% Bare Ground in Herb Stratum	0		

Dominance Test worksheet:			
Number of Dominant Species That Are OBL, FACW, or FAC:	1	(A)	
Total Number of Dominant Species Across All Strata:	1	(B)	
Percent of Dominant Species That Are OBL, FACW, or FAC:	1	(A/B)	
Prevalence Index worksheet:			
Total % Cover of:		Multiply by:	
OBL species	5	x 1 =	5
FACW species	95	x 2 =	190
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100	(A)	195 (B)
Prevalence Index = B/A = 1.95			
Hydrophytic Vegetation Indicators:			
<input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation			
<input checked="" type="checkbox"/> 2 - Dominance Test is >50%			
<input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹			
<input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet)			
<input type="checkbox"/> 5 - Wetland Non-Vascular Plants			
<input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain)			
¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.			
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			

Remarks:

PEM marsh.

SOIL

Sampling Point: SP12c-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		%	Redox Features				Texture	Remarks
	Color (moist)			Color (moist)		Type	Loc ²		
0-12	10YR	2/1	97	10YR	3/4	3	C	PL	Muck

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input checked="" type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Redox dark surface hydric soil indicator observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|---|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input checked="" type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input checked="" type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☒ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☒ No ☐ Depth (inches): 3

Saturation Present? Yes ☒ No ☐ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Site has several primary hydrologic indicators.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP12d-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Convex Slope (%): 40
 Subregion (LRR): E 44 Lat: 45.39214 Long: -112.452291 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Hydic Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland point on road prism.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: <u>15 ft r</u>) 1. <u>Salix exigua</u> <u>30</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. _____ 3. _____ 4. _____ 5. _____ <u>30</u> = Total Cover				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>30</u> x 2 = <u>60</u> FAC species <u>60</u> x 3 = <u>180</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>6</u> x 5 = <u>30</u> Column Totals: <u>96</u> (A) <u>270</u> (B) Prevalence Index = B/A = <u>2.81</u>
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Bassia scoparia</u> <u>45</u> <input checked="" type="checkbox"/> <u>FAC</u> 2. <u>Elymus repens</u> <u>15</u> <input checked="" type="checkbox"/> <u>FAC</u> 3. <u>Centaurea biebersteinii</u> <u>3</u> <input type="checkbox"/> <u>UPL</u> 4. <u>Descurainia sophia</u> <u>3</u> <input type="checkbox"/> <u>UPL</u> 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ <u>66</u> = Total Cover				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ <u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>34</u>				
Remarks: Upland sample point with coyote willow and an understory dominated by kochia and quackgrass.				

SOIL

Sampling Point: SP12d-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10YR 4/2	60					Sandy Clay Loam	Gravelly.
0 - 12	10YR 5/3	40						
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP12d-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.392138 Long: -112.452333 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: PSS wetland along right bank of IR-1.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>66.67</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: <u>15 ft r</u>) 1. <u>Salix exigua</u> <u>65</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. _____ 3. _____ 4. _____ 5. _____ <u>65</u> = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Galium boreale</u> <u>20</u> <input checked="" type="checkbox"/> <u>FACU</u> 2. <u>Sonchus arvensis</u> <u>15</u> <u>FACU</u> 3. <u>Asclepias speciosa</u> <u>5</u> <u>FAC</u> 4. <u>Schoenoplectus acutus</u> <u>5</u> <u>OBL</u> 5. <u>Cirsium arvense</u> <u>3</u> <input checked="" type="checkbox"/> <u>FAC</u> 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ <u>48</u> = Total Cover				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ <u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>30</u>				
Remarks:				
PSS dominated by coyote willow.				
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>				

SOIL

Sampling Point: SP12d-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 10	10YR 4/1	98	10YR 4/4	2	C		Silty Clay	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix. Cobbles at 10 inches prevent digging deeper.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Oxidized rhizospheres found along pore linings.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek-North City/County: Madison Sampling Date: 8/23/2015
 Applicant/Owner: MDT State: Montana Sampling Point: SP13a-u
 Investigator(s): R McEldowney Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Swale Local relief (concave, convex, none): concave Slope (%): 1
 Subregion (LRR): LRR E Lat: 45.387549 Long: -112.452722 Datum: NAD83
 Soil Map Unit Name: 150-Villy silty clay loam, 0-2% slopes NMI classification: none

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>			
Wetland Hydrology Present?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>			
Remarks: Confirmed in 2023.					

VEGETATION - Use scientific names of plant

Tree Stratum	Plot size (30 Foot Radius)	Absolute % Cover:	Dominant Species?	Indicator Status	Dominance Test worksheet Number of Dominant Species that are OBL, FACW or FAC: 1 (A) Total Number of Dominant Species Across All Strata: 1 (B) Percent of Dominant Species That Are OBL, FACW, or FAC: 100 % (A/B) Prevalence Index worksheet <table border="1"> <thead> <tr> <th>Total % Cover of:</th> <th>Multiply by:</th> </tr> </thead> <tbody> <tr> <td>OBL species 1 X 1</td> <td>1</td> </tr> <tr> <td>FACW species 91 X 2</td> <td>182</td> </tr> <tr> <td>FAC species 5 X 3</td> <td>15</td> </tr> <tr> <td>FACU species 3 X 4</td> <td>12</td> </tr> <tr> <td>UPL species 0 X 5</td> <td>0</td> </tr> <tr> <td>Column Totals 100 (A)</td> <td>210 (B)</td> </tr> </tbody> </table> Prevalence Index = B/A = 2.1	Total % Cover of:	Multiply by:	OBL species 1 X 1	1	FACW species 91 X 2	182	FAC species 5 X 3	15	FACU species 3 X 4	12	UPL species 0 X 5	0	Column Totals 100 (A)	210 (B)
Total % Cover of:	Multiply by:																		
OBL species 1 X 1	1																		
FACW species 91 X 2	182																		
FAC species 5 X 3	15																		
FACU species 3 X 4	12																		
UPL species 0 X 5	0																		
Column Totals 100 (A)	210 (B)																		
Sapling/Shrub Stratum	Plot size (30 Foot Radius)																		
Herbaceous Stratum	Plot size (3 Foot Radius)																		
Calamagrostis stricta 80 <input checked="" type="checkbox"/> FACW Carex sp. 1 <input type="checkbox"/> NL Cirsium arvense 2 <input type="checkbox"/> FAC Equisetum hyemale 1 <input type="checkbox"/> FACW Juncus balticus 5 <input type="checkbox"/> FACW Plantago eriopoda 5 <input type="checkbox"/> FACW Polemonium pulcherrimum 5 <input type="checkbox"/> NL Schoenoplectus pungens 1 <input type="checkbox"/> OBL Sonchus arvensis 1 <input type="checkbox"/> FACU Symphyotrichum ericoides 3 <input type="checkbox"/> FAC Trifolium fragiferum 2 <input type="checkbox"/> FACU																			
Woody Vine Stratum	Plot size (30 Foot Radius)																		
Percent Bare Ground 0																			
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> NO <input type="checkbox"/>																			

Remarks:
Upland swale with hydrophytic vegetation but no evidence of hydrology and no hydric soils. Vegetation appears to be relict.

SOIL

Sampling Point: SP13a-u

Profile Description: (Describe to the depth needed to document the Indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-12	10YR	2/1	100				Silt Loam	
12-16	10YR	3/1	97	7.5YR 3/4	3		Silt Loam	White particles in soil.

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒

Remarks:

Soil is dry throughout profile.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
☐ Drainage Patterns (B10)
☐ Dry-Season Water Table (C2)
☐ Saturation Visible on Aerial Imagery (C9)
☐ Geomorphic Position (D2)
☐ Shallow Aquitard (D3)
☐ FAC-Neutral Test (D5)
☐ Raised Ant Mounds (D6) (LRR A)
☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

In a swale. Questionable hydrology.

SOIL

Sampling Point: SP13b-u

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-6	10YR	2/1	100				Loam	White particles in soil.
6-15	10YR	5/1	100				Silty Clay	White particles

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

Secondary Indicators (2 or more required)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Little evidence of wetland hydrology

WETLAND DETERMINATION DATA FORM - Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek-North City/County: Madison Sampling Date: 8/23/2015
 Applicant/Owner: MDT State: Montana Sampling Point: SP13c-w
 Investigator(s): R McEldowney Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Terrace Local relief (concave, convex, none): concave Slope (%): 0
 Subregion (LRR): _____ Lat: 45.388026 Long: -112.452597 Datum: NAD83
 Soil Map Unit Name: 150-Villy silty clay loam, 0-2% slopes NWI classification: none

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS - Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM Confirmed in 2023.		

VEGETATION - Use scientific names of plant

Tree Stratum	Plot size (30 Foot Radius)	Absolute % Cover:	Dominant Species?	Indicator Status
Sapling/Shrub Stratum Plot size (15 Foot Radius)				
Herbaceous Stratum Plot size (5 Foot Radius)				
Asclepias speciosa		1	<input type="checkbox"/>	FAC
Elymus repens		1	<input type="checkbox"/>	FAC
Equisetum hyemale		1	<input type="checkbox"/>	FACW
Glycyrrhiza lepidota		1	<input type="checkbox"/>	FAC
Juncus balticus		1	<input type="checkbox"/>	FACW
Pascopyrum smithii		5	<input checked="" type="checkbox"/>	FACU
Plantago eriopoda		15	<input checked="" type="checkbox"/>	FACW
Puccinellia nuttalliana		35	<input checked="" type="checkbox"/>	FACW
Schoenoplectus pungens		5	<input checked="" type="checkbox"/>	OBL
Spartina gracilis		1	<input type="checkbox"/>	FACW
Triglochin maritima		1	<input type="checkbox"/>	OBL
Woody Vine Stratum Plot size (30 Foot Radius)				
Percent Bare Ground 0				

Dominance Test worksheet
 Number of Dominant Species that are OBL, FACW or FAC: 3 (A)
 Total Number of Dominant Species Across All Strata: 4 (B)
 Percent of Dominant Species That Are OBL, FACW, or FAC: 75 % (A/B)

Prevalence Index worksheet

Total % Cover of:	Multiply by:
OBL species 6 X 1	6
FACW species 53 X 2	106
FAC species 3 X 3	9
FACU species 5 X 4	20
UPL species 0 X 5	0
Column Totals 67 (A)	141 (B)

Prevalence Index = B/A = 2.10448

Hydrophytic Vegetation Indicators
☐ 1 - Rapid Test for Hydrophytic Vegetation
☒ 2 - Dominance Test is >50%
☒ 3 - Prevalence Index is <= 3.0
☐ 4 - Morphological Adaptations (Provide supporting data in remarks or on separate sheet.)
☐ 5 - Wetland Non-Vascular Plants
☐ Problematic Hydrophytic Vegetation (Explain)

Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic for #3, 4, 5.

Hydrophytic Vegetation Present? Yes ☒ NO ☐

Remarks:

SOIL

Sampling Point: SP13c-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix			Redox Features				Type ¹	Loc ²	Texture	Remarks
	Color (moist)		%	Color (moist)		%					
0-11	10YR	3/1	75	10YR	4/1	20	C	M		Silt Loam	Concentrations 5YR 3/4 = 5%
11-15	2.5Y	6/1	80	7.5YR	4/6	20	C	M		Sandy Loam	Second horizon is saturated.

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

Indicators for Problematic Hydric Soils³:

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input checked="" type="checkbox"/> Redox Dark Surface (F8) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Moist throughout profile.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input checked="" type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☒ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 11

(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Hoof prints/uneven

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-03
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13d-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.388207 Long: -112.452151 Datum: WGS 84
 Soil Map Unit Name: 86 - Neen silty clay loam, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Hydic Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point. Site has been lightly grazed.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____)		0 = Total Cover		Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>7</u></td> <td>x 2 = <u>14</u></td> </tr> <tr> <td>FAC species <u>66</u></td> <td>x 3 = <u>198</u></td> </tr> <tr> <td>FACU species <u>14</u></td> <td>x 4 = <u>56</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>87</u> (A)</td> <td><u>268</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.08</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>7</u>	x 2 = <u>14</u>	FAC species <u>66</u>	x 3 = <u>198</u>	FACU species <u>14</u>	x 4 = <u>56</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>87</u> (A)	<u>268</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>7</u>	x 2 = <u>14</u>																	
FAC species <u>66</u>	x 3 = <u>198</u>																	
FACU species <u>14</u>	x 4 = <u>56</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>87</u> (A)	<u>268</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>)		0 = Total Cover																
1. <u>Elymus repens</u>	<u>60</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Elymus lanceolatus</u>	<u>10</u>		<u>FACU</u>															
3. <u>Hordeum jubatum</u>	<u>5</u>		<u>FAC</u>															
4. <u>Spartina gracilis</u>	<u>3</u>		<u>FACW</u>															
5. <u>Pascopyrum smithii</u>	<u>2</u>		<u>FACU</u>															
6. <u>Plantago eriopoda</u>	<u>2</u>		<u>FACW</u>															
7. <u>Schedonorus pratensis</u>	<u>2</u>		<u>FACU</u>															
8. <u>Bassia scoparia</u>	<u>1</u>		<u>FAC</u>															
9. <u>Carex sp.</u>	<u>1</u>																	
10. <u>Juncus balticus</u>	<u>1</u>		<u>FACW</u>															
11. <u>Muhlenbergia asperifolia</u>	<u>1</u>		<u>FACW</u>															
		88 = Total Cover																
Woody Vine Stratum (Plot size: _____)		0 = Total Cover		Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
1. _____		_____																
2. _____		_____																
% Bare Ground in Herb Stratum <u>12</u>		0 = Total Cover																
Remarks: Site is dominated by quackgrass.																		

SOIL

Sampling Point: SP13d-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 9	10YR 2/1	100					Silty Clay Loam	Lots of salt crystals.
9 - 16	10YR 4/1	100					Silty Clay Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-03
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13d-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.388295 Long: -112.4522 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM, riverine/depressional.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ _____ = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>7</u></td> <td>x 1 = <u>7</u></td> </tr> <tr> <td>FACW species <u>15</u></td> <td>x 2 = <u>30</u></td> </tr> <tr> <td>FAC species <u>19</u></td> <td>x 3 = <u>57</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>41</u> (A)</td> <td><u>94</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.29</u>	Total % Cover of:	Multiply by:	OBL species <u>7</u>	x 1 = <u>7</u>	FACW species <u>15</u>	x 2 = <u>30</u>	FAC species <u>19</u>	x 3 = <u>57</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>41</u> (A)	<u>94</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>7</u>	x 1 = <u>7</u>																	
FACW species <u>15</u>	x 2 = <u>30</u>																	
FAC species <u>19</u>	x 3 = <u>57</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>41</u> (A)	<u>94</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Elymus repens</u> <u>15</u> <input checked="" type="checkbox"/> <u>FAC</u> 2. <u>Spartina gracilis</u> <u>10</u> <input checked="" type="checkbox"/> <u>FACW</u> 3. <u>Schoenoplectus pungens</u> <u>5</u> <input type="checkbox"/> <u>OBL</u> 4. <u>Asclepias speciosa</u> <u>2</u> <input type="checkbox"/> <u>FAC</u> 5. <u>Hordeum jubatum</u> <u>2</u> <input type="checkbox"/> <u>FAC</u> 6. <u>Muhlenbergia asperifolia</u> <u>2</u> <input type="checkbox"/> <u>FACW</u> 7. <u>Plantago eriopoda</u> <u>2</u> <input type="checkbox"/> <u>FACW</u> 8. <u>Asclepias incarnata</u> <u>1</u> <input type="checkbox"/> <u>OBL</u> 9. <u>Distichlis spicata</u> <u>1</u> <input type="checkbox"/> <u>FACW</u> 10. <u>Triglochin maritima</u> <u>1</u> <input type="checkbox"/> <u>OBL</u> 11. _____ _____ = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ _____ = Total Cover																		
% Bare Ground in Herb Stratum <u>59</u> _____ = Total Cover																		
Remarks: Site is dominated by quackgrass and alkali cordgrass.																		

SOIL

Sampling Point: SP13d-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3	10YR 3/1	100					Silty Clay Loam	Salt crystals.
3 - 9	10YR 2/1	100					Silty Clay Loam	
9 - 16	10YR 6/1	100					Silty Clay Loam	
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix identified.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input checked="" type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Hoof marks and effervescent salt crust present, indicating soil saturation earlier in the year.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-03
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13e-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.389364 Long: -112.451865 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point dominated by salt tolerant FAC species.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>1</u> x 1 = <u>1</u> FACW species <u>27</u> x 2 = <u>54</u> FAC species <u>59</u> x 3 = <u>177</u> FACU species <u>1</u> x 4 = <u>4</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>88</u> (A) <u>236</u> (B) Prevalence Index = B/A = <u>2.68</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Sporobolus airoides</u>	<u>55</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Plantago eriopoda</u>	<u>15</u>	_____	<u>FACW</u>	
3. <u>Spartina gracilis</u>	<u>10</u>	_____	<u>FACW</u>	
4. <u>Muhlenbergia richardsonis</u>	<u>3</u>	_____	<u>FAC</u>	
5. <u>suaeda calceolifoemis</u>	<u>2</u>	_____	<u>FACW</u>	
6. <u>Asclepias incarnata</u>	<u>1</u>	_____	<u>OBL</u>	
7. <u>Asclepias speciosa</u>	<u>1</u>	_____	<u>FAC</u>	
8. <u>Pascopyrum smithii</u>	<u>1</u>	_____	<u>FACU</u>	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>88</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>12</u>				
Remarks: This upland point is dominated by a FAC species - alkali sacaton.				

SOIL

Sampling Point: SP13e-U**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 2/1	100					Silt Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> 2 cm Muck (A10)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Red Parent Material (TF2)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input type="checkbox"/> Depleted Matrix (F3)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Redox Depressions (F8)	

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed. CaCO₃ crystals occur throughout the profile but are most concentrated in the upper 2 inches.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

<input type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Salt Crust (B11)
<input type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Aquatic Invertebrates (B13)
<input type="checkbox"/> Water Marks (B1)	<input type="checkbox"/> Hydrogen Sulfide Odor (C1)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A)
<input type="checkbox"/> Surface Soil Cracks (B6)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	

Secondary Indicators (2 or more required)

<input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> Drainage Patterns (B10)
<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Shallow Aquitard (D3)
<input type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Raised Ant Mounds (D6) (LRR A)
<input type="checkbox"/> Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes _____ No ☒ Depth (inches): _____Water Table Present? Yes _____ No ☒ Depth (inches): _____Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed. Sample point is approx. 2 ft higher than paired wetland point.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-03
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13e-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Meander Scar Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.389412 Long: -112.451976 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: Ungrazed emergent wetland.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>5</u> (A) Total Number of Dominant Species Across All Strata: <u>5</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>15</u></td> <td>x 1 = <u>15</u></td> </tr> <tr> <td>FACW species <u>7</u></td> <td>x 2 = <u>14</u></td> </tr> <tr> <td>FAC species <u>13</u></td> <td>x 3 = <u>39</u></td> </tr> <tr> <td>FACU species <u>3</u></td> <td>x 4 = <u>12</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>38</u> (A)</td> <td><u>80</u> (B)</td> </tr> </table>	Total % Cover of:	Multiply by:	OBL species <u>15</u>	x 1 = <u>15</u>	FACW species <u>7</u>	x 2 = <u>14</u>	FAC species <u>13</u>	x 3 = <u>39</u>	FACU species <u>3</u>	x 4 = <u>12</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>38</u> (A)	<u>80</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>15</u>	x 1 = <u>15</u>																	
FACW species <u>7</u>	x 2 = <u>14</u>																	
FAC species <u>13</u>	x 3 = <u>39</u>																	
FACU species <u>3</u>	x 4 = <u>12</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>38</u> (A)	<u>80</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Juncus balticus</u>	<u>7</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Alopecurus arundinaceus</u>	<u>5</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
3. <u>Potentilla anserina</u>	<u>5</u>	<input checked="" type="checkbox"/>	<u>OBL</u>															
4. <u>Schoenoplectus acutus</u>	<u>5</u>	<input checked="" type="checkbox"/>	<u>OBL</u>															
5. <u>Symphyotrichum bracteolatum</u>	<u>5</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
6. <u>Sonchus arvensis</u>	<u>3</u>		<u>FACU</u>															
7. <u>Triglochin maritima</u>	<u>3</u>		<u>OBL</u>															
8. <u>Lycopus asper</u>	<u>2</u>		<u>OBL</u>															
9. <u>Muhlenbergia richardsonis</u>	<u>2</u>		<u>FAC</u>															
10. <u>Symphyotrichum ericoides</u>	<u>1</u>		<u>FAC</u>															
11. _____	_____	_____	_____															
<u>38</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>62</u>																		
Remarks: Emergent wetland with diverse species assemblage.																		

SOIL

Sampling Point: SP13e-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 6	10YR 3/2	100						Organic -hemic
6 - 16	N 2.5/0	100						Organic-sapric
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- ☒ Histosol (A1)
- ☐ Histic Epipedon (A2)
- ☐ Black Histic (A3)
- ☐ Hydrogen Sulfide (A4)
- ☐ Depleted Below Dark Surface (A11)
- ☐ Thick Dark Surface (A12)
- ☐ Sandy Mucky Mineral (S1)
- ☐ Sandy Gleyed Matrix (S4)
- ☐ Sandy Redox (S5)
- ☐ Stripped Matrix (S6)
- ☐ Loamy Mucky Mineral (F1) (**except MLRA 1**)
- ☐ Loamy Gleyed Matrix (F2)
- ☐ Depleted Matrix (F3)
- ☐ Redox Dark Surface (F6)
- ☐ Depleted Dark Surface (F7)
- ☐ Redox Depressions (F8)

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Organic soil to at least 16 inches.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- ☐ Surface Water (A1)
- ☐ High Water Table (A2)
- ☐ Saturation (A3)
- ☐ Water Marks (B1)
- ☐ Sediment Deposits (B2)
- ☐ Drift Deposits (B3)
- ☐ Algal Mat or Crust (B4)
- ☐ Iron Deposits (B5)
- ☒ Surface Soil Cracks (B6)
- ☐ Inundation Visible on Aerial Imagery (B7)
- ☐ Sparsely Vegetated Concave Surface (B8)
- ☐ Water-Stained Leaves (B9) (**except MLRA 1, 2, 4A, and 4B**)
- ☐ Salt Crust (B11)
- ☐ Aquatic Invertebrates (B13)
- ☐ Hydrogen Sulfide Odor (C1)
- ☐ Oxidized Rhizospheres along Living Roots (C3)
- ☐ Presence of Reduced Iron (C4)
- ☐ Recent Iron Reduction in Tilled Soils (C6)
- ☐ Stunted or Stressed Plants (D1) (**LRR A**)
- ☐ Other (Explain in Remarks)

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (**MLRA 1, 2, 4A, and 4B**)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☒ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☒ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (**LRR A**)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____

(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Site is in a depressional area and passes the FAC-neutral test. Salts are on the surface and there are a lot of pug marks from livestock, indicating this area is frequently very wet.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-08
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13f-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Convex Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.390711 Long: -112.450821 Datum: WGS 84
 Soil Map Unit Name: 86 - Neen silty clay loam, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland island that is roughly 1-2 ft higher than the surrounding terrain.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
_____ = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>46</u> x 2 = <u>92</u> FAC species <u>5</u> x 3 = <u>15</u> FACU species <u>16</u> x 4 = <u>64</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>67</u> (A) <u>171</u> (B) Prevalence Index = B/A = <u>2.55</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Rosa woodsii</u>	<u>1</u>		<u>FACU</u>	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
_____ = Total Cover				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
Herb Stratum (Plot size: 5 ft r _____)				
1. <u>Spartina gracilis</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. <u>Pascopyrum smithii</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
3. <u>Muhlenbergia asperifolia</u>	<u>10</u>		<u>FACW</u>	
4. <u>Asclepias speciosa</u>	<u>5</u>		<u>FAC</u>	
5. <u>Plantago eriopoda</u>	<u>5</u>		<u>FACW</u>	
6. <u>Suaeda calciformis</u>	<u>1</u>		<u>FACW</u>	
7. <u>Unidentified aster</u>	<u>1</u>		_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
_____ = Total Cover				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
_____ = Total Cover				
% Bare Ground in Herb Stratum <u>33</u>				
Remarks: Upland sample point dominated by alkali cord grass and western wheatgrass.				

SOIL

Sampling Point: SP13f-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 4/1	100					Silt Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed. Soil is dry.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-08
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13f-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.39058 Long: -112.450772 Datum: WGS 84
 Soil Map Unit Name: 86 - Neen silty clay loam, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM wetland in historic floodplain of the Beaverhead River east of the highway.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>45</u></td> <td>x 1 = <u>45</u></td> </tr> <tr> <td>FACW species <u>40</u></td> <td>x 2 = <u>80</u></td> </tr> <tr> <td>FAC species <u>5</u></td> <td>x 3 = <u>15</u></td> </tr> <tr> <td>FACU species <u>7</u></td> <td>x 4 = <u>28</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>97</u> (A)</td> <td><u>168</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>1.73</u>	Total % Cover of:	Multiply by:	OBL species <u>45</u>	x 1 = <u>45</u>	FACW species <u>40</u>	x 2 = <u>80</u>	FAC species <u>5</u>	x 3 = <u>15</u>	FACU species <u>7</u>	x 4 = <u>28</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>97</u> (A)	<u>168</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>45</u>	x 1 = <u>45</u>																	
FACW species <u>40</u>	x 2 = <u>80</u>																	
FAC species <u>5</u>	x 3 = <u>15</u>																	
FACU species <u>7</u>	x 4 = <u>28</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>97</u> (A)	<u>168</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Potentilla anserina</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>OBL</u>	Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Spartina gracilis</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
3. <u>Carex praegracilis</u>	<u>5</u>	_____	<u>FACW</u>															
4. <u>Glycyrrhiza lepidota</u>	<u>5</u>	_____	<u>FAC</u>															
5. <u>Juncus balticus</u>	<u>5</u>	_____	<u>FACW</u>															
6. <u>Sonchus arvensis</u>	<u>4</u>	_____	<u>FACU</u>															
7. <u>Iris missouriensis</u>	<u>3</u>	_____	<u>FACW</u>															
8. <u>Pascopyrum smithii</u>	<u>3</u>	_____	<u>FACU</u>															
9. <u>Triglochin maritima</u>	<u>3</u>	_____	<u>OBL</u>															
10. <u>Asclepias incarnata</u>	<u>2</u>	_____	<u>OBL</u>															
11. <u>Helianthus nuttallii</u>	<u>2</u>	_____	<u>FACW</u>															
<u>97</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>0</u>																		
Remarks: Other species include Juncus tenuis (2%), Asclepias species (1%)																		

SOIL

Sampling Point: SP13f-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 7	10YR 3/2	100						Organic - hemic.
7 - 16	10B 4/1	97	10YR 4/1	3	D	M	Silty Clay Loam	Gleyed.
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input checked="" type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Organic soil over a gleyed silty clay loam. Soil is moist.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

This area is expected to be quite wet during spring.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-03
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13g-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Roadway Embankment Local relief (concave, convex, none): Convex Slope (%): 75
 Subregion (LRR): E 44 Lat: 45.39132 Long: -112.452372 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point on a roadside fill slope.	

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
_____ = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>3</u></td> <td>x 1 = <u>3</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>21</u></td> <td>x 3 = <u>63</u></td> </tr> <tr> <td>FACU species <u>32</u></td> <td>x 4 = <u>128</u></td> </tr> <tr> <td>UPL species <u>8</u></td> <td>x 5 = <u>40</u></td> </tr> <tr> <td>Column Totals: <u>64</u> (A)</td> <td><u>234</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.66</u>	Total % Cover of:	Multiply by:	OBL species <u>3</u>	x 1 = <u>3</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>21</u>	x 3 = <u>63</u>	FACU species <u>32</u>	x 4 = <u>128</u>	UPL species <u>8</u>	x 5 = <u>40</u>	Column Totals: <u>64</u> (A)	<u>234</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>3</u>	x 1 = <u>3</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>21</u>	x 3 = <u>63</u>																	
FACU species <u>32</u>	x 4 = <u>128</u>																	
UPL species <u>8</u>	x 5 = <u>40</u>																	
Column Totals: <u>64</u> (A)	<u>234</u> (B)																	
_____ = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
_____ = Total Cover																		
Herb Stratum (Plot size: 5 ft r _____)																		
1. <u>Pascopyrum smithii</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FACU</u>															
2. <u>Elymus repens</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
3. <u>Bromus inermis</u>	<u>5</u>		<u>UPL</u>															
4. <u>Melilotus officinalis</u>	<u>5</u>		<u>FACU</u>															
5. <u>Medicago sativa</u>	<u>3</u>		<u>UPL</u>															
6. <u>Schoenoplectus acutus</u>	<u>3</u>		<u>OBL</u>															
7. <u>Medicago lupulina</u>	<u>2</u>		<u>FACU</u>															
8. <u>Bassia scoparia</u>	<u>1</u>		<u>FAC</u>															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
_____ = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
_____ = Total Cover																		
% Bare Ground in Herb Stratum <u>36</u>																		
Remarks: Upland sample point dominated by western wheatgrass and quackgrass.																		

SOIL

Sampling Point: SP13g-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10YR 3/2	100					Sandy Loam	Gravelly.
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed. On the sideslope of the highway.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/13/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP13g-w
 Investigator(s): B Sandefur Section, Township, Range: S 22 T 5S R 7W
 Landform (hillslope, terrace, etc.): Swale Local relief (concave, convex, none): flat Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.391312 Long: -112.452183 Datum: WGS84
 Soil Map Unit Name: Villy silty clay loam NWI classification: PEM

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Remarks: DP in emergent wetland dominated by eleocharis community. Confirmed in 2023.	

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:
1. _____	0	<input type="checkbox"/>		Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A)
2. _____	0	<input type="checkbox"/>		Total Number of Dominant Species Across All Strata: <u>1</u> (B)
3. _____	0	<input type="checkbox"/>		Percent of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A/B)
4. _____	0	<input type="checkbox"/>		
	0 = Total Cover			
Sapling/Shrub Stratum (Plot size: _____)				Prevalence Index worksheet:
1. _____	0	<input type="checkbox"/>		Total % Cover of: _____ Multiply by: _____
2. _____	0	<input type="checkbox"/>		OBL species <u>93</u> x 1 = <u>93</u>
3. _____	0	<input type="checkbox"/>		FACW species <u>2</u> x 2 = <u>4</u>
4. _____	0	<input type="checkbox"/>		FAC species <u>5</u> x 3 = <u>15</u>
5. _____	0	<input type="checkbox"/>		FACU species <u>0</u> x 4 = <u>0</u>
	0 = Total Cover			UPL species <u>0</u> x 5 = <u>0</u>
Herb Stratum (Plot size: <u>5ft</u>)				Column Totals: <u>100</u> (A) <u>112</u> (B)
1. <u>Agrostis gigantea</u>	<u>5</u>	<input type="checkbox"/>	<u>FAC</u>	Prevalence Index = B/A = <u>1.12</u>
2. <u>Eleocharis palustris</u>	<u>90</u>	<input checked="" type="checkbox"/>	<u>OBL</u>	
3. <u>Schoenoplectus acutus</u>	<u>3</u>	<input type="checkbox"/>	<u>OBL</u>	
4. <u>Epilobium ciliatum</u>	<u>2</u>	<input type="checkbox"/>	<u>FACW</u>	
5. _____	0	<input type="checkbox"/>		
6. _____	0	<input type="checkbox"/>		
7. _____	0	<input type="checkbox"/>		
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
	100 = Total Cover			
Woody Vine Stratum (Plot size: _____)				
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
	0 = Total Cover			
% Bare Ground in Herb Stratum <u>0</u>				

Hydrophytic Vegetation Present? Yes ☒ No ☐

Remarks:
Emergent marsh near the warm spring dominated by spikerush.

Sampling Point: SP13g-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- ### Indicators for Problematic Hydric Soils³:

- ³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Histosol and sulfidic odor detected.

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- Secondary Indicators (2 or more required)**

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☒ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Site has multiple primary wetland hydrology indicators.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13h-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Hillslope Local relief (concave, convex, none): Convex Slope (%): 25
 Subregion (LRR): E 44 Lat: 45.392483 Long: -112.451976 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Hydic Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Located on roadside fill slope approx. 2 ft higher in elevation than the paired wetland point.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>90</u></td> <td>x 3 = <u>270</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>90</u> (A)</td> <td><u>270</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.00</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>90</u>	x 3 = <u>270</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>90</u> (A)	<u>270</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>90</u>	x 3 = <u>270</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>90</u> (A)	<u>270</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Bassia scoparia</u>	<u>80</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Elymus repens</u>	<u>10</u>		<u>FAC</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>90</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>10</u>																		
Remarks: Upland sample point dominated by FAC vegetation.																		

SOIL

Sampling Point: SP13h-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3	10YR 3/2	100					Clay Loam	
3 - 13	10YR 4/2	100					Sandy Clay Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | |
|--|
| <input type="checkbox"/> Surface Water (A1) |
| <input type="checkbox"/> High Water Table (A2) |
| <input type="checkbox"/> Saturation (A3) |
| <input type="checkbox"/> Water Marks (B1) |
| <input type="checkbox"/> Sediment Deposits (B2) |
| <input type="checkbox"/> Drift Deposits (B3) |
| <input type="checkbox"/> Algal Mat or Crust (B4) |
| <input type="checkbox"/> Iron Deposits (B5) |
| <input type="checkbox"/> Surface Soil Cracks (B6) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) |

- | |
|--|
| <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Other (Explain in Remarks) |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13h-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.3924685 Long: -112.4519203 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped.

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: PSS, riverine wetland near the warm spring.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>17</u></td> <td>x 1 = <u>17</u></td> </tr> <tr> <td>FACW species <u>35</u></td> <td>x 2 = <u>70</u></td> </tr> <tr> <td>FAC species <u>70</u></td> <td>x 3 = <u>210</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>5</u></td> <td>x 5 = <u>25</u></td> </tr> <tr> <td>Column Totals: <u>127</u> (A)</td> <td><u>322</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.54</u>	Total % Cover of:	Multiply by:	OBL species <u>17</u>	x 1 = <u>17</u>	FACW species <u>35</u>	x 2 = <u>70</u>	FAC species <u>70</u>	x 3 = <u>210</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>5</u>	x 5 = <u>25</u>	Column Totals: <u>127</u> (A)	<u>322</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>17</u>	x 1 = <u>17</u>																	
FACW species <u>35</u>	x 2 = <u>70</u>																	
FAC species <u>70</u>	x 3 = <u>210</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>5</u>	x 5 = <u>25</u>																	
Column Totals: <u>127</u> (A)	<u>322</u> (B)																	
Sapling/Shrub Stratum (Plot size: 15 ft r _____)																		
1. <u>Salix exigua</u>	<u>35</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
2. <u>Ribes lacustre</u>	<u>10</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>45</u> = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Herb Stratum (Plot size: 5 ft r _____)																		
1. <u>Elymus repens</u>	<u>60</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Typha latifolia</u>	<u>15</u>	_____	<u>OBL</u>															
3. <u>Cardaria draba</u>	<u>5</u>	_____	<u>UPL</u>															
4. <u>Schoenoplectus acutus</u>	<u>2</u>	_____	<u>OBL</u>															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>82</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>18</u>																		
Remarks:																		
PSS dominated by coyote willow with a mixed understory.																		

SOIL

Sampling Point: SP13h-W**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features			Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹		
0 - 16	10YR 4/2	98	10YR 3/3	2	C	PL	Loam
-							
-							
-							
-							
-							
-							
-							
-							

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)**

- ☐ Histosol (A1) ☐ Sandy Redox (S5)
☐ Histic Epipedon (A2) ☐ Stripped Matrix (S6)
☐ Black Histic (A3) ☐ Loamy Mucky Mineral (F1) (**except MLRA 1**)
☐ Hydrogen Sulfide (A4) ☐ Loamy Gleyed Matrix (F2)
☐ Depleted Below Dark Surface (A11) ☒ Depleted Matrix (F3)
☐ Thick Dark Surface (A12) ☐ Redox Dark Surface (F6)
☐ Sandy Mucky Mineral (S1) ☐ Depleted Dark Surface (F7)
☐ Sandy Gleyed Matrix (S4) ☐ Redox Depressions (F8)

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix indicator observed.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

- ☐ Surface Water (A1) ☐ Water-Stained Leaves (B9) (**except MLRA 1, 2, 4A, and 4B**)
☐ High Water Table (A2) ☐ Salt Crust (B11)
☐ Saturation (A3) ☐ Aquatic Invertebrates (B13)
☐ Water Marks (B1) ☐ Hydrogen Sulfide Odor (C1)
☐ Sediment Deposits (B2) ☒ Oxidized Rhizospheres along Living Roots (C3)
☐ Drift Deposits (B3) ☐ Presence of Reduced Iron (C4)
☐ Algal Mat or Crust (B4) ☐ Recent Iron Reduction in Tilled Soils (C6)
☐ Iron Deposits (B5) ☐ Stunted or Stressed Plants (D1) (**LRR A**)
☐ Surface Soil Cracks (B6) ☐ Other (Explain in Remarks)
☐ Inundation Visible on Aerial Imagery (B7)
☐ Sparsely Vegetated Concave Surface (B8)

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (**MLRA 1, 2, 4A, and 4B**)
☐ Drainage Patterns (B10)
☐ Dry-Season Water Table (C2)
☐ Saturation Visible on Aerial Imagery (C9)
☒ Geomorphic Position (D2)
☐ Shallow Aquitard (D3)
☐ FAC-Neutral Test (D5)
☐ Raised Ant Mounds (D6) (**LRR A**)
☐ Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Wetland hydrology indicated by the site's geographic position and by oxidized rhizospheres.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-08
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13i-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Convex Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.393465 Long: -112.450443 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: <u>Upland island approx. 2 ft higher in elevation compared to paired wetland point.</u>			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
_____ = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>52</u> x 2 = <u>104</u> FAC species <u>35</u> x 3 = <u>105</u> FACU species <u>7</u> x 4 = <u>28</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>94</u> (A) <u>237</u> (B) Prevalence Index = B/A = <u>2.52</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____) 1. <u>Sarcobatus vermiculatus</u> <u>2</u> _____ FACU 2. _____ 3. _____ 4. _____ 5. _____ _____ = Total Cover				
Herb Stratum (Plot size: 5 ft r _____) 1. <u>Muhlenbergia asperifolia</u> <u>30</u> <input checked="" type="checkbox"/> FACW 2. <u>Sporobolus airoides</u> <u>30</u> <input checked="" type="checkbox"/> FAC 3. <u>Spartina gracilis</u> <u>15</u> FACW 4. <u>Bassia scoparia</u> <u>5</u> FAC 5. <u>Pascopyrum smithii</u> <u>5</u> FACU 6. <u>Plantago eriopoda</u> <u>5</u> FACW 7. <u>Chenopodium rubrum</u> <u>1</u> FACW 8. <u>Juncus balticus</u> <u>1</u> FACW 9. _____ 10. _____ 11. _____ _____ = Total Cover				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ _____ = Total Cover				
% Bare Ground in Herb Stratum <u>8</u>				
Remarks: <u>Sample point is dominated by both FAC and FACW vegetation.</u>				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

SOIL

Sampling Point: SP13i-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 2	10YR 2/2	100						Organic - Fibric
2 - 15	10YR 3/1	100					Silt Loam	CaCO3 crystals.
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed. Soil is dry.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Upland island approx. 2 ft higher in elevation compared to paired wetland point. No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-08
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13i-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.393369 Long: -112.450499 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM wetland in the extended floodplain of the Beaverhead River.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
_____ = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>1</u> x 1 = <u>1</u> FACW species <u>35</u> x 2 = <u>70</u> FAC species <u>17</u> x 3 = <u>51</u> FACU species <u>33</u> x 4 = <u>132</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>86</u> (A) <u>254</u> (B) Prevalence Index = B/A = <u>2.95</u>
_____ = Total Cover				
_____ = Total Cover				
_____ = Total Cover				
_____ = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u>)				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Sonchus arvensis</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
2. <u>Spartina gracilis</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
3. <u>Muhlenbergia richardsonis</u>	<u>15</u>		<u>FAC</u>	
4. <u>Helianthus nuttallii</u>	<u>10</u>		<u>FACW</u>	
5. <u>Mentha arvensis</u>	<u>5</u>		<u>FACW</u>	
6. <u>Pascopyrum smithii</u>	<u>3</u>		<u>FACU</u>	
7. <u>Juncus tenuis</u>	<u>2</u>		<u>FAC</u>	
8. <u>Triglochin maritima</u>	<u>1</u>		<u>OBL</u>	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
_____ = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
_____ = Total Cover				
% Bare Ground in Herb Stratum <u>14</u>				
Remarks: PEM sample point dominated by sowthistle and alkali cordgrass.				

SOIL

Sampling Point: SP13i-W**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 2	10YR 3/2	100						Organic - hemic.
2 - 16	10B 2.5/1	100						Organic - sapric.
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

<input checked="" type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> 2 cm Muck (A10)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Red Parent Material (TF2)
<input checked="" type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input type="checkbox"/> Depleted Matrix (F3)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Redox Depressions (F8)	

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Organic soil. Soil is moist.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

<input type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Salt Crust (B11)
<input type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Aquatic Invertebrates (B13)
<input type="checkbox"/> Water Marks (B1)	<input type="checkbox"/> Hydrogen Sulfide Odor (C1)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A)
<input type="checkbox"/> Surface Soil Cracks (B6)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	

Secondary Indicators (2 or more required)

<input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> Drainage Patterns (B10)
<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input checked="" type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Shallow Aquitard (D3)
<input checked="" type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Raised Ant Mounds (D6) (LRR A)
<input type="checkbox"/> Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Exhibits wetland hydrology by passing the FAC-neutral test and occurring in an appropriate geographic position on the landscape.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-08
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13j-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 2
 Subregion (LRR): E 44 Lat: 45.394006 Long: -112.450664 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point. Site has been hayed.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>37</u> x 2 = <u>74</u> FAC species <u>0</u> x 3 = <u>0</u> FACU species <u>32</u> x 4 = <u>128</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>69</u> (A) <u>202</u> (B) Prevalence Index = B/A = <u>2.93</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				
1. <u>Muhlenbergia asperifolia</u>	<u>35</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Schedonorus pratensis</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
3. <u>Sonchus arvensis</u>	<u>2</u>	<input type="checkbox"/>	<u>FACU</u>	
4. <u>Juncus balticus</u>	<u>1</u>	<input type="checkbox"/>	<u>FACW</u>	
5. <u>Plantago eriopoda</u>	<u>1</u>	<input type="checkbox"/>	<u>FACW</u>	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>69</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>31</u>				
Remarks: Site is dominated by both FACW and FACU vegetation.				

SOIL

Sampling Point: SP13j-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 6	10YR 3/1	100						Organic - hemic.
6 - 16	10YR 2/1	99	10YR 5/4	1	C	M	Silty Clay	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

The redox feature in layer 2 is questionable - might be organic accumulation. Second layer is moist. Hemic soils appear to be relict from before irrigation ditches were installed. No reliable/relevant hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-08
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13j-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.3938775 Long: -112.450591 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped.

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: Wetland sample point in a broad swale. Site has been hayed.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>4</u> (A) Total Number of Dominant Species Across All Strata: <u>4</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
_____ = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>17</u></td> <td>x 1 = <u>17</u></td> </tr> <tr> <td>FACW species <u>38</u></td> <td>x 2 = <u>76</u></td> </tr> <tr> <td>FAC species <u>30</u></td> <td>x 3 = <u>90</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>85</u> (A)</td> <td><u>183</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.15</u>	Total % Cover of:	Multiply by:	OBL species <u>17</u>	x 1 = <u>17</u>	FACW species <u>38</u>	x 2 = <u>76</u>	FAC species <u>30</u>	x 3 = <u>90</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>85</u> (A)	<u>183</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>17</u>	x 1 = <u>17</u>																	
FACW species <u>38</u>	x 2 = <u>76</u>																	
FAC species <u>30</u>	x 3 = <u>90</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>85</u> (A)	<u>183</u> (B)																	
_____ = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
_____ = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u> _____)																		
1. <u>Elymus repens</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Carex praegracilis</u>	<u>10</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
3. <u>Helianthus nuttallii</u>	<u>10</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
4. <u>Potentilla anserina</u>	<u>10</u>	<input checked="" type="checkbox"/>	<u>OBL</u>															
5. <u>Mentha arvensis</u>	<u>7</u>		<u>FACW</u>															
6. <u>Calamagrostis stricta</u>	<u>5</u>		<u>FACW</u>															
7. <u>Juncus balticus</u>	<u>5</u>		<u>FACW</u>															
8. <u>Schoenoplectus acutus</u>	<u>5</u>		<u>OBL</u>															
9. <u>Plantago eriopoda</u>	<u>1</u>		<u>FACW</u>															
10. <u>Triglochin maritima</u>	<u>1</u>		<u>OBL</u>															
11. <u>Typha latifolia</u>	<u>1</u>		<u>OBL</u>															
_____ = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
_____ = Total Cover																		
% Bare Ground in Herb Stratum <u>15</u>																		
Remarks:																		
PEM. Diverse plant assemblage.																		

SOIL

Sampling Point: SP13j-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 6	10YR 3/2	100						Organic - hemic.
6 - 16	10YR 2/1	100						Organic - sapric. Snail shells.
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- ☒ Histosol (A1)
- ☐ Histic Epipedon (A2)
- ☐ Black Histic (A3)
- ☐ Hydrogen Sulfide (A4)
- ☐ Depleted Below Dark Surface (A11)
- ☐ Thick Dark Surface (A12)
- ☐ Sandy Mucky Mineral (S1)
- ☐ Sandy Gleyed Matrix (S4)
- ☐ Sandy Redox (S5)
- ☐ Stripped Matrix (S6)
- ☐ Loamy Mucky Mineral (F1) (**except MLRA 1**)
- ☐ Loamy Gleyed Matrix (F2)
- ☐ Depleted Matrix (F3)
- ☐ Redox Dark Surface (F6)
- ☐ Depleted Dark Surface (F7)
- ☐ Redox Depressions (F8)

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Soil is moist in second horizon. Small snail shells observed in the second horizon.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- ☐ Surface Water (A1)
- ☐ High Water Table (A2)
- ☐ Saturation (A3)
- ☐ Water Marks (B1)
- ☐ Sediment Deposits (B2)
- ☐ Drift Deposits (B3)
- ☐ Algal Mat or Crust (B4)
- ☐ Iron Deposits (B5)
- ☐ Surface Soil Cracks (B6)
- ☐ Inundation Visible on Aerial Imagery (B7)
- ☐ Sparsely Vegetated Concave Surface (B8)
- ☐ Water-Stained Leaves (B9) (**except MLRA 1, 2, 4A, and 4B**)
- ☐ Salt Crust (B11)
- ☐ Aquatic Invertebrates (B13)
- ☐ Hydrogen Sulfide Odor (C1)
- ☐ Oxidized Rhizospheres along Living Roots (C3)
- ☐ Presence of Reduced Iron (C4)
- ☐ Recent Iron Reduction in Tilled Soils (C6)
- ☐ Stunted or Stressed Plants (D1) (**LRR A**)
- ☐ Other (Explain in Remarks)

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (**MLRA 1, 2, 4A, and 4B**)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☒ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☒ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (**LRR A**)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☐ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Passes FAC-neutral test and is in the appropriate geomorphic position. Expect this site to be saturated to the soil surface in the spring and early summer.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP13k-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 2
 Subregion (LRR): E 44 Lat: 45.393494 Long: -112.451243 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point in a senescing stand of mature coyote willows.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>4</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
_____ = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>30</u> x 2 = <u>60</u> FAC species <u>42</u> x 3 = <u>126</u> FACU species <u>35</u> x 4 = <u>140</u> UPL species <u>20</u> x 5 = <u>100</u> Column Totals: <u>127</u> (A) <u>426</u> (B) Prevalence Index = B/A = <u>3.35</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Salix exigua</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. <u>Sarcobatus vermiculatus</u>	<u>5</u>		<u>FACU</u>	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
_____ = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Elymus repens</u>	<u>35</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
2. <u>Chenopodium album</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
3. <u>Cardaria draba</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>UPL</u>	
4. <u>Cirsium arvense</u>	<u>5</u>		<u>FAC</u>	
5. <u>Glycyrrhiza lepidota</u>	<u>2</u>		<u>FAC</u>	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
_____ = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
_____ = Total Cover				
% Bare Ground in Herb Stratum <u>8</u>				
Remarks:				
Senescing coyote willows with an understory of weedy FAC, FACU and UPL species.				

SOIL

Sampling Point: SP13k-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 1							Loam	Litter.
1 - 16	10YR 3/2	70					Silt Loam	
1 - 16	10YR 2/1	30						
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed. The coyote willows are senescing, more dead than alive, likely due to lack of adequate hydrology. The ditch is acting as a drain and is 2.5 ft below the elevation of this sample point.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/13/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP131-u
 Investigator(s): B Sandefur Section, Township, Range: S 15 T 5S R 7W
 Landform (hillslope, terrace, etc.): Valley bottom Local relief (concave, convex, none): flat Slope (%): 36.3
 Subregion (LRR): LRR E Lat: 45.393782 Long: -112.451185 Datum: WGS84
 Soil Map Unit Name: Villy silty clay loam NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
---	---

Remarks:
 DP in scrub/shrub upland outside direct influence of irrigation canal.
 Confirmed in 2023.

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
0 = Total Cover				
Sapling/Shrub Stratum (Plot size: 15ft)				
1. <u>Salix exigua</u>	70	<input checked="" type="checkbox"/>	FACW	
2. <u>Sarcobatus vermiculatus</u>	10	<input type="checkbox"/>	FACU	
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
5. _____	0	<input type="checkbox"/>		
80 = Total Cover				
Herb Stratum (Plot size: 5ft)				
1. <u>Cardaria draba</u>	25	<input checked="" type="checkbox"/>	UPL	
2. <u>Bromus inermis</u>	30	<input checked="" type="checkbox"/>	UPL	
3. <u>Poa pratensis</u>	30	<input checked="" type="checkbox"/>	FAC	
4. _____	0	<input type="checkbox"/>		
5. _____	0	<input type="checkbox"/>		
6. _____	0	<input type="checkbox"/>		
7. _____	0	<input type="checkbox"/>		
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
85 = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
0 = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				

Dominance Test worksheet:
 Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)
 Total Number of Dominant Species Across All Strata: 4 (B)
 Percent of Dominant Species That Are OBL, FACW, or FAC: 0.25 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:	
OBL species <u>0</u>	x 1 =	<u>0</u>
FACW species <u>70</u>	x 2 =	<u>140</u>
FAC species <u>30</u>	x 3 =	<u>90</u>
FACU species <u>10</u>	x 4 =	<u>40</u>
UPL species <u>55</u>	x 5 =	<u>275</u>
Column Totals: <u>165</u>	(A)	<u>545</u> (B)

 Prevalence Index = B/A = 3.3030

Hydrophytic Vegetation Indicators:
☐ 1 - Rapid Test for Hydrophytic Vegetation
☐ 2 - Dominance Test is >50%
☐ 3 - Prevalence Index is ≤3.0¹
☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
☐ 5 - Wetland Non-Vascular Plants¹
☐ Problematic Hydrophytic Vegetation¹ (Explain)
¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☐ No ☒

Remarks:
 Upland sample point dominated by smooth brome, whitetop and Kentucky bluegrass.

SOILSampling Point: **SP131-u****Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type	Loc ²		
0-6	10YR	3/3		100			Clay Loam	
6-12	10YR	4/3		100			Clay Loam	
12-17	10YR	4/2		100			Clay	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

- | | |
|--|---|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

- ☐ 2 cm Muck (A10)
- ☐ Red Parent Material (TF2)
- ☐ Very Shallow Dark Surface (TF12)
- ☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☐ No ☒**Remarks:**

Ca accumulation below 12in., no redox in upper 12in of soil.

HYDROLOGY**Wetland Hydrology Indicators:****Primary Indicators (minimum of one required; check all that apply)**

- | | |
|--|---|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☐ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☐ No ☒ Depth (inches): _____Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? (includes capillary fringe) Yes ☐ No ☒ Depth (inches): _____**Wetland Hydrology Present?** Yes ☐ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No surface hydro indicator, water table ~4ft below surface

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP14a-U
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.393437 Long: -112.451871 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point along roadside.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>66.67</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: <u>15 ft r</u>) 1. <u>Sarcobatus vermiculatus</u> <u>40</u> <input checked="" type="checkbox"/> <u>FACU</u>				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>26</u> x 2 = <u>52</u> FAC species <u>55</u> x 3 = <u>165</u> FACU species <u>40</u> x 4 = <u>160</u> UPL species <u>15</u> x 5 = <u>75</u> Column Totals: <u>136</u> (A) <u>452</u> (B) Prevalence Index = B/A = <u>3.32</u>
0 = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Bassia scoparia</u> <u>50</u> <input checked="" type="checkbox"/> <u>FAC</u>				
2. <u>Distichlis spicata</u> <u>25</u> <input checked="" type="checkbox"/> <u>FACW</u>				
3. <u>Bromus tectorum</u> <u>15</u> <input type="checkbox"/> <u>UPL</u>				
4. <u>Elymus repens</u> <u>5</u> <input type="checkbox"/> <u>FAC</u>				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
5. <u>Chenopodium rubrum</u> <u>1</u> <input type="checkbox"/> <u>FACW</u>				
6. _____				
7. _____				
8. _____				
9. _____				
10. _____				
11. _____				
96 = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____				
2. _____				
0 = Total Cover				
% Bare Ground in Herb Stratum <u>4</u>				
Remarks: Upland vegetation dominated by greasewood and kochia.				

SOIL

Sampling Point: SP14a-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 4/2	100					Silt Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP14a-W
 Investigator(s): McEldowney Section, Township, Range: S22 T5S R7W
 Landform (hillslope, terrace, etc.): Sideslope Local relief (concave, convex, none): Concave Slope (%): 5
 Subregion (LRR): E 44 Lat: 45.393474 Long: -112.451916 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PSS fringe adjacent to IR-1 , North of the farm road.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>100</u> x 2 = <u>200</u> FAC species <u>30</u> x 3 = <u>90</u> FACU species <u>7</u> x 4 = <u>28</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>137</u> (A) <u>318</u> (B) Prevalence Index = B/A = <u>2.32</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Salix exigua</u>	<u>50</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>50</u> = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
Herb Stratum (Plot size: 5 ft r _____)				
1. <u>Phalaris arundinacea</u>	<u>50</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. <u>Asclepias speciosa</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
3. <u>Bassia scoparia</u>	<u>5</u>	_____	<u>FAC</u>	
4. <u>Sonchus arvensis</u>	<u>5</u>	_____	<u>FACU</u>	
5. <u>Melilotus officinalis</u>	<u>2</u>	_____	<u>FACU</u>	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>87</u> = Total Cover				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>13</u>				
Remarks: PSS dominated by coyote willow.				

SOIL

Sampling Point: SP14a-W**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features			Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹		
0 - 15	10YR 4/2	55	10YR 4/6	5	C	M	Silty Clay Loam
0 - 15	10YR 5/2	40					
-							
-							
-							
-							
-							
-							

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> 2 cm Muck (A10)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Red Parent Material (TF2)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input checked="" type="checkbox"/> Depleted Matrix (F3)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Redox Depressions (F8)	

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

<input type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Salt Crust (B11)
<input checked="" type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Aquatic Invertebrates (B13)
<input type="checkbox"/> Water Marks (B1)	<input type="checkbox"/> Hydrogen Sulfide Odor (C1)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A)
<input type="checkbox"/> Surface Soil Cracks (B6)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	

Secondary Indicators (2 or more required)

<input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> Drainage Patterns (B10)
<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Shallow Aquitard (D3)
<input checked="" type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Raised Ant Mounds (D6) (LRR A)
<input type="checkbox"/> Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☒ No ☐ Depth (inches): 12Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Soils saturated to surface. Adjacent to the flowing irrigation ditch.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP14b-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.39581 Long: -112.450783 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point adjacent to IR-1 and roughly 16 inches higher in elevation than the paired wetland sample point.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>80</u> x 3 = <u>240</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>10</u> x 5 = <u>50</u> Column Totals: <u>90</u> (A) <u>290</u> (B) Prevalence Index = B/A = <u>3.22</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u>)				
1. <u>Elymus repens</u>	<u>50</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Bassia scoparia</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
3. <u>Bromus inermis</u>	<u>10</u>		<u>UPL</u>	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>90</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>10</u>				
Remarks: Upland point dominated by quackgrass and kochia.				

SOIL

Sampling Point: SP14b-U**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 11	10YR 4/2	100					Silty Clay Loam	
11 - 15	10YR 4/2	97	10YR 5/4	3	C	M	Silty Clay Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> 2 cm Muck (A10)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Red Parent Material (TF2)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input type="checkbox"/> Depleted Matrix (F3)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Redox Depressions (F8)	

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed. The redox features observed occur too deep for the soil to qualify for the depleted matrix indicator.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

<input type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Salt Crust (B11)
<input type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Aquatic Invertebrates (B13)
<input type="checkbox"/> Water Marks (B1)	<input type="checkbox"/> Hydrogen Sulfide Odor (C1)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A)
<input type="checkbox"/> Surface Soil Cracks (B6)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	

Secondary Indicators (2 or more required)

<input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> Drainage Patterns (B10)
<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Shallow Aquitard (D3)
<input type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Raised Ant Mounds (D6) (LRR A)
<input type="checkbox"/> Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes _____ No ☒ Depth (inches): _____Water Table Present? Yes _____ No ☒ Depth (inches): _____Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed. The sample point is roughly 16 inches higher in elevation than the paired wetland point that is immediately adjacent to the irrigation ditch.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP14b-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.39581 Long: -112.450806 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM. Narrow wetland fringe along right bank of canal IR-1.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B) Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>85</u> x 2 = <u>170</u> FAC species <u>0</u> x 3 = <u>0</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>85</u> (A) <u>170</u> (B) Prevalence Index = B/A = <u>2.00</u> Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Phalaris arundinacea</u>	<u>85</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>85</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>15</u>				
Remarks: PEM wetland fringe dominated by reed canarygrass.				

SOIL

Sampling Point: SP14b-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 16	10YR 4/2	100					Silt Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Hydrogen sulfide odor detected.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 12

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Saturated to the surface, hydrogen sulfide odor detected. Flowing water in irrigation ditch.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP14c-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Convex Slope (%): 50
 Subregion (LRR): E 44 Lat: 45.396058 Long: -112.450982 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: R5UBFx

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Sample point is located at the edge of an irrigated alfalfa field.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)																
1. _____	_____	_____	_____																	
2. _____	_____	_____	_____																	
3. _____	_____	_____	_____																	
4. _____	_____	_____	_____																	
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>0</u></td> <td>x 3 = <u>0</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>100</u></td> <td>x 5 = <u>500</u></td> </tr> <tr> <td>Column Totals: <u>100</u> (A)</td> <td><u>500</u> (B)</td> </tr> <tr> <td colspan="2">Prevalence Index = B/A = <u>5.00</u></td> </tr> </table>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>0</u>	x 3 = <u>0</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>100</u>	x 5 = <u>500</u>	Column Totals: <u>100</u> (A)	<u>500</u> (B)	Prevalence Index = B/A = <u>5.00</u>	
Total % Cover of:	Multiply by:																			
OBL species <u>0</u>	x 1 = <u>0</u>																			
FACW species <u>0</u>	x 2 = <u>0</u>																			
FAC species <u>0</u>	x 3 = <u>0</u>																			
FACU species <u>0</u>	x 4 = <u>0</u>																			
UPL species <u>100</u>	x 5 = <u>500</u>																			
Column Totals: <u>100</u> (A)	<u>500</u> (B)																			
Prevalence Index = B/A = <u>5.00</u>																				
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ <u>0</u> = Total Cover																				
Herb Stratum (Plot size: <u>5 ft r</u> _____) 1. <u>Bromus inermis</u> <u>50</u> <input checked="" type="checkbox"/> <u>UPL</u> 2. <u>Medicago sativa</u> <u>50</u> <input checked="" type="checkbox"/> <u>UPL</u> 3. _____ 4. _____ 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ <u>100</u> = Total Cover																				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ <u>0</u> = Total Cover																				
% Bare Ground in Herb Stratum <u>0</u>																				
Remarks: Upland vegetation dominates.																				

SOIL

Sampling Point: SP14c-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 14	10YR 4/3	100					Sandy Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____

(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-07
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP14c-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Bench Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.396054 Long: -112.45095 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM, narrow fringe adjacent to irrigation canal.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>90</u> x 2 = <u>180</u> FAC species <u>5</u> x 3 = <u>15</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>5</u> x 5 = <u>25</u> Column Totals: <u>100</u> (A) <u>220</u> (B) Prevalence Index = B/A = <u>2.20</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Phalaris arundinacea</u>	<u>90</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Bromus inermis</u>	<u>5</u>		<u>UPL</u>	
3. <u>Cirsium arvense</u>	<u>5</u>		<u>FAC</u>	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>100</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				
Remarks: PEM, reed canarygrass is dominant at this site.				

SOIL

Sampling Point: SP14c-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 8	10YR 3/1	100					Silty Clay Loam	
8 - 16	10YR 5/1	95	10YR 4/6	5	C	M	Sandy Clay Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Depleted matrix in second horizon with sulfidic odor.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☐ No ☒ Depth (inches): _____

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Narrow bench adjacent to an irrigation canal.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15a-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): Convex Slope (%): 5
 Subregion (LRR): E 44 Lat: 45.393849 Long: -112.450987 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: <u>Upland same point in hayfield adjacent to the Warm Springs irrigation canal.</u>		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>50.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>28</u></td> <td>x 3 = <u>84</u></td> </tr> <tr> <td>FACU species <u>40</u></td> <td>x 4 = <u>160</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>68</u> (A)</td> <td><u>244</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.59</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>28</u>	x 3 = <u>84</u>	FACU species <u>40</u>	x 4 = <u>160</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>68</u> (A)	<u>244</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>28</u>	x 3 = <u>84</u>																	
FACU species <u>40</u>	x 4 = <u>160</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>68</u> (A)	<u>244</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Schedonorus pratensis</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation ___ 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Elymus repens</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
3. <u>Cirsium arvense</u>	<u>3</u>	<input type="checkbox"/>	<u>FAC</u>															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>68</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>32</u>																		
Remarks: <u>Site has been hayed.</u>																		

SOIL

Sampling Point: SP15a-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 7	10YR 3/1	100					Loam	
7 - 16	10YR 2/1	99	10YR 4/6	1	C	M	Silty Clay	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15a-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Sideslope Local relief (concave, convex, none): Concave Slope (%): 50
 Subregion (LRR): E 44 Lat: 45.393857 Long: -112.451005 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: Narrow wetland fringe on right bank of the Warm Springs irrigation canal.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ 0 = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>20</u></td> <td>x 1 = <u>20</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>57</u></td> <td>x 3 = <u>171</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>77</u> (A)</td> <td><u>191</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.48</u>	Total % Cover of:	Multiply by:	OBL species <u>20</u>	x 1 = <u>20</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>57</u>	x 3 = <u>171</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>77</u> (A)	<u>191</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>20</u>	x 1 = <u>20</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>57</u>	x 3 = <u>171</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>77</u> (A)	<u>191</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Agrostis stolonifera</u> <u>40</u> <input checked="" type="checkbox"/> <u>FAC</u> 2. <u>Eleocharis palustris</u> <u>20</u> <input checked="" type="checkbox"/> <u>OBL</u> 3. <u>Elymus repens</u> <u>10</u> <input type="checkbox"/> <u>FAC</u> 4. <u>Cirsium arvense</u> <u>5</u> <input type="checkbox"/> <u>FAC</u> 5. <u>Hordeum jubatum</u> <u>1</u> <input type="checkbox"/> <u>FAC</u> 6. <u>Symphyotrichum ericoides</u> <u>1</u> <input type="checkbox"/> <u>FAC</u> 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ 77 = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ 0 = Total Cover																		
% Bare Ground in Herb Stratum <u>23</u>																		
Remarks:																		
Wetland fringe is dominated by spikerush and quackgrass.																		

SOIL

Sampling Point: SP15a-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 8	10YR 2/1	100					Silty Clay Loam	
8 - 14	10GY 4/1	100					Silty Clay Loam	Gleyed.
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input checked="" type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Gleyed in second horizon.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 4
Water Table Present? Yes ☐ No ☒ Depth (inches): _____
Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Surface water flowing to north in adjacent irrigation canal.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15b-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.395066 Long: -112.450641 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point. Riparian, but doesn't qualify as a wetland.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>4</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>75.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
_____ = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>35</u> x 2 = <u>70</u> FAC species <u>105</u> x 3 = <u>315</u> FACU species <u>35</u> x 4 = <u>140</u> UPL species <u>5</u> x 5 = <u>25</u> Column Totals: <u>180</u> (A) <u>550</u> (B) Prevalence Index = B/A = <u>3.06</u>
Sapling/Shrub Stratum (Plot size: 15 ft r _____)				
1. <u>Salix exigua</u>	<u>35</u>	<input checked="" type="checkbox"/>	<u>FACW</u>	
2. <u>Symphoricarpos albus</u>	<u>30</u>	<input checked="" type="checkbox"/>	<u>FACU</u>	
3. <u>Ribes aureum</u>	<u>10</u>		<u>FAC</u>	
4. <u>Rosa woodsii</u>	<u>5</u>		<u>FACU</u>	
5. _____	_____	_____	_____	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
_____ = Total Cover				
Herb Stratum (Plot size: 5 ft r _____)				
1. <u>Elymus repens</u>	<u>63</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
2. <u>Poa pratensis</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
3. <u>Cirsium arvense</u>	<u>10</u>		<u>FAC</u>	
4. <u>Bromus inermis</u>	<u>5</u>		<u>UPL</u>	
5. <u>Asclepias speciosa</u>	<u>2</u>		<u>FAC</u>	
6. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
_____ = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
_____ = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				
Remarks: Upland sample point dominated by coyote willow with an understory of FAC species.				

SOIL

Sampling Point: SP15b-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 5	10YR 3/1	100					Silt Loam	
5 - 16	10YR 4/3	100					Silty Clay Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15b-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.395034 Long: -112.450601 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: Wetland fringe along left bank of the Warm Springs canal.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>4</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>75.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>15</u></td> <td>x 1 = <u>15</u></td> </tr> <tr> <td>FACW species <u>20</u></td> <td>x 2 = <u>40</u></td> </tr> <tr> <td>FAC species <u>45</u></td> <td>x 3 = <u>135</u></td> </tr> <tr> <td>FACU species <u>5</u></td> <td>x 4 = <u>20</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>85</u> (A)</td> <td><u>210</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.47</u>	Total % Cover of:	Multiply by:	OBL species <u>15</u>	x 1 = <u>15</u>	FACW species <u>20</u>	x 2 = <u>40</u>	FAC species <u>45</u>	x 3 = <u>135</u>	FACU species <u>5</u>	x 4 = <u>20</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>85</u> (A)	<u>210</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>15</u>	x 1 = <u>15</u>																	
FACW species <u>20</u>	x 2 = <u>40</u>																	
FAC species <u>45</u>	x 3 = <u>135</u>																	
FACU species <u>5</u>	x 4 = <u>20</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>85</u> (A)	<u>210</u> (B)																	
Sapling/Shrub Stratum (Plot size: 15 ft r _____)																		
1. <u>Salix exigua</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>FACW</u>															
2. <u>Rosa woodsii</u>	<u>5</u>	<input checked="" type="checkbox"/>	<u>FACU</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>25</u> = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Herb Stratum (Plot size: 5 ft r _____)																		
1. <u>Alopecurus arundinaceus</u>	<u>35</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Eleocharis palustris</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>OBL</u>															
3. <u>Agrostis scabra</u>	<u>5</u>	_____	<u>FAC</u>															
4. <u>Poa palustris</u>	<u>3</u>	_____	<u>FAC</u>															
5. <u>Asclepias speciosa</u>	<u>2</u>	_____	<u>FAC</u>															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>60</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>40</u>																		
Remarks: PEM wetland fringe with some coyote willow in this portion of the canal.																		

SOIL

Sampling Point: SP15b-W**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 4	10YR 2/1						Clay Loam	
4 - 12	10YR 4/2	98	10YR 4/6	2	C	M	Clay Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)****Indicators for Problematic Hydric Soils³:**

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> 2 cm Muck (A10)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Red Parent Material (TF2)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input checked="" type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input type="checkbox"/> Depleted Matrix (F3)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Redox Depressions (F8)	

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.**Restrictive Layer (if present):**

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Sulfidic odor throughout soil profile.

HYDROLOGY

Wetland Hydrology Indicators:Primary Indicators (minimum of one required; check all that apply)

<input checked="" type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Salt Crust (B11)
<input checked="" type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Aquatic Invertebrates (B13)
<input type="checkbox"/> Water Marks (B1)	<input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A)
<input type="checkbox"/> Surface Soil Cracks (B6)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	

Secondary Indicators (2 or more required)

<input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
<input type="checkbox"/> Drainage Patterns (B10)
<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input checked="" type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Shallow Aquitard (D3)
<input checked="" type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Raised Ant Mounds (D6) (LRR A)
<input type="checkbox"/> Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☒ No ☐ Depth (inches): 3Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Saturated to soil surface. Water is flowing northward in the adjacent Warm Springs irrigation canal.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15c-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Convex Slope (%): 10
 Subregion (LRR): E 44 Lat: 45.396317 Long: -112.450126 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: R5UBFx

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Hydic Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point between road and the Warm Springs irrigation canal.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>87</u> x 3 = <u>261</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>0</u> x 5 = <u>0</u> Column Totals: <u>87</u> (A) <u>261</u> (B) Prevalence Index = B/A = <u>3.00</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				
1. <u>Elymus repens</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Leymus cinereus</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
3. <u>Poa pratensis</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
4. <u>Asclepias speciosa</u>	<u>5</u>	<input type="checkbox"/>	<u>FAC</u>	
5. <u>Cirsium arvense</u>	<u>2</u>	<input type="checkbox"/>	<u>FAC</u>	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>87</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>13</u>				
Remarks: Upland sample point dominated by FAC vegetation.				

SOIL

Sampling Point: SP15c-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 15	10YR 4/2	100					Silt Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15c-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 1
 Subregion (LRR): E 44 Lat: 45.396272 Long: -112.450093 Datum: WGS 84
 Soil Map Unit Name: 150 - Villy silty clay loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PSS, riverine. Wetland sample point on right bank of Warm Springs canal.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: <u>15 ft r</u>) 1. <u>Salix exigua</u> <u>35</u> <input checked="" type="checkbox"/> <u>FACW</u> 2. _____ 3. _____ 4. _____ 5. _____ <u>35</u> = Total Cover				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>35</u> x 2 = <u>70</u> FAC species <u>77</u> x 3 = <u>231</u> FACU species <u>7</u> x 4 = <u>28</u> UPL species <u>5</u> x 5 = <u>25</u> Column Totals: <u>124</u> (A) <u>354</u> (B) Prevalence Index = B/A = <u>2.85</u>
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Leymus cinereus</u> <u>60</u> <input checked="" type="checkbox"/> <u>FAC</u> 2. <u>Asclepias speciosa</u> <u>15</u> <u>FAC</u> 3. <u>Cardaria draba</u> <u>5</u> <u>UPL</u> 4. <u>Sonchus arvensis</u> <u>5</u> <u>FACU</u> 5. <u>Galium boreale</u> <u>2</u> <u>FACU</u> 6. <u>Glycyrrhiza lepidota</u> <u>2</u> <u>FAC</u> 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ <u>89</u> = Total Cover				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ <u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>11</u>				
Remarks: PSS dominated by coyote willow.				

SOIL

Sampling Point: SP15c-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 6	10YR 3/2	100					Sandy Loam	
6 - 16	10YR 4/2	30	10YR 4/6	2	C	PL	Sandy Clay Loam	
6 - 16	10YR 4/3	68						
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input checked="" type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Second layer is mixed, likely from mixing of sidecast material from periodic ditch cleaning.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input checked="" type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 3

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 13
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Sample point is on a bench adjacent to the canal. Flowing water in the canal.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15d-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Convex Slope (%): 2
 Subregion (LRR): E 44 Lat: 45.397047 Long: -112.449632 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: <u>Upland sample point at edge of an alfalfa field.</u>	

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
			<u>0</u> = Total Cover	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>1</u></td> <td>x 2 = <u>2</u></td> </tr> <tr> <td>FAC species <u>12</u></td> <td>x 3 = <u>36</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>80</u></td> <td>x 5 = <u>400</u></td> </tr> <tr> <td>Column Totals: <u>93</u> (A)</td> <td><u>438</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>4.71</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>1</u>	x 2 = <u>2</u>	FAC species <u>12</u>	x 3 = <u>36</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>80</u>	x 5 = <u>400</u>	Column Totals: <u>93</u> (A)	<u>438</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>1</u>	x 2 = <u>2</u>																	
FAC species <u>12</u>	x 3 = <u>36</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>80</u>	x 5 = <u>400</u>																	
Column Totals: <u>93</u> (A)	<u>438</u> (B)																	
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
			<u>0</u> = Total Cover															
Herb Stratum (Plot size: <u>5 ft r</u> _____)																		
1. <u>Bromus inermis</u>	<u>75</u>	<input checked="" type="checkbox"/>	<u>UPL</u>															
2. <u>Poa pratensis</u>	<u>10</u>		<u>FAC</u>															
3. <u>Medicago sativa</u>	<u>5</u>		<u>UPL</u>															
4. <u>Cirsium arvense</u>	<u>2</u>		<u>FAC</u>															
5. <u>Phalaris arundinacea</u>	<u>1</u>		<u>FACW</u>															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
			<u>93</u> = Total Cover															
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
			<u>0</u> = Total Cover															
% Bare Ground in Herb Stratum <u>7</u>																		
Remarks: <u>Upland vegetation.</u>																		

SOIL

Sampling Point: SP15d-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 3	10YR 3/1	100					Silt Loam	
3 - 14	10YR 3/1	100					Sandy Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15d-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Bench Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.397047 Long: -112.449674 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: R5UBFx

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: Wetland fringe along the south central portion of the Warm Springs canal.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>45</u></td> <td>x 1 = <u>45</u></td> </tr> <tr> <td>FACW species <u>15</u></td> <td>x 2 = <u>30</u></td> </tr> <tr> <td>FAC species <u>35</u></td> <td>x 3 = <u>105</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>95</u> (A)</td> <td><u>180</u> (B)</td> </tr> </table>	Total % Cover of:	Multiply by:	OBL species <u>45</u>	x 1 = <u>45</u>	FACW species <u>15</u>	x 2 = <u>30</u>	FAC species <u>35</u>	x 3 = <u>105</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>95</u> (A)	<u>180</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>45</u>	x 1 = <u>45</u>																	
FACW species <u>15</u>	x 2 = <u>30</u>																	
FAC species <u>35</u>	x 3 = <u>105</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>95</u> (A)	<u>180</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Eleocharis palustris</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>OBL</u>	Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Alopecurus arundinaceus</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
3. <u>Muhlenbergia richardsonis</u>	<u>10</u>	<input type="checkbox"/>	<u>FAC</u>															
4. <u>Phalaris arundinacea</u>	<u>10</u>	<input type="checkbox"/>	<u>FACW</u>															
5. <u>Glyceria grandis</u>	<u>5</u>	<input type="checkbox"/>	<u>OBL</u>															
6. <u>Juncus torreyi</u>	<u>5</u>	<input type="checkbox"/>	<u>FACW</u>															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>95</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>5</u>																		
Remarks: PEM dominated by spikerush and creeping meadow foxtail.																		

SOIL

Sampling Point: SP15d-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features			Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹		
0 - 12	N 4/0	60	10YR 4/6	5	C	M	Sandy Loam
0 - 12	N 2.5/0	35					Gleyed.
-							
-							
-							
-							
-							
-							

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input checked="" type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Gleyed soils with a sulfidic odor.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 5

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Flowing water in canal. Saturated to the surface with a sulfidic odor.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15e-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Convex Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.397648 Long: -112.44942 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: R5UBFx

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: Upland sample point on berm. Sample point is roughly 1.5 ft higher than the wetland point.	

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ _____ = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>13</u> x 3 = <u>39</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>80</u> x 5 = <u>400</u> Column Totals: <u>93</u> (A) <u>439</u> (B) Prevalence Index = B/A = <u>4.72</u>
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Bromus inermis</u> <u>80</u> <input checked="" type="checkbox"/> <u>UPL</u> 2. <u>Elymus repens</u> <u>10</u> <input type="checkbox"/> <u>FAC</u> 3. <u>Asclepias speciosa</u> <u>2</u> <input type="checkbox"/> <u>FAC</u> 4. <u>Cirsium arvense</u> <u>1</u> <input type="checkbox"/> <u>FAC</u> 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ _____ = Total Cover				
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ _____ = Total Cover				
% Bare Ground in Herb Stratum <u>7</u>				
Remarks: Upland sample point dominated by smooth brome.				

SOIL

Sampling Point: SP15e-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 9	10YR 4/1	100					Sandy Loam	
9 - 16	10YR 3/1	30					Silt Loam	
9 - 16	10YR 4/2	70						
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15e-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.39765 Long: -112.449386 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: R5UBFx

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: Narrow PEM fringe along g the Warm Springs canal.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ 0 = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>45</u></td> <td>x 1 = <u>45</u></td> </tr> <tr> <td>FACW species <u>10</u></td> <td>x 2 = <u>20</u></td> </tr> <tr> <td>FAC species <u>40</u></td> <td>x 3 = <u>120</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>95</u> (A)</td> <td><u>185</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>1.95</u>	Total % Cover of:	Multiply by:	OBL species <u>45</u>	x 1 = <u>45</u>	FACW species <u>10</u>	x 2 = <u>20</u>	FAC species <u>40</u>	x 3 = <u>120</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>95</u> (A)	<u>185</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>45</u>	x 1 = <u>45</u>																	
FACW species <u>10</u>	x 2 = <u>20</u>																	
FAC species <u>40</u>	x 3 = <u>120</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>95</u> (A)	<u>185</u> (B)																	
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Eleocharis palustris</u> <u>45</u> <input checked="" type="checkbox"/> OBL 2. <u>Alopecurus arundinaceus</u> <u>30</u> <input checked="" type="checkbox"/> FAC 3. <u>Juncus torreyi</u> <u>10</u> FACW 4. <u>Agrostis stolonifera</u> <u>5</u> FAC 5. <u>Elymus repens</u> <u>5</u> FAC 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ 95 = Total Cover				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ 0 = Total Cover																		
% Bare Ground in Herb Stratum <u>5</u>																		
Remarks:																		
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>																		

SOIL

Sampling Point: SP15e-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	10Y 4/1	99	10YR 4/6	1	C	M	Sandy Loam	Gleyed.
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input checked="" type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Gleyed soil horizon with a sulfidic odor.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 4

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Water flowing northward in adjacent Warm Springs canal.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-09
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15f-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Hillslope Local relief (concave, convex, none): Convex Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.400688 Long: -112.448005 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Hydic Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point in flat area adjacent to highway.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>66.67</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>45</u> x 3 = <u>135</u> FACU species <u>0</u> x 4 = <u>0</u> UPL species <u>15</u> x 5 = <u>75</u> Column Totals: <u>60</u> (A) <u>210</u> (B) Prevalence Index = B/A = <u>3.50</u>
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u>)				
1. <u>Elymus repens</u>	<u>25</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. <u>Bromus inermis</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>UPL</u>	
3. <u>Poa pratensis</u>	<u>15</u>	<input checked="" type="checkbox"/>	<u>FAC</u>	
4. <u>Bassia scoparia</u>	<u>5</u>	<input type="checkbox"/>	<u>FAC</u>	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
11. _____	_____	_____	_____	
<u>60</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>40</u>				
Remarks: Upland sample point dominated by FAC vegetation.				

SOIL

Sampling Point: SP15f-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 4	10YR 3/2	100						
4 - 16	10YR 4/3	100					Silty Clay Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: Stone Creek - North City/County: Madison Co Sampling Date: 6/13/2013
 Applicant/Owner: MDT State: MT Sampling Point: SP15f-w
 Investigator(s): B Sandefur Section, Township, Range: S 15 T 5S R 7W
 Landform (hillslope, terrace, etc.): Valley bottom Local relief (concave, convex, none): concave Slope (%): 0
 Subregion (LRR): LRR E Lat: 45.400525 Long: -112.447993 Datum: WGS84
 Soil Map Unit Name: Havre loam NWI classification: Upland

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Remarks: DP along irrigation canal, inundated from backwater/headgate. Confirmed in 2023.	

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
0 = Total Cover				
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
3. _____	0	<input type="checkbox"/>		
4. _____	0	<input type="checkbox"/>		
5. _____	0	<input type="checkbox"/>		
0 = Total Cover				
Herb Stratum (Plot size: <u>5ft</u>)				
1. <u>Rumex crispus</u>	15	<input type="checkbox"/>	FAC	
2. <u>Alopecurus arundinaceus</u>	40	<input checked="" type="checkbox"/>	FAC	
3. <u>Plantago major</u>	5	<input type="checkbox"/>	FAC	
4. <u>Poa pratensis</u>	25	<input checked="" type="checkbox"/>	FAC	
5. _____	0	<input type="checkbox"/>		
6. _____	0	<input type="checkbox"/>		
7. _____	0	<input type="checkbox"/>		
8. _____	0	<input type="checkbox"/>		
9. _____	0	<input type="checkbox"/>		
10. _____	0	<input type="checkbox"/>		
11. _____	0	<input type="checkbox"/>		
85 = Total Cover				
Woody Vine Stratum (Plot size: _____)				
1. _____	0	<input type="checkbox"/>		
2. _____	0	<input type="checkbox"/>		
0 = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				

Dominance Test worksheet:
 Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)
 Total Number of Dominant Species Across All Strata: 2 (B)
 Percent of Dominant Species That Are OBL, FACW, or FAC: 1 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:
OBL species <u>0</u>	x 1 = <u>0</u>
FACW species <u>0</u>	x 2 = <u>0</u>
FAC species <u>85</u>	x 3 = <u>255</u>
FACU species <u>0</u>	x 4 = <u>0</u>
UPL species <u>0</u>	x 5 = <u>0</u>
Column Totals: <u>85</u> (A)	<u>255</u> (B)

Prevalence Index = B/A = 3

Hydrophytic Vegetation Indicators:
☐ 1 - Rapid Test for Hydrophytic Vegetation
☒ 2 - Dominance Test is >50%
☒ 3 - Prevalence Index is ≤3.0¹
☐ 4 - Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
☐ 5 - Wetland Non-Vascular Plants¹
☐ Problematic Hydrophytic Vegetation¹ (Explain)
¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes ☒ No ☐

Remarks:
 PEM dominated by creeping meadow foxtail.

Sampling Point: SP15f-w

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- ### Indicators for Problematic Hydric Soils³:

- ³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Site has a depleted matrix.

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- Secondary Indicators (2 or more required)**

- ☐ Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B)
- ☐ Drainage Patterns (B10)
- ☐ Dry-Season Water Table (C2)
- ☒ Saturation Visible on Aerial Imagery (C9)
- ☐ Geomorphic Position (D2)
- ☐ Shallow Aquitard (D3)
- ☐ FAC-Neutral Test (D5)
- ☐ Raised Ant Mounds (D6) (LRR A)
- ☐ Frost-Heave Hummocks (D7)

Field Observations:

(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Site occurs in a low spot between the ditch and the road that is occasionally flooded by irrigation water.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15g-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.401311 Long: -112.447509 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland point between the Warm Springs canal and a wheatfield.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>5</u></td> <td>x 3 = <u>15</u></td> </tr> <tr> <td>FACU species <u>1</u></td> <td>x 4 = <u>4</u></td> </tr> <tr> <td>UPL species <u>75</u></td> <td>x 5 = <u>375</u></td> </tr> <tr> <td>Column Totals: <u>81</u> (A)</td> <td><u>394</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>4.86</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>5</u>	x 3 = <u>15</u>	FACU species <u>1</u>	x 4 = <u>4</u>	UPL species <u>75</u>	x 5 = <u>375</u>	Column Totals: <u>81</u> (A)	<u>394</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>5</u>	x 3 = <u>15</u>																	
FACU species <u>1</u>	x 4 = <u>4</u>																	
UPL species <u>75</u>	x 5 = <u>375</u>																	
Column Totals: <u>81</u> (A)	<u>394</u> (B)																	
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ <u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>) 1. <u>Bromus inermis</u> <u>60</u> <input checked="" type="checkbox"/> <u>UPL</u> 2. <u>Triticum aestivum</u> <u>15</u> <input type="checkbox"/> <u>UPL</u> 3. <u>Elymus repens</u> <u>5</u> <input type="checkbox"/> <u>FAC</u> 4. <u>Taraxacum officinale</u> <u>1</u> <input type="checkbox"/> <u>FACU</u> 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ <u>81</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ <u>0</u> = Total Cover % Bare Ground in Herb Stratum <u>19</u>																		
Remarks: Upland point dominated by smooth brome.																		

SOIL

Sampling Point: SP15g-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 14	10YR 5/2	100					Silty Clay Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

At edge of a wheat field. No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15g-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.401321 Long: -112.447538 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: R5UBFx

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		
Remarks: PEM fringe adjacent to the Warm Springs irrigation canal.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>70</u></td> <td>x 1 = <u>70</u></td> </tr> <tr> <td>FACW species <u>7</u></td> <td>x 2 = <u>14</u></td> </tr> <tr> <td>FAC species <u>15</u></td> <td>x 3 = <u>45</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>92</u> (A)</td> <td><u>129</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>1.40</u>	Total % Cover of:	Multiply by:	OBL species <u>70</u>	x 1 = <u>70</u>	FACW species <u>7</u>	x 2 = <u>14</u>	FAC species <u>15</u>	x 3 = <u>45</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>92</u> (A)	<u>129</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>70</u>	x 1 = <u>70</u>																	
FACW species <u>7</u>	x 2 = <u>14</u>																	
FAC species <u>15</u>	x 3 = <u>45</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>92</u> (A)	<u>129</u> (B)																	
Sapling/Shrub Stratum (Plot size: _____) 1. _____ 2. _____ 3. _____ 4. _____ 5. _____ <u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u> _____) 1. <u>Eleocharis palustris</u> <u>40</u> <input checked="" type="checkbox"/> <u>OBL</u> 2. <u>Sagittaria latifolia</u> <u>30</u> <input checked="" type="checkbox"/> <u>OBL</u> 3. <u>Alopecurus arundinaceus</u> <u>15</u> <input type="checkbox"/> <u>FAC</u> 4. <u>Echinochloa muricata</u> <u>5</u> <input type="checkbox"/> <u>FACW</u> 5. <u>Polypogon monspeliensis</u> <u>2</u> <input type="checkbox"/> <u>FACW</u> 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ 11. _____ <u>92</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____) 1. _____ 2. _____ <u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>8</u>																		
Remarks: PEM along the irrigation ditch.																		

SOIL

Sampling Point: SP15g-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 12	N 4/0	100					Loamy Sand	Gleyed.
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input checked="" type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Gleyed with sulfidic odor.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 6

Water Table Present? Yes ☐ No ☒ Depth (inches): _____

Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Water flowing north in the adjacent Warm Springs canal.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15h-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Convex Slope (%): 15
 Subregion (LRR): E 44 Lat: 45.404584 Long: -112.446388 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
Remarks: Upland sample point at north end of project area, between highway and the Warm Springs irrigation canal.			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
_____ = Total Cover				Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>80</u></td> <td>x 3 = <u>240</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>80</u> (A)</td> <td><u>240</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.00</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>80</u>	x 3 = <u>240</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>80</u> (A)	<u>240</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>80</u>	x 3 = <u>240</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>80</u> (A)	<u>240</u> (B)																	
_____ = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
_____ = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u> _____)																		
1. <u>Bassia scoparia</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Elymus repens</u>	<u>40</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
_____ = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
_____ = Total Cover																		
% Bare Ground in Herb Stratum <u>20</u>																		
Remarks:																		
Upland sample point dominated by FAC vegetation.																		

SOIL

Sampling Point: SP15h-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 9	10YR 4/3	100					Sandy Loam	
9 - 16	10Y 5/4	100					Sandy Loam	
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15h-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.404564 Long: -112.446346 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: Not mapped

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	
Remarks: PEM fringe adjacent to Warm Springs canal.		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>1</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Prevalence Index worksheet: <table border="0"> <tr> <td>Total % Cover of:</td> <td>Multiply by:</td> </tr> <tr> <td>OBL species <u>60</u></td> <td>x 1 = <u>60</u></td> </tr> <tr> <td>FACW species <u>5</u></td> <td>x 2 = <u>10</u></td> </tr> <tr> <td>FAC species <u>15</u></td> <td>x 3 = <u>45</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>80</u> (A)</td> <td><u>115</u> (B)</td> </tr> </table>	Total % Cover of:	Multiply by:	OBL species <u>60</u>	x 1 = <u>60</u>	FACW species <u>5</u>	x 2 = <u>10</u>	FAC species <u>15</u>	x 3 = <u>45</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>80</u> (A)	<u>115</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>60</u>	x 1 = <u>60</u>																	
FACW species <u>5</u>	x 2 = <u>10</u>																	
FAC species <u>15</u>	x 3 = <u>45</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>80</u> (A)	<u>115</u> (B)																	
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u>)																		
1. <u>Eleocharis palustris</u>	<u>60</u>	<input checked="" type="checkbox"/>	<u>OBL</u>	Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% <input checked="" type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ 5 - Wetland Non-Vascular Plants ¹ ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
2. <u>Alopecurus arundinaceus</u>	<u>15</u>	_____	<u>FAC</u>															
3. <u>Echinochloa muricata</u>	<u>5</u>	_____	<u>FACW</u>															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>80</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____	Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>20</u>																		
Remarks: PEM fringe adjacent to the canal, dominated by spikerush.																		

SOIL

Sampling Point: SP15h-W

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 2	10YR 4/2	100					Sandy Loam	
2 - 12	10YR 2/1							
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input checked="" type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Sulfidic odor throughout soil profile.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input checked="" type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input checked="" type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input checked="" type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input checked="" type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes ☒ No ☐ Depth (inches): 5
Water Table Present? Yes ☐ No ☒ Depth (inches): _____
Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)

Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Sulfidic odor, saturated to the soil surface, flowing water in the canal.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15i-U
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Valley Floor Local relief (concave, convex, none): Linear Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.406071 Long: -112.445346 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: R5UBFx

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Hydric Soil Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Wetland Hydrology Present?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	
Remarks: <u>Upland point between canal and a wheatfield.</u>		

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>0</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>0.00</u> (A/B)
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
<u>0</u> = Total Cover				Prevalence Index worksheet: Total % Cover of: Multiply by: OBL species <u>0</u> x 1 = <u>0</u> FACW species <u>0</u> x 2 = <u>0</u> FAC species <u>10</u> x 3 = <u>30</u> FACU species <u>5</u> x 4 = <u>20</u> UPL species <u>85</u> x 5 = <u>425</u> Column Totals: <u>100</u> (A) <u>475</u> (B) Prevalence Index = B/A = <u>4.75</u>
Sapling/Shrub Stratum (Plot size: _____)				
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
<u>0</u> = Total Cover				
Herb Stratum (Plot size: <u>5 ft r</u> _____)				Hydrophytic Vegetation Indicators: <input type="checkbox"/> 1 - Rapid Test for Hydrophytic Vegetation <input type="checkbox"/> 2 - Dominance Test is >50% <input type="checkbox"/> 3 - Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> 5 - Wetland Non-Vascular Plants ¹ <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
1. <u>Bromus inermis</u>	<u>65</u>	<input checked="" type="checkbox"/>	<u>UPL</u>	
2. <u>Triticum aestivum</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>UPL</u>	
3. <u>Elymus repens</u>	<u>10</u>	<input type="checkbox"/>	<u>FAC</u>	
4. <u>Taraxacum officinale</u>	<u>5</u>	<input type="checkbox"/>	<u>FACU</u>	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
<u>100</u> = Total Cover				
Woody Vine Stratum (Plot size: _____)				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
<u>0</u> = Total Cover				
% Bare Ground in Herb Stratum <u>0</u>				
Remarks: <u>Upland sample point dominated by smooth brome.</u>				

SOIL

Sampling Point: SP15i-U

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features			Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹		
0 - 12	10YR 3/2	99	10YR 4/6	1	C	M	Sandy Clay Loam
12 - 15	10YR 4/3	100					Sandy Loam
-							
-							
-							
-							
-							
-							

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.

²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)

- | | |
|--|--|
| <input type="checkbox"/> Histosol (A1) | <input type="checkbox"/> Sandy Redox (S5) |
| <input type="checkbox"/> Histic Epipedon (A2) | <input type="checkbox"/> Stripped Matrix (S6) |
| <input type="checkbox"/> Black Histic (A3) | <input type="checkbox"/> Loamy Mucky Mineral (F1) (except MLRA 1) |
| <input type="checkbox"/> Hydrogen Sulfide (A4) | <input type="checkbox"/> Loamy Gleyed Matrix (F2) |
| <input type="checkbox"/> Depleted Below Dark Surface (A11) | <input type="checkbox"/> Depleted Matrix (F3) |
| <input type="checkbox"/> Thick Dark Surface (A12) | <input type="checkbox"/> Redox Dark Surface (F6) |
| <input type="checkbox"/> Sandy Mucky Mineral (S1) | <input type="checkbox"/> Depleted Dark Surface (F7) |
| <input type="checkbox"/> Sandy Gleyed Matrix (S4) | <input type="checkbox"/> Redox Depressions (F8) |

Indicators for Problematic Hydric Soils³:

- | |
|---|
| <input type="checkbox"/> 2 cm Muck (A10) |
| <input type="checkbox"/> Red Parent Material (TF2) |
| <input type="checkbox"/> Very Shallow Dark Surface (TF12) |
| <input type="checkbox"/> Other (Explain in Remarks) |

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes _____ No ☒

Remarks:

No hydric soil indicators observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- | | |
|--|--|
| <input type="checkbox"/> Surface Water (A1) | <input type="checkbox"/> Water-Stained Leaves (B9) (except MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> High Water Table (A2) | <input type="checkbox"/> Salt Crust (B11) |
| <input type="checkbox"/> Saturation (A3) | <input type="checkbox"/> Aquatic Invertebrates (B13) |
| <input type="checkbox"/> Water Marks (B1) | <input type="checkbox"/> Hydrogen Sulfide Odor (C1) |
| <input type="checkbox"/> Sediment Deposits (B2) | <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) |
| <input type="checkbox"/> Drift Deposits (B3) | <input type="checkbox"/> Presence of Reduced Iron (C4) |
| <input type="checkbox"/> Algal Mat or Crust (B4) | <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) |
| <input type="checkbox"/> Iron Deposits (B5) | <input type="checkbox"/> Stunted or Stressed Plants (D1) (LRR A) |
| <input type="checkbox"/> Surface Soil Cracks (B6) | <input type="checkbox"/> Other (Explain in Remarks) |
| <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) | |
| <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) | |

Secondary Indicators (2 or more required)

- | |
|---|
| <input type="checkbox"/> Water-Stained Leaves (B9) (MLRA 1, 2, 4A, and 4B) |
| <input type="checkbox"/> Drainage Patterns (B10) |
| <input type="checkbox"/> Dry-Season Water Table (C2) |
| <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) |
| <input type="checkbox"/> Geomorphic Position (D2) |
| <input type="checkbox"/> Shallow Aquitard (D3) |
| <input type="checkbox"/> FAC-Neutral Test (D5) |
| <input type="checkbox"/> Raised Ant Mounds (D6) (LRR A) |
| <input type="checkbox"/> Frost-Heave Hummocks (D7) |

Field Observations:

Surface Water Present? Yes _____ No ☒ Depth (inches): _____

Water Table Present? Yes _____ No ☒ Depth (inches): _____

Saturation Present? Yes _____ No ☒ Depth (inches): _____
(includes capillary fringe)

Wetland Hydrology Present? Yes _____ No ☒

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

No evidence of wetland hydrology observed.

WETLAND DETERMINATION DATA FORM – Western Mountains, Valleys, and Coast Region

Project/Site: MDT Stone Crk 2023 City/County: Madison County Sampling Date: 2023-08-10
 Applicant/Owner: Montana Dept. of Transportation State: Montana Sampling Point: SP15i-W
 Investigator(s): McEldowney Section, Township, Range: S15 T5S R7W
 Landform (hillslope, terrace, etc.): Bench Local relief (concave, convex, none): Concave Slope (%): 0
 Subregion (LRR): E 44 Lat: 45.406081 Long: -112.445359 Datum: WGS 84
 Soil Map Unit Name: 58 - Havre loam, cool, 0 to 2 percent slopes NWI classification: R5UBFx

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ☒ No ☐ (If no, explain in Remarks.)
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ significantly disturbed? Are "Normal Circumstances" present? Yes ☒ No ☐
 Are Vegetation ☐, Soil ☐, or Hydrology ☐ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Remarks: Wetland sample point on a bench adjacent to the Warm Springs canal at the north end of the project area.	

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: _____)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:														
1. _____	_____	_____	_____	Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
<u>0</u> = Total Cover				Prevalence Index worksheet: <table style="width: 100%;"> <tr> <th>Total % Cover of:</th> <th>Multiply by:</th> </tr> <tr> <td>OBL species <u>20</u></td> <td>x 1 = <u>20</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>80</u></td> <td>x 3 = <u>240</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>100</u> (A)</td> <td><u>260</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>2.60</u>	Total % Cover of:	Multiply by:	OBL species <u>20</u>	x 1 = <u>20</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>80</u>	x 3 = <u>240</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>100</u> (A)	<u>260</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>20</u>	x 1 = <u>20</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>80</u>	x 3 = <u>240</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>100</u> (A)	<u>260</u> (B)																	
<u>0</u> = Total Cover																		
Sapling/Shrub Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
Herb Stratum (Plot size: <u>5 ft r</u> _____)																		
1. <u>Alopecurus arundinaceus</u>	<u>80</u>	<input checked="" type="checkbox"/>	<u>FAC</u>															
2. <u>Carex nebrascensis</u>	<u>20</u>	<input checked="" type="checkbox"/>	<u>OBL</u>															
3. _____	_____	_____	_____															
4. _____	_____	_____	_____															
5. _____	_____	_____	_____															
6. _____	_____	_____	_____															
7. _____	_____	_____	_____															
8. _____	_____	_____	_____															
9. _____	_____	_____	_____															
10. _____	_____	_____	_____															
11. _____	_____	_____	_____															
<u>100</u> = Total Cover																		
Woody Vine Stratum (Plot size: _____)																		
1. _____	_____	_____	_____															
2. _____	_____	_____	_____															
<u>0</u> = Total Cover																		
% Bare Ground in Herb Stratum <u>0</u>																		
Remarks: PEM dominated by creeping meadow foxtail and Nebraska sedge.																		

SOIL

Sampling Point: SP15i-W**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0 - 13	10YR 4/1	95	10YR 4/6	5	C		Silty Clay Loam	
-								
-								
-								
-								
-								
-								
-								
-								

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains.²Location: PL=Pore Lining, M=Matrix.**Hydric Soil Indicators: (Applicable to all LRRs, unless otherwise noted.)**

- ☐ Histosol (A1) ☐ Sandy Redox (S5)
☐ Histic Epipedon (A2) ☐ Stripped Matrix (S6)
☐ Black Histic (A3) ☐ Loamy Mucky Mineral (F1) (**except MLRA 1**)
☒ Hydrogen Sulfide (A4) ☐ Loamy Gleyed Matrix (F2)
☐ Depleted Below Dark Surface (A11) ☒ Depleted Matrix (F3)
☐ Thick Dark Surface (A12) ☐ Redox Dark Surface (F6)
☐ Sandy Mucky Mineral (S1) ☐ Depleted Dark Surface (F7)
☐ Sandy Gleyed Matrix (S4) ☐ Redox Depressions (F8)

Indicators for Problematic Hydric Soils³:

- ☐ 2 cm Muck (A10)
☐ Red Parent Material (TF2)
☐ Very Shallow Dark Surface (TF12)
☐ Other (Explain in Remarks)

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if present):

Type: _____

Depth (inches): _____

Hydric Soil Present? Yes ☒ No ☐

Remarks:

Sulfidic odor and depleted matrix observed.

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one required; check all that apply)

- ☒ Surface Water (A1) ☐ Water-Stained Leaves (B9) (**except MLRA 1, 2, 4A, and 4B**)
☐ High Water Table (A2) ☐ Salt Crust (B11)
☒ Saturation (A3) ☐ Aquatic Invertebrates (B13)
☐ Water Marks (B1) ☒ Hydrogen Sulfide Odor (C1)
☐ Sediment Deposits (B2) ☐ Oxidized Rhizospheres along Living Roots (C3)
☐ Drift Deposits (B3) ☐ Presence of Reduced Iron (C4)
☐ Algal Mat or Crust (B4) ☐ Recent Iron Reduction in Tilled Soils (C6)
☐ Iron Deposits (B5) ☐ Stunted or Stressed Plants (D1) (**LRR A**)
☐ Surface Soil Cracks (B6) ☐ Other (Explain in Remarks)
☐ Inundation Visible on Aerial Imagery (B7)
☐ Sparsely Vegetated Concave Surface (B8)

Secondary Indicators (2 or more required)

- ☐ Water-Stained Leaves (B9) (**MLRA 1, 2, 4A, and 4B**)
☐ Drainage Patterns (B10)
☐ Dry-Season Water Table (C2)
☐ Saturation Visible on Aerial Imagery (C9)
☒ Geomorphic Position (D2)
☐ Shallow Aquitard (D3)
☒ FAC-Neutral Test (D5)
☐ Raised Ant Mounds (D6) (**LRR A**)
☐ Frost-Heave Hummocks (D7)

Field Observations:Surface Water Present? Yes ☒ No ☐ Depth (inches): 6Water Table Present? Yes ☐ No ☒ Depth (inches): _____Saturation Present? Yes ☒ No ☐ Depth (inches): 0
(includes capillary fringe)Wetland Hydrology Present? Yes ☒ No ☐

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

Water flowing in adjacent Warm Springs canal. Soil saturated to the surface and a sulfidic odor detected in the soil profile.

MDT Montana Wetland Assessment Form (revised March 2008)

1. **Project Name:** Stone Creek - North
 2. **MDT Project #:** STPP49-1(25)9 **Control #:** 7931000
 3. **Evaluation Date:** 09/18/2023 4. **Evaluator(s):** R. McElowney 5. **Wetlands/Site #(s):** AA-01 (W-01)
 6. **Wetland Location(s): i. Legal:** T5S,R7W,33 **Latitude/Longitude:**
 ii. **Approx. Stationing or Mileposts:** 9.02
 iii. **Watershed:** 6

Watershed Name, County: Upper Missouri, Beaverhead

7. **a. Evaluating Agency:** Confluence Consulting

b. Purpose of Evaluation:

1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:

8. **Wetland size:** 0.500 acres (estimated)

9. **Assessment area (AA):** 0.500 acres (estimated)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
R	EM	NA	SI	70.00
R	SS	NA	SI	5.00
R	UB	NA	PP	20.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. **Estimated relative abundance:** (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)

ABUNDANT

12. General condition of AA:

i. **Disturbance:** (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): Highway crosses over the AA and farm roads bracket it at the upstream and downstream ends of the AA. Channel has been straightened and manipulated for agriculture.

ii. **Prominent noxious, aquatic nuisance, & other exotic vegetation species:** Reed canarygrass, Canada thistle.

iii. **Provide brief descriptive summary of AA and surrounding land use/habitat:** Surrounding land use is agricultural, including pasture, irrigated crops, and other related uses. Upstream of the highway the AA crosses through a cropped field irrigated by a pivot. Downstream of the highway, the AA occurs immediately west of a hay stack yard and various out buildings and storage areas.

13. **Structural Diversity:** (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: Site contains PEM and PSS wetland types.

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP element occurrence report, 2015 special status plant survey

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP, MFISH

Westslope cutthroat trout do not occur in this section of Stone Creek.

14C. General Wildlife Habitat Rating:

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☐ few or no wildlife observations during peak use periods
- ☒ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☐ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☐ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other in terms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: Highly disturbed with minimal signs of use by wildlife.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is "correctable" such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark NA and proceed to 14E.)

Type of Fishery: Cold Water (CW) X Warm Water (WW) Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA: MFISH.

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed "Probable Impaired Uses" including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? X If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? If yes, add 0.1 to the adjusted score in i or iia.

iii. Final Score and Rating: 0.4M

Comments: Stone Creek is a highly disturbed system with little suitable habitat. The downstream connection to the Beaverhead River is manipulated and impeded by a series of ditches that the creek flows through before it confluences with the Beaverhead.

14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark NA and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched - B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User's Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

$$\frac{16}{9} = 1.78$$

Flood-prone width Bankfull width Entrenchment ratio (ER)



Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)?

Comments: The stream has been straightened and has incised, especially on the downstream side of the highway. The outlet at the downstream end of the AA is restricted by a culvert.

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: Due to their small size and relative steepness, the wetlands adjacent to Stone Creek provide very little surface water storage.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating [H=high, M=moderate, or L=low])

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.			
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%	
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L

Comments: Stone Creek receives a significant amount of sediment and nutrient input from the surrounding agricultural fields.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of <u>wetland</u> streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial	Seasonal / Intermittent	Temporary / Ephemeral
>= 65%	1H	.9H	.7M
35-64%	.7M	.6M	.5M
35%	.3L	.2L	.1L

Comments: Reed canarygrass provides a great deal of streambank stability in the AA.

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) Vegetated Upland Buffer (VUB): Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference?

If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.60M

Comments: As the only perennial source of water in this area, Stone Creek provides food chain support to the surrounding ecosystem. A portion of the area around the creek upstream of the highway is mowed/cropped.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
☐ Springs or seeps are known or observed
☐ Vegetation growing during dormant season/drought
☐ Wetland occurs at the toe of a natural slope
☐ AA permanently flooded during drought periods
☐ Wetland contains an outlet, but no inlet
☐ Shallow water table and the site is saturated to the surface
☐ Other:

ii. Recharge Indicators

- ☐ Permeable substrate present without underlying impeding layer
☐ Wetland contains inlet but no outlet
☐ Stream is a known 'losing' stream; discharge volume decreases
☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: Insufficient information is available to understand if or how much interaction Stone Creek has with groundwater in this area.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
Estimated relative abundance (#11)	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: This is a highly disturbed system with very common species and is relatively easy to replace.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ____ (if 'Yes' continue with the evaluation; if 'No' then mark **X** **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ____ Educational/scientific study; ____ Consumptive rec.; ____ Non-consumptive rec.;
 ____ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: This site is on private land and its current condition does not provide much of an opportunity for recreation or educational opportunities, except, perhaps, as an example of a highly impacted stream system.

General Site Notes
<p>The grade of Stone Creek increases on the downstream side (north) of the highway.</p> <p>As a perennial system the AA provides fish habitat.</p> <p>Because of its location adjacent to agricultural activities the AA has a high level of opportunity to provide water quality improvements.</p> <p>The reed canarygrass is providing a high level of bank stability within the AA.</p> <p>As one of the only perennial streams in the area, the AA provides food chain support to the local ecosystem.</p>

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-01 (W-01)

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.00	1	0.00	
B. MT Natural Heritage Program Species Habitat	L	0.00	1	0.00	
C. General Wildlife Habitat	L	0.20	1	0.10	
D. General Fish Habitat	M	0.40	1	0.20	*
E. Flood Attenuation	M	0.50	1	0.25	
F. Short and Long Term Surface Water Storage	L	0.30	1	0.15	
G. Sediment/Nutrient/Toxicant Removal	M	0.50	1	0.25	*
H. Sediment/Shoreline Stabilization	H	1.00	1	0.50	*
I. Production Export/Food Chain Support	M	0.60	1	0.30	*
J. Groundwater Discharge/Recharge	NA				
K. Uniqueness	L	0.10	1	0.05	
L. Recreation/Education Potential (bonus points)	NA				
Totals:		3.60	10.00	1.80	
Percent of Possible Score			36%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☐ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☒ "Low" rating for Uniqueness; **and**
☒ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☐ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: III

Summary Comments: AA-01 is a low category III wetland that is highly disturbed by agricultural activities and the highway.

MDT Montana Wetland Assessment Form (revised March 2008)

1. Project Name: Stone Creek - North
2. MDT Project #: STPP49-1(25)9 **Control #:** 7931000
3. Evaluation Date: 09/18/2023 **4. Evaluator(s):** R. McElDowney
5. Wetlands/Site #(s): AA-02 (W-02, W-04, W-05)
6. Wetland Location(s): i. Legal: T5S,R7W,22 ;T6S,R7W,6 **Latitude/Longitude:**
 ii. Approx. Stationing or Mileposts: 10.22, 14.35, 14.38
 iii. Watershed: 10020002

Watershed Name, County: Upper Missouri, Beaverhead & Madison County

7. a. Evaluating Agency: Confluence Consulting

b. Purpose of Evaluation:

1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:

8. Wetland size: 0.010 acres (estimated)

9. Assessment area (AA): 0.010 acres (estimated)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
D	EM	NA	TE	100.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. Estimated relative abundance: (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)

ABUNDANT

12. General condition of AA:

i. Disturbance: (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): AA is comprised of several small ephemeral emergent wetlands that are highly disturbed by land management activities.

ii. Prominent noxious, aquatic nuisance, & other exotic vegetation species: Canada thistle

iii. Provide brief descriptive summary of AA and surrounding land use/habitat: Highway right-of-way, haying, grazing.

13. Structural Diversity: (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PEM

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP report, 2015 special status plant survey

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP report, 2015 special status plant survey.

14C. General Wildlife Habitat Rating:

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☒ few or no wildlife observations during peak use periods
- ☒ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☐ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☐ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other interms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: Very small wetland area with little value to wildlife.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is “correctable” such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark **X NA** and proceed to 14E.)

Type of Fishery: Cold Water (CW) _____ Warm Water (WW) _____ **Use the CW or WW guidelines in the user manual to complete the matrix**

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA:

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed “Probable Impaired Uses” including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? _____ If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? _____ If yes, add 0.1 to the adjusted score in i or iia.

iii. Final Score and Rating: NA **Comments:** No fish habitat in AA.


14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark **X NA** and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched – B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User’s Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

$$\frac{\text{Flood-prone width}}{\text{Bankfull width}} = \text{Entrenchment ratio (ER)}$$

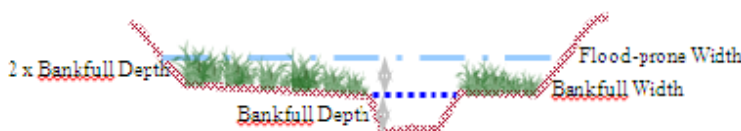

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? _____ **Comments:** NA

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: These are small wetlands that flood in response to precipitation events.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating [H=high, M=moderate, or L=low])

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%		
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No	
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L	
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L	

Comments: As depressional wetlands they serve as sinks for toxicants. These wetlands have either no outlet or an outlet restricted by a culvert.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, X NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of <u>wetland</u> streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial	Seasonal / Intermittent	Temporary / Ephemeral
>= 65%	1H	.9H	.7M
35-64%	.7M	.6M	.5M
35%	.3L	.2L	.1L

Comments: NA

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) **Vegetated Upland Buffer (VUB):** Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference?

If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.10L

Comments: While some of the sites do contain a restricted outlet, the frequency they flow is estimated to be rarely, and so is not considered to have a significant role in food chain support. The sites do not have qualifying vegetated buffers.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
- ☐ Springs or seeps are known or observed
- ☐ Vegetation growing during dormant season/drought
- ☐ Wetland occurs at the toe of a natural slope
- ☐ AA permanently flooded during drought periods
- ☐ Wetland contains an outlet, but no inlet
- ☐ Shallow water table and the site is saturated to the surface
- ☐ Other:

ii. Recharge Indicators

- ☒ Permeable substrate present without underlying impeding layer
- ☒ Wetland contains inlet but no outlet
- ☐ Stream is a known 'losing' stream; discharge volume decreases
- ☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: As depressional wetlands, they likely help to recharge the shallow aquifer.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
Estimated relative abundance (#11)	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: These wetlands are very abundant in the watershed and are relatively easy to replace.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ____ (if 'Yes' continue with the evaluation; if 'No' then mark **X** **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ____ Educational/scientific study; ____ Consumptive rec.; ____ Non-consumptive rec.;
____ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: These wetlands have no value for education or recreation.

General Site Notes
Roadside ditch wetlands that are highly disturbed.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-02 (W-02, W-04, W-05)

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.00	1	0.00	
B. MT Natural Heritage Program Species Habitat	L	0.00	1	0.00	
C. General Wildlife Habitat	L	0.10	1	0.00	
D. General Fish Habitat	NA				
E. Flood Attenuation	NA				
F. Short and Long Term Surface Water Storage	L	0.30	1	0.00	*
G. Sediment/Nutrient/Toxicant Removal	H	0.80	1	0.01	*
H. Sediment/Shoreline Stabilization	NA				
I. Production Export/Food Chain Support	L	0.10	1	0.00	*
J. Groundwater Discharge/Recharge	M	0.40	1	0.00	*
K. Uniqueness	L	0.10	1	0.00	
L. Recreation/Education Potential (bonus points)	NA				
Totals:		1.80	8.00	0.01	
Percent of Possible Score			23%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☐ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☒ "Low" rating for Uniqueness; **and**
☒ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☒ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: IV

Summary Comments: Category IV wetlands. Because of their depressional nature these wetlands are providing higher functionality for short/long term surface water storage and pollutant removal. Of the remaining functions, these wetlands are providing more functionality for the production export and groundwater recharge functions than the other functions.

MDT Montana Wetland Assessment Form (revised March 2008)

1. **Project Name:** Stone Creek - North
2. **MDT Project #:** STPP49-1(25)9
3. **Evaluation Date:** 09/18/2023
4. **Evaluator(s):** R. McElowney
5. **Wetlands/Site #(s):** AA-03 (W-03a (Pond on south side))
6. **Wetland Location(s): i. Legal:** T5S,R7W,33
- Latitude/Longitude:**
- ii. **Approx. Stationing or Mileposts:** 12.72
- iii. **Watershed:** 10020002
- Watershed Name, County:** Upper Missouri, Beaverhead
7. **a. Evaluating Agency:** Confluence Consulting
- b. Purpose of Evaluation:**
1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:
8. **Wetland size:** 0.800 acres (measured)
9. **Assessment area (AA):** 0.800 acres (measured)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
D	AB	I	PP	90.00
D	EM	I	SI	5.00
D	FO	I	SI	5.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. **Estimated relative abundance:** (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)
ABUNDANT

12. General condition of AA:

- i. **Disturbance:** (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): 5 Rivers Lodge and associated grounds is nearby. Highway occurs immediately north of the AA.

ii. **Prominent noxious, aquatic nuisance, & other exotic vegetation species:** Reed canarygrass

iii. **Provide brief descriptive summary of AA and surrounding land use/habitat:** Excavated pond in an unnamed drainage. The highway occurs at the north end of the AA, and the 5 Rivers Lodge is located >500 ft to the east.

13. **Structural Diversity:** (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PEM, PRO, PAB wetlands types.

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP report, 2015 Special status plant species survey.

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP report, 2015 Special status plant species survey.

14C. General Wildlife Habitat Rating:

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☐ few or no wildlife observations during peak use periods
- ☐ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☒ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☐ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other interms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: Numerous bird species observed using the AA.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is "correctable" such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark NA and proceed to 14E.)

Type of Fishery: Cold Water (CW) X Warm Water (WW) Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA: The pond appears to have been designed for fisherman. Suspect that it is stocked with rainbow and brown trout.

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed "Probable Impaired Uses" including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? If yes, add 0.1 to the adjusted score in i or iia.

iii. Final Score and Rating: 0.3L

Comments: The lack of shrubs and trees makes the site more subject to thermal loading. The culvert at the north end of the AA likely reduces fish use.


14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark NA and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched - B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User's Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

$$\frac{2.3}{\text{Flood-prone width}} = \frac{1}{\text{Bankfull width}} = \frac{2.30}{\text{Entrenchment ratio (ER)}}$$

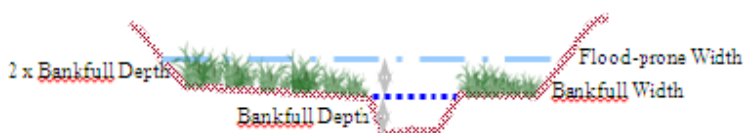

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)?

Comments: Entrenchment ratio does not apply. The in-line impoundments attenuate flood waters by slowing the water and allowing it to spread out, similar to a floodplain. A culvert at the downstream end restricts flood flows. The degree that the inline ponds slow the water down is considered to be similar to the 25-75% of shrub cover category.

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: The in-line ponds provide both short and long-term surface water storage.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating [H=high, M=moderate, or L=low])

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%		
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No	
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L	
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L	

Comments: The in-line ponds are flooded and the AA contains a culvert at the downstream end which restricts flow.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of <u>wetland</u> streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial	Seasonal / Intermittent	Temporary / Ephemeral
>= 65%	1H	.9H	.7M
35-64%	.7M	.6M	.5M
35%	.3L	.2L	.1L

Comments: The main species on the streambanks is creeping meadow-foxtail, a rhizomatous species with a plant stability rating of 6. The NRCS considers this species to be well suited for erosion control and streambank stabilization.

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) **Vegetated Upland Buffer (VUB):** Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference?

X If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.70M

Comments: The AA has a vegetated buffer and restricted outlet at the downstream end.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
- ☐ Springs or seeps are known or observed
- ☐ Vegetation growing during dormant season/drought
- ☐ Wetland occurs at the toe of a natural slope
- ☐ AA permanently flooded during drought periods
- ☐ Wetland contains an outlet, but no inlet
- ☐ Shallow water table and the site is saturated to the surface
- ☐ Other:

ii. Recharge Indicators

- ☒ Permeable substrate present without underlying impeding layer
- ☐ Wetland contains inlet but no outlet
- ☐ Stream is a known 'losing' stream; discharge volume decreases
- ☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: The ponds provide opportunity for groundwater recharge.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
	rare	common	abundant	rare	common	abundant	rare	common	abundant
Estimated relative abundance (#11)	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: This type of wetland is abundant in the watershed. The high structural diversity rating adds to its moderate rating.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ☒ (if 'Yes' continue with the evaluation; if 'No' then mark **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ☐ Educational/scientific study; ☒ Consumptive rec.; ☒ Non-consumptive rec.; ☐ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: This site is privately owned, but the use of the site by waterfowl and raptors make it of potential interest to birders. Fisherman may also be interested in fishing the ponds.

General Site Notes
This site has the potential to offer educational and/or recreational opportunities.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-03 (W-03a (Pond on south side))

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.00	1	0.00	
B. MT Natural Heritage Program Species Habitat	L	0.00	1	0.00	
C. General Wildlife Habitat	M	0.70	1	0.56	
D. General Fish Habitat	L	0.30	1	0.24	
E. Flood Attenuation	H	0.90	1	0.72	*
F. Short and Long Term Surface Water Storage	H	0.80	1	0.64	*
G. Sediment/Nutrient/Toxicant Removal	M	0.70	1	0.56	*
H. Sediment/Shoreline Stabilization	H	1.00	1	0.80	
I. Production Export/Food Chain Support	M	0.70	1	0.56	*
J. Groundwater Discharge/Recharge	H	1.00	1	0.80	
K. Uniqueness	M	0.40	1	0.32	
L. Recreation/Education Potential (bonus points)	L	0.05	1	0.04	
Totals:		6.55	11.00	5.24	
Percent of Possible Score			60%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☐ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☐ "Low" rating for Uniqueness; **and**
☒ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☐ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: III

Summary Comments: Category III wetland. The in-line ponds provide a high level of functionality for the flood attenuation, short/long term water storage, and toxicant removal functions. The open water is attractive to a lot of wildlife and so the production export function is considered to be a prominent function in this AA.

MDT Montana Wetland Assessment Form (revised March 2008)

1. Project Name: Stone Creek - North
2. MDT Project #: STPP49-1(25)9 **Control #:** 7931000
3. Evaluation Date: 09/18/2023 **4. Evaluator(s):** R. McEldowney **5. Wetlands/Site #(s):** AA-04 (W-03b (N of Hwy))
6. Wetland Location(s): i. Legal: T5S,R7W,33 **Latitude/Longitude:**
ii. Approx. Stationing or Mileposts: 12.72
iii. Watershed: 10020002
Watershed Name, County: Upper Missouri, Beaverhead

7. a. Evaluating Agency: Confluence Consulting

b. Purpose of Evaluation:

1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:

8. Wetland size: 0.500 acres (estimated)

9. Assessment area (AA): 0.500 acres (estimated)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
R	EM	E	SI	50.00
R	UB	E	PP	50.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. Estimated relative abundance: (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)

ABUNDANT

12. General condition of AA:

i. Disturbance: (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): AA has been channelized into an irrigation ditch downstream from the highway.

ii. Prominent noxious, aquatic nuisance, & other exotic vegetation species: Reed canarygrass, Canada thistle

iii. Provide brief descriptive summary of AA and surrounding land use/habitat: AA has been modified into a ditch for agricultural use. Surrounding landscape is dry rolling hills. Water is perennial in the AA, but the creek goes dry further downstream in Browns Ditch.

13. Structural Diversity: (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PEM

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

- i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat
- Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)**

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP report, 2015 special status plant survey

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

- i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat
- Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)**

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP report, 2015 special status plant survey

14C. General Wildlife Habitat Rating:

- i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☐ few or no wildlife observations during peak use periods
- ☒ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☐ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☐ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other in terms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: AA offers little value to wildlife.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is "correctable" such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark NA and proceed to 14E.)

Type of Fishery: Cold Water (CW) X Warm Water (WW) Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA: Suspected that rainbow trout and brown trout are likely stocked in the upstream pond on the south side of the highway. Fish entrainment is possible, but no fish were observed during the site visit.

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed "Probable Impaired Uses" including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? X If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? If yes, add 0.1 to the adjusted score in i or **ii**a.

iii. Final Score and Rating: 0.3L **Comments:** NWW-02 is converted to irrigation use. Fish use is likely impaired by the hanging culvert at the upstream end.

14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark NA and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched – B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User's Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

20 /


Flood-prone width

2 =

Bankfull width

10.00

Entrenchment ratio (ER)

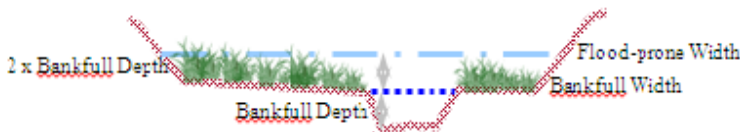

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? **Comments:** The channel is able to flood out of its banks even though it has been straightened for irrigation.

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: Ponds upstream of the AA likely reduce frequency of flooding in the AA.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for “probable causes” related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%		
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No	
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L	
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L	

Comments: Wetland has the potential to filter out sediments/nutrients/toxicants from the surrounding agricultural fields.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of wetland streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial		Temporary / Ephemeral
>= 65%	1H		.7M
35-64%	.7M		.5M
35%	.3L		.1L

Comments: Reed canarygrass is the dominant species along the streambank and has a root stability index of 9.

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = “absent” [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) Vegetated Upland Buffer (VUB): Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference? **X** If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.40M

Comments: The vegetated upland buffer around the AA increases the score for this function.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
- ☐ Springs or seeps are known or observed
- ☐ Vegetation growing during dormant season/drought
- ☐ Wetland occurs at the toe of a natural slope
- ☐ AA permanently flooded during drought periods
- ☐ Wetland contains an outlet, but no inlet
- ☐ Shallow water table and the site is saturated to the surface
- ☐ Other:

ii. Recharge Indicators

- ☐ Permeable substrate present without underlying impeding layer
- ☐ Wetland contains inlet but no outlet
- ☐ Stream is a known 'losing' stream; discharge volume decreases
- ☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands <u>FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM</u>			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: Insufficient data available to assess this function.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
	rare	common	abundant	rare	common	abundant	rare	common	abundant
Estimated relative abundance (#11)									
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: This type of wetland is abundant in the watershed.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ____ (if 'Yes' continue with the evaluation; if 'No' then mark **X** **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ____ Educational/scientific study; ____ Consumptive rec.; ____ Non-consumptive rec.; ____ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: The AA's small size and low habitat complexity make this an unsuitable site for recreation or education.

General Site Notes

AA is a relatively simplistic, highly disturbed small creek.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-04 (W-03b (N of Hwy))

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.00	1	0.00	
B. MT Natural Heritage Program Species Habitat	L	0.00	1	0.00	
C. General Wildlife Habitat	L	0.20	1	0.10	
D. General Fish Habitat	L	0.30	1	0.10	
E. Flood Attenuation	M	0.50	1	0.25	*
F. Short and Long Term Surface Water Storage	L	0.30	1	0.15	
G. Sediment/Nutrient/Toxicant Removal	M	0.70	1	0.35	*
H. Sediment/Shoreline Stabilization	H	1.00	1	0.50	*
I. Production Export/Food Chain Support	M	0.40	1	0.20	*
J. Groundwater Discharge/Recharge	NA				
K. Uniqueness	L	0.10	1	0.05	
L. Recreation/Education Potential (bonus points)	NA				
Totals:		3.50	10.00	1.70	
Percent of Possible Score			35%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☐ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☒ "Low" rating for Uniqueness; **and**
☒ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☒ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: IV

Summary Comments: Category IV wetland. The ability of this creek to flood out of its banks increases the functionality of flood flow attenuation and toxicant removal functions. Similarly, the presence of perennial water plays a big influence in the AA's ability to export energy and supports the local food chain.

MDT Montana Wetland Assessment Form (revised March 2008)

1. **Project Name:** Stone Creek - North
 2. **MDT Project #:** STPP49-1(25)9 **Control #:** 7931000
 3. **Evaluation Date:** 09/18/2023 4. **Evaluator(s):** R. McElowney 5. **Wetlands/Site #(s):** AA-05 (W-07)
 6. **Wetland Location(s): i. Legal:** T5S,R7W,22 **Latitude/Longitude:**
 ii. **Approx. Stationing or Mileposts:** 14.7
 iii. **Watershed:** 10020002
Watershed Name, County: Upper Missouri, Madison

7. **a. Evaluating Agency:** Confluence Consulting

b. Purpose of Evaluation:

1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:

8. **Wetland size:** 0.010 acres (estimated)

9. **Assessment area (AA):** 0.010 acres (estimated)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
R	EM	NA	SI	50.00
R	SS	NA	SI	50.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. **Estimated relative abundance:** (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)
 ABUNDANT

12. General condition of AA:

i. **Disturbance:** (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): Parking lot and highway surround the AA.

ii. **Prominent noxious, aquatic nuisance, & other exotic vegetation species:** Canada thistle, houndstongue

iii. **Provide brief descriptive summary of AA and surrounding land use/habitat:** AA is a portion of the Beaverhead River floodplain that has been isolated by roads and a parking lot. It is connected to the river via alluvial groundwater.

13. **Structural Diversity:** (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PEM, PSS

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP, 2015 Special status plant survey

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP, 2015 Special status plant survey

14C. General Wildlife Habitat Rating:

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☒ few or no wildlife observations during peak use periods
- ☒ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☐ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☐ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other interms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: Small wetland of little value to wildlife.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is "correctable" such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark **X NA** and proceed to 14E.)

Type of Fishery: Cold Water (CW) ☐ Warm Water (WW) ☐ Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA:

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed "Probable Impaired Uses" including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? ☐ If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? ☐ If yes, add 0.1 to the adjusted score in i or iia.

iii. Final Score and Rating: NA **Comments:** NA


14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark **X NA** and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched - B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User's Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

$$\frac{\text{Flood-prone width}}{\text{Bankfull width}} = \text{Entrenchment ratio (ER)}$$

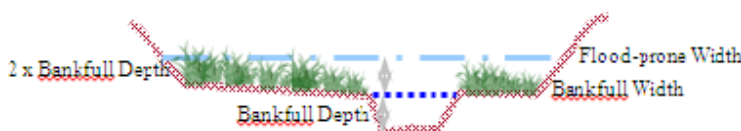

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? ☐ **Comments:** NA

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: Wetland may occasionally flood or pond as a result of precipitation events.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating [H=high, M=moderate, or L=low])

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%		
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No	
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L	
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L	

Comments: Surrounding land use (parking lot) has the potential to deliver high levels of sediments and compounds by precipitation events and overland flow.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, X NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of wetland streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial	Seasonal / Intermittent	Temporary / Ephemeral
>= 65%	1H	.9H	.7M
35-64%	.7M	.6M	.5M
35%	.3L	.2L	.1L

Comments: NA

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) **Vegetated Upland Buffer (VUB):** Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference?

If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.30L

Comments: AA is surrounded by parking lot and lacks a vegetated upland buffer. The AA has a subsurface connection to the alluvial aquifer.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
- ☐ Springs or seeps are known or observed
- ☐ Vegetation growing during dormant season/drought
- ☐ Wetland occurs at the toe of a natural slope
- ☐ AA permanently flooded during drought periods
- ☐ Wetland contains an outlet, but no inlet
- ☒ Shallow water table and the site is saturated to the surface
- ☐ Other:

ii. Recharge Indicators

- ☐ Permeable substrate present without underlying impeding layer
- ☐ Wetland contains inlet but no outlet
- ☐ Stream is a known 'losing' stream; discharge volume decreases
- ☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: AA demonstrates saturation during the growing season.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
Estimated relative abundance (#11)	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: Wetland type is abundant in the watershed.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ____ (if 'Yes' continue with the evaluation; if 'No' then mark **X** **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ____ Educational/scientific study; ____ Consumptive rec.; ____ Non-consumptive rec.;
____ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: The AA has little to no recreational or educational value.

General Site Notes
Very small, highly disturbed, and isolated wetland.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-05 (W-07)

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.00	1	0.00	
B. MT Natural Heritage Program Species Habitat	L	0.00	1	0.00	
C. General Wildlife Habitat	L	0.20	1	0.00	
D. General Fish Habitat	NA				
E. Flood Attenuation	NA				
F. Short and Long Term Surface Water Storage	L	0.20	1	0.00	*
G. Sediment/Nutrient/Toxicant Removal	M	0.50	1	0.01	*
H. Sediment/Shoreline Stabilization	NA				
I. Production Export/Food Chain Support	L	0.30	1	0.00	*
J. Groundwater Discharge/Recharge	M	0.70	1	0.01	*
K. Uniqueness	L	0.10	1	0.00	
L. Recreation/Education Potential (bonus points)	NA				
Totals:		2.00	8.00	0.02	
Percent of Possible Score			25%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☐ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☒ "Low" rating for Uniqueness; **and**
☒ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☒ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: IV

Summary Comments: Category IV wetland. Very low functionality for any functions. The closed contour means that it has higher potential value for surface water storage and to act as a sink for nutrients and pollutants. The site is supported by groundwater, making it a prominent function, and the site is accessible to birds, making production export one of its more important functions.

MDT Montana Wetland Assessment Form (revised March 2008)

1. Project Name: Stone Creek - North
2. MDT Project #: STPP49-1(25)9 **Control #:** 7931000
3. Evaluation Date: 09/18/2023 **4. Evaluator(s):** R. McEldowney
5. Wetlands/Site #(s): AA-06 (W-06, W-08)
6. Wetland Location(s): i. Legal: T5S,R7W,22
Latitude/Longitude:
ii. Approx. Stationing or Mileposts: 14.15-14.64, 14.68-14.82
iii. Watershed: 10020002
Watershed Name, County: Upper Missouri, Madison

7. a. Evaluating Agency: Confluence Consulting

b. Purpose of Evaluation:

1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:

8. Wetland size: 115.000 acres (estimated)

9. Assessment area (AA): 130.000 acres (estimated)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
D	AB	E	PP	2.00
R	EM	NA	SI	68.00
R	SS	NA	SI	20.00
R	UB	NA	PP	10.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. Estimated relative abundance: (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)
COMMON

12. General condition of AA:

i. Disturbance: (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): AA is along the Beaverhead River on both sides of the highway. These areas are primarily managed for grazing.

ii. Prominent noxious, aquatic nuisance, & other exotic vegetation species: Canada thistle, houndstongue

iii. Provide brief descriptive summary of AA and surrounding land use/habitat: A PSS/PEM wetland on the banks and floodplain of the Beaverhead River. The AA extends a half mile up and downstream of the bridge over the the Beaverhead River (using stream miles), and includes a portion of the constructed wetland on the south side of the floodplain, west of the bridge. Surrounding land use is haying and livestock use with some minimal residential structures. The primary manmade disturbances are associated with the road and grazing.

13. Structural Diversity: (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PEM, PSS, and Aquatic bed.

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species)

Secondary habitat (list species)

Incidental habitat (list species)

Spiranthes diluvialis(S)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): Spiranthes diluvialis occurs in the area. A plant survey conducted in 2015 documented no Spiranthes diluvialis within the AA.

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species)

Secondary habitat (list species)

Incidental habitat (list species)

Monarch Butterfly(S) - S2S3

Golden Eagle(D) - S2S3

Great Blue Heron(D) - S2S3

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP element occurrence report. 2015 special status plant survey.

14C. General Wildlife Habitat Rating:

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☐ few or no wildlife observations during peak use periods
- ☐ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☒ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☒ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other in terms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: PEM and PSS wetland types provide structural diversity for wildlife habitat.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is “correctable” such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark NA and proceed to 14E.)

Type of Fishery: Cold Water (CW) X Warm Water (WW) Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA: MFWP

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed “Probable Impaired Uses” including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? X If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? If yes, add 0.1 to the adjusted score in i or **ii**a.

iii. Final Score and Rating: 0.6M **Comments:** Impaired for aquatic life.

14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark NA and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched – B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User’s Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

125 /


54 =

2.32

Flood-prone width

Bankfull width

Entrenchment ratio (ER)

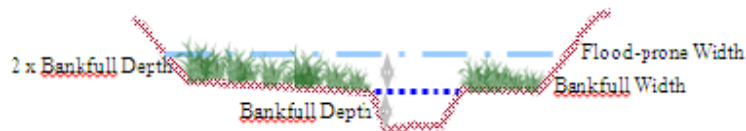

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? **Comments:** Wetlands are subject to flooding by the Beaverhead River. Where normally this system may be scored as 0.5M because of the lower scrub-shrub component, the large area and relatively flat topography of the site reduces water velocity and merits an increase of score as indicated in the rating table. The shrubs in the wetland help to slow and spread out floodwaters.

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: Fringe wetlands along the river channel are frequently subjected to flooding by the dam controlled flow.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.			
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%	
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L

Comments: Beaverhead River is listed as impaired for aquatic life due to too much sediment and high temperatures.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of wetland streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial	Seasonal / Intermittent	Temporary / Ephemeral
>= 65%	1H	.9H	.7M
35-64%	.7M	.6M	.5M
35%	.3L	.2L	.1L

Comments: Dominant vegetation is reed canarygrass and willow species. Root stability index for this community is 7-10. While eroding banks exist, they are <35% of the banks in the AA.

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) Vegetated Upland Buffer (VUB): Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference? If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.80H

Comments: More than 25% of the land adjacent to the AA is not vegetated or is mowed/hayed. Therefore, the modified vegetated buffer rating is not applied.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
- ☐ Springs or seeps are known or observed
- ☐ Vegetation growing during dormant season/drought
- ☐ Wetland occurs at the toe of a natural slope
- ☐ AA permanently flooded during drought periods
- ☐ Wetland contains an outlet, but no inlet
- ☐ Shallow water table and the site is saturated to the surface
- ☐ Other:

ii. Recharge Indicators

- ☒ Permeable substrate present without underlying impeding layer
- ☐ Wetland contains inlet but no outlet
- ☐ Stream is a known 'losing' stream; discharge volume decreases
- ☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands <u>FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM</u>			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: Permeable substrate allows for water table recharge.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
	rare	common	abundant	rare	common	abundant	rare	common	abundant
Estimated relative abundance (#11)									
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: Wetland types are common in the watershed.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) X (if 'Yes' continue with the evaluation; if 'No' then mark NA and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: Educational/scientific study; X Consumptive rec.; X Non-consumptive rec.;
 Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: The AA includes the Beaverhead River, which provides public access within the ordinary high water marks. Additionally, the AA includes an informal fishing access site adjacent to the bridge that spans the Beaverhead River.

General Site Notes

The AA is regularly grazed but is managed such that it continues to provides a high level of functionality for several functions.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-06 (W-06, W-08)

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.10	1	13.00	
B. MT Natural Heritage Program Species Habitat	H	0.90	1	117.00	*
C. General Wildlife Habitat	M	0.70	1	91.00	
D. General Fish Habitat	M	0.60	1	78.00	
E. Flood Attenuation	H	0.80	1	104.00	*
F. Short and Long Term Surface Water Storage	H	0.90	1	117.00	*
G. Sediment/Nutrient/Toxicant Removal	M	0.40	1	52.00	
H. Sediment/Shoreline Stabilization	H	1.00	1	130.00	
I. Production Export/Food Chain Support	H	0.80	1	104.00	*
J. Groundwater Discharge/Recharge	H	1.00	1	130.00	
K. Uniqueness	M	0.50	1	65.00	
L. Recreation/Education Potential (bonus points)	H	0.20	1	26.00	
Totals:		7.90	11.00	1,027.00	
Percent of Possible Score			72%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☒ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☐ "Low" rating for Uniqueness; **and**
☐ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☐ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: II

Summary Comments: The large size and relatively flat topography make the flood attenuation and surface water storage functions especially prominent functions of this AA. By its very nature as a floodplain, the AA also provides a high level of functionality for production export/food chain support.

MDT Montana Wetland Assessment Form (revised March 2008)

1. **Project Name:** Stone Creek - North
 2. **MDT Project #:** STPP49-1(25)9 **Control #:** 7931000
 3. **Evaluation Date:** 09/18/2023 4. **Evaluator(s):** R. McElowney 5. **Wetlands/Site #(s):** AA-07 (W-09)
 6. **Wetland Location(s): i. Legal:** T5S,R7W,22 **Latitude/Longitude:**
 ii. **Approx. Stationing or Mileposts:** 14.82
 iii. **Watershed:** 10020002
Watershed Name, County: Upper Missouri, Madison

7. **a. Evaluating Agency:** Confluence Consulting

b. Purpose of Evaluation:

1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:

8. **Wetland size:** 3.700 acres (measured)

9. **Assessment area (AA):** 3.700 acres (measured)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
R	EM	NA	SI	100.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. **Estimated relative abundance:** (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)
 COMMON

12. General condition of AA:

i. **Disturbance:** (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): AA is grazed by cattle.

ii. **Prominent noxious, aquatic nuisance, & other exotic vegetation species:** NA

iii. **Provide brief descriptive summary of AA and surrounding land use/habitat:** AA is a historic oxbow with seasonal hydrology within the floodplain of the Beaverhead River. It is supported by alluvial groundwater provided by the Beaverhead River. Surrounding land uses include the highway corridor, grazing lands, and undisturbed wetlands.

13. **Structural Diversity:** (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: Emergent wetland grazed by sheep and cattle.

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species)

Secondary habitat (list species)

Incidental habitat (list species)

Spiranthes diluvialis(S)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): Emergent wetlands in the Beaverhead watershed are potential suitable habitat for *Spiranthes diluvialis*. None observed during 2015 survey. MTNHP, 2015 Special Status Plant Survey.

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species)

Secondary habitat (list species)

Incidental habitat (list species)

Great Blue Heron (S3)(S) - S2S3

Golden Eagle (S3)(D) - S2S3

Spotted Bat (S3)(S) - S2S3

Annual Indian Paintbrush(S) - S2S3

Monarch Butterfly(S) - S2S3

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): Surveys were conducted in 2015 for SOC: *Eleocharis rostellata*, *Primula incana*, and *Castilleja exilis*. No individuals were documented within the AA.

14C. General Wildlife Habitat Rating:

Sources: MTNHP, 2015 Special status plant survey

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☒ few or no wildlife observations during peak use periods
- ☒ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☐ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☐ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other in terms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional		Moderate	
Substantial	1E		.8H	
Moderate	.9H		.5M	
Minimal	.6M		.4M	

Comments: Little evidence of wildlife was observed during peak use periods.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is "correctable" such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark **X NA** and proceed to 14E.)

Type of Fishery: Cold Water (CW) ☐ Warm Water (WW) ☐ Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA:

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed "Probable Impaired Uses" including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? ☐ If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? ☐ If yes, add 0.1 to the adjusted score in i or iia.

iii. Final Score and Rating: NA **Comments:** NA


14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark **X NA** and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched - B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User's Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

$$\frac{\text{Flood-prone width}}{\text{Bankfull width}} = \text{Entrenchment ratio (ER)}$$

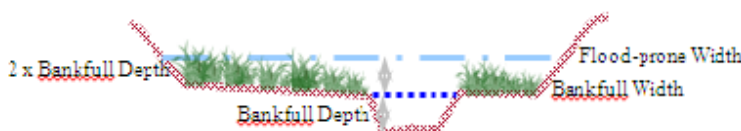

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2		Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type	

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? ☐ **Comments:** NA

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: Site is groundwater supported and is likely saturated or shallowly inundated on a frequent basis.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating [H=high, M=moderate, or L=low])

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%		
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No	
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L	
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L	

Comments: The AA is a focal area for livestock and is heavily grazed all year. Wetlands resultingly receive high nutrient input.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, X NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of wetland streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial	Seasonal / Intermittent	Temporary / Ephemeral
>= 65%	1H	.9H	.7M
35-64%	.7M	.6M	.5M
35%	.3L	.2L	.1L

Comments: NA

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) **Vegetated Upland Buffer (VUB):** Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference?

If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.60M

Comments: The AA and surrounding buffer is grazed by livestock.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
- ☐ Springs or seeps are known or observed
- ☒ Vegetation growing during dormant season/drought
- ☐ Wetland occurs at the toe of a natural slope
- ☐ AA permanently flooded during drought periods
- ☐ Wetland contains an outlet, but no inlet
- ☐ Shallow water table and the site is saturated to the surface
- ☐ Other:

ii. Recharge Indicators

- ☐ Permeable substrate present without underlying impeding layer
- ☐ Wetland contains inlet but no outlet
- ☐ Stream is a known 'losing' stream; discharge volume decreases
- ☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: The oxbow supports green vegetation during dry spells.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
Estimated relative abundance (#11)	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: Wetland type is common in the watershed.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ____ (if 'Yes' continue with the evaluation; if 'No' then mark **X** **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ____ Educational/scientific study; ____ Consumptive rec.; ____ Non-consumptive rec.;
____ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: This AA has little to no potential for education or recreation.

General Site Notes
This is a fairly heavily grazed AA.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-07 (W-09)

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.10	1	0.37	
B. MT Natural Heritage Program Species Habitat	M	0.70	1	2.59	*
C. General Wildlife Habitat	M	0.40	1	1.48	*
D. General Fish Habitat	NA				
E. Flood Attenuation	NA				
F. Short and Long Term Surface Water Storage	L	0.30	1	1.11	
G. Sediment/Nutrient/Toxicant Removal	M	0.40	1	1.48	*
H. Sediment/Shoreline Stabilization	NA				
I. Production Export/Food Chain Support	M	0.60	1	2.22	*
J. Groundwater Discharge/Recharge	M	0.70	1	2.59	
K. Uniqueness	L	0.30	1	1.11	
L. Recreation/Education Potential (bonus points)	NA				
Totals:		3.50	8.00	12.95	
Percent of Possible Score			44%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☐ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☒ "Low" rating for Uniqueness; **and**
☐ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☐ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: III

Summary Comments: As a Category III wetland this AA is providing a moderate level of functionality. The sensitive species habitat function is prominent because of the documented use by Great Blue Herons. It is also provides attractive feeding areas for migrating waterfowl and other wading birds, such as Sand Hill Cranes. The site is heavily used by livestock and as such the AA provides an important sink for excess nutrients in the animal waste. Production export is considered a prominent function primarily because of the feeding opportunities provided to migrating waterfowl and wading birds.

MDT Montana Wetland Assessment Form (revised March 2008)

1. **Project Name:** Stone Creek - North
 2. **MDT Project #:** STPP49-1(25)9 **Control #:** 7931000
 3. **Evaluation Date:** 09/18/2023 4. **Evaluator(s):** R. McElowney 5. **Wetlands/Site #(s):** AA-08 (W-10, W-11, W-12)
 6. **Wetland Location(s): i. Legal:** T5S,R7W,22 **Latitude/Longitude:**
 ii. **Approx. Stationing or Mileposts:** 14.91, 14.93-15.09, 15.02-15.31
 iii. **Watershed:** 10020002
Watershed Name, County: Upper Missouri, Madison

7. **a. Evaluating Agency:** Confluence Consulting

b. Purpose of Evaluation:

1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:

8. **Wetland size:** 3.600 acres (estimated)

9. **Assessment area (AA):** 5.000 acres (estimated)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
R	EM	NA	SI	67.00
R	SS	NA	SI	5.00
R	UB	E	PP	28.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. **Estimated relative abundance:** (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)
 COMMON

12. General condition of AA:

i. **Disturbance:** (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): Highway on east side of the AA, Beaverhead Rock Road, channelized Co-op Ditch.

ii. **Prominent noxious, aquatic nuisance, & other exotic vegetation species:** Canada thistle, houndstongue, common reed

iii. **Provide brief descriptive summary of AA and surrounding land use/habitat:** Wetlands in the Beaverhead River floodplain, with the Co-op Ditch running through them on the west side. The Co-op Ditch has been straightened, receives routine maintenance, and receives warm spring input from several locations along this portion of it. The surrounding floodplain area has been cleared and is used for livestock and hay production. The prominent cliffs and hills to the west are dry and presumably also used for grazing livestock.

13. **Structural Diversity:** (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PEM, PSS

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species) **Secondary habitat (list species)** **Incidental habitat (list species)**
 Spiranthes diluvialis(S)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): Wetlands in the Beaverhead watershed are potential suitable habitat for Spiranthes diluvialis, which are known to occur in this area. None found during the 2015 survey.
MTNHP report, 2015 Special Status Plant Survey

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species) **Secondary habitat (list species)** **Incidental habitat (list species)**
 Castilleja exilis (S2)(D) - S2S3
 Eleocharis rostellata (S3)(D) - S2S3

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): 2015 Special Status Plant Survey

14C. General Wildlife Habitat Rating:

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☐ few or no wildlife observations during peak use periods
- ☐ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☒ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☒ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other in terms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: Moderate wildlife activity observed.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is "correctable" such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark **X NA** and proceed to 14E.)

Type of Fishery: Cold Water (CW) ☐ Warm Water (WW) ☒ Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA: MFWP

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed "Probable Impaired Uses" including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? ☐ If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? ☐ If yes, add 0.1 to the adjusted score in i or iia.

iii. Final Score and Rating: NA

Comments: The Co-op ditch is a warm water creek that supports tropical aquarium fish and common carp. It is unlikely that other fish species could persist in the channel because of the warm water, not to mention the numerous culverts and headgates, etc. Fish use is undesirable from a management perspective because the ditch is used for irrigation.


14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark **NA** and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched - B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User's Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

90 / 30 = **3.00**
Flood-prone width Bankfull width Entrenchment ratio (ER)

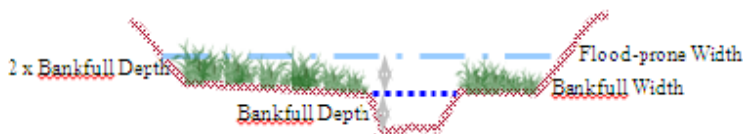

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? ☐

Comments: The flood-prone width is variable along the AA. The Co-op ditch is able to flood out of its banks, similar to the slightly entrenched category.

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: Flood flows are controlled by a diversion structure from the Beaverhead River upstream of the AA. Wetlands also flood from groundwater.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating [H=high, M=moderate, or L=low])

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%		
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No	
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L	
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L	

Comments: Co-op Ditch has a culvert at the downstream end of the AA, which restricts flow.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of <u>wetland</u> streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial	Seasonal / Intermittent	Temporary / Ephemeral
>= 65%	1H	.9H	.7M
35-64%	.7M	.6M	.5M
35%	.3L	.2L	.1L

Comments: Cattail, bulrush, willows, and common reed are the dominant species along the Co-op Ditch. The root stability index for these communities ranges from 7-10.

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) **Vegetated Upland Buffer (VUB):** Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference?

If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.70M

Comments: Area around AA is grazed, or disturbed such that a vegetated buffer is absent for more than 25% of its perimeter.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

<input type="checkbox"/>	The AA is a slope wetland
<input checked="" type="checkbox"/>	Springs or seeps are known or observed
<input checked="" type="checkbox"/>	Vegetation growing during dormant season/drought
<input type="checkbox"/>	Wetland occurs at the toe of a natural slope
<input type="checkbox"/>	AA permanently flooded during drought periods
<input type="checkbox"/>	Wetland contains an outlet, but no inlet
<input checked="" type="checkbox"/>	Shallow water table and the site is saturated to the surface
<input checked="" type="checkbox"/>	Other: seeps are present at the wetland edge

ii. Recharge Indicators

<input type="checkbox"/>	Permeable substrate present without underlying impeding layer
<input type="checkbox"/>	Wetland contains inlet but no outlet
<input type="checkbox"/>	Stream is a known 'losing' stream; discharge volume decreases
<input type="checkbox"/>	Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: Numerous seeps observed on the west side of the Co-op Ditch near the north end. Warm springs were also observed in the Co-op Ditch in the northern portion of the AA below the cliffs.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
Estimated relative abundance (#11)	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: Warm springs occur in the Co-op Ditch.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) X (if 'Yes' continue with the evaluation; if 'No' then mark NA and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: X Educational/scientific study; Consumptive rec.; X Non-consumptive rec.;
 Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: The site is easily accessible from the highway, and with landowner permission, could be used for education about sensitive species that the AA supports.

General Site Notes
Common reed is dominant in the middle portion of the AA, east of the Co-op Ditch.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-08 (W-10, W-11, W-12)

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.10	1	0.50	
B. MT Natural Heritage Program Species Habitat	H	0.90	1	4.50	*
C. General Wildlife Habitat	M	0.70	1	3.50	
D. General Fish Habitat	NA				
E. Flood Attenuation	M	0.50	1	2.50	
F. Short and Long Term Surface Water Storage	M	0.60	1	3.00	
G. Sediment/Nutrient/Toxicant Removal	M	0.50	1	2.50	
H. Sediment/Shoreline Stabilization	H	1.00	1	5.00	
I. Production Export/Food Chain Support	M	0.70	1	3.50	*
J. Groundwater Discharge/Recharge	H	1.00	1	5.00	*
K. Uniqueness	H	0.80	1	4.00	*
L. Recreation/Education Potential (bonus points)	L	0.05	1	0.25	
Totals:		6.85	10.00	34.25	
Percent of Possible Score			69%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☒ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☐ "Low" rating for Uniqueness; **and**
☐ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☐ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: II

Summary Comments: The presence of warm springs makes the Uniqueness function more prominent. Similarly, the presence of Annual Indian Paintbrush raises the importance of the sensitive species function, and the presence of seeps and springs emphasizes the groundwater function. The site is highly productive and provides a substantial contribution to the local food chain.

MDT Montana Wetland Assessment Form (revised March 2008)

1. Project Name: Stone Creek - North
2. MDT Project #: STPP49-1(25)9 **Control #:** 7931000
3. Evaluation Date: 09/18/2023 **4. Evaluator(s):** R. McEldowney **5. Wetlands/Site #(s):** AA-09 (W-13)
6. Wetland Location(s): i. Legal: T5S,R7W,22 **Latitude/Longitude:**
ii. Approx. Stationing or Mileposts: 14.86-15.44
iii. Watershed: 10020002
Watershed Name, County: Upper Missouri, Madison

7. a. Evaluating Agency: Confluence Consulting

b. Purpose of Evaluation:

1. ☒ Wetlands potentially affected by MDT project
2. ☐ Mitigation wetlands; pre-construction
3. ☐ Mitigation wetlands; post-construction
4. ☐ Other:

8. Wetland size: 85.000 acres (estimated)

9. Assessment area (AA): 85.000 acres (estimated)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
R	AB	NA	PP	0.20
R	EM	NA	SI	99.00
R	UB	NA	PP	0.40

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. Estimated relative abundance: (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)

RARE

12. General condition of AA:

i. Disturbance: (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): The highway runs along the west side of the AA. The AA and surrounding areas are grazed by cattle and sheep. Alfalfa fields occur along a portion of the AA's northern boundary. Common reedgrass has invaded the area surrounding the warm spring.

ii. Prominent noxious, aquatic nuisance, & other exotic vegetation species: Common reedgrass

iii. Provide brief descriptive summary of AA and surrounding land use/habitat: The AA is a wet meadow in the extended floodplain of the Beaverhead River. Based on the presence of organic soils and being supported by groundwater, much of the wet meadow is considered to be a fen. The wet meadow is punctuated by old meander scars dominated by hardstem bulrush. The AA also contains a warm spring near the highway that maintains a constant flow and water temperature throughout the year. The area around the warm spring is largely dominated by giant reedgrass. The land uses in the surround area are agricultural, livestock grazing, and grass hay production.

13. Structural Diversity: (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PAB, PEM

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species)

Secondary habitat (list species)

Incidental habitat (list species)

Spiranthes diluvialis(S)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): Wetlands in the Beaverhead watershed are potential suitable habitat for Spiranthes diluvialis. None observed during 2015 survey. MTNHP report, 2015 Special Status Plant Species Survey.

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species)

Secondary habitat (list species)

Incidental habitat (list species)

Eleocharis rostellata (S3)(D) - S2S3

Golden Eagle(S) - S2S3

Castilleja exilis (S2)(D) - S2S3

Great Blue Heron(S) - S2S3

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): Beaked spikerush and annual indian paintbrush documented in the AA during 2015 survey.

14C. General Wildlife Habitat Rating:

Sources: MTNHP element occurrence report, 2015 Special Status Plant Species Survey.

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☐ few or no wildlife observations during peak use periods
- ☐ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☐ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☒ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other in terms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional		High	
Substantial	1E		.9H	
Moderate	.9H		.7M	
Minimal	.6M		.4M	

Comments: Moderate wildlife use observed in AA.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is “correctable” such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark X **NA** and proceed to 14E.)

Type of Fishery: Cold Water (CW) Warm Water (WW) X Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA: MFWP

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed “Probable Impaired Uses” including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? If yes, add 0.1 to the adjusted score in i or **ii**a.


iii. Final Score and Rating: NA **Comments:** Tropical aquarium fish were released into the warm spring and continue to persist. Their presence is not needed nor desired.

14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark X **NA** and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched – B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User’s Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

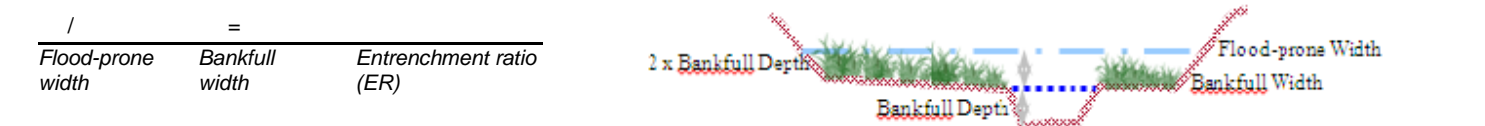

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding **AND** are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? **Comments:** The warm springs provides a constant flow rate and does not flood.

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: Wetlands in the AA experience periodic flooding/ponding from groundwater.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for “probable causes” related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.			
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%	
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L

Comments: AA has the potential to receive large loads of nutrients from onsite grazing practices.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of wetland streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial		Temporary / Ephemeral
>= 65%	1H		.7M
35-64%	.7M		.5M
35%	.3L		.1L

Comments: The warm creek provides constant flow. Common reedgrass is the dominant species along much of the channel and has a root stability index of 9.

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = “absent” [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) **Vegetated Upland Buffer (VUB):** Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference? If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: **0.80H**

Comments: Perennial waterway and emergent wetlands support aquatic and terrestrial life. There is no vegetated buffer along much of the the west side of the AA - the highway occurs along that side.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
- ☒ Springs or seeps are known or observed
- ☐ Vegetation growing during dormant season/drought
- ☐ Wetland occurs at the toe of a natural slope
- ☐ AA permanently flooded during drought periods
- ☐ Wetland contains an outlet, but no inlet
- ☐ Shallow water table and the site is saturated to the surface
- ☐ Other:

ii. Recharge Indicators

- ☐ Permeable substrate present without underlying impeding layer
- ☐ Wetland contains inlet but no outlet
- ☐ Stream is a known 'losing' stream; discharge volume decreases
- ☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands <u>FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM</u>			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: AA includes a warm spring.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
<i>Estimated relative abundance (#11)</i>	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: AA contains a large fen complex and a warm spring.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ☒ (if 'Yes' continue with the evaluation; if 'No' then mark ☐ **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ☒ Educational/scientific study; ☐ Consumptive rec.; ☒ Non-consumptive rec.; ☐ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: AA includes a warm spring and fen wetland and has the potential to offer educational/scientific study value with coordination from private landowners. Moderate wildlife use and habitat provides potential non-consumptive recreational activities (e.g. bird watching).

General Site Notes

The AA is comprised of rolling terrain that used to be part of the active floodplain of the Beaverhead River. The warm spring used to drain to the east, toward the Beaverhead River, but was rerouted to the north for agricultural use.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-09 (W-13)

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.10	1	8.50	
B. MT Natural Heritage Program Species Habitat	H	0.90	1	76.50	*
C. General Wildlife Habitat	M	0.50	1	42.50	
D. General Fish Habitat	NA				
E. Flood Attenuation	NA				
F. Short and Long Term Surface Water Storage	H	0.80	1	68.00	
G. Sediment/Nutrient/Toxicant Removal	M	0.40	1	34.00	
H. Sediment/Shoreline Stabilization	H	1.00	1	85.00	
I. Production Export/Food Chain Support	H	0.80	1	68.00	*
J. Groundwater Discharge/Recharge	H	1.00	1	85.00	*
K. Uniqueness	H	0.90	1	76.50	*
L. Recreation/Education Potential (bonus points)	L	0.05	1	4.25	
Totals:		6.45	9.00	548.25	
Percent of Possible Score			72%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☒ Score of .9 functional point for Uniqueness; **or**
☒ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☐ "Low" rating for Uniqueness; **and**
☐ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☐ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: II

Summary Comments: The warm spring and fen complex make the uniqueness function prominent, and the warm spring makes the groundwater function prominent. The occurrences of sensitive plant species makes the the sensitive species function prominent. The large size and moderate level of disturbance make the production export function prominent.

MDT Montana Wetland Assessment Form (revised March 2008)

1. **Project Name:** Stone Creek - North
2. **MDT Project #:** STPP49-1(25)9
3. **Evaluation Date:** 09/18/2023
4. **Evaluator(s):** R. McEldowney
5. **Wetlands/Site #(s):** AA-10 (W-14 (N end of Co-op Ditch))
6. **Wetland Location(s): i. Legal:** T5N,R7W,15, 22
- ii. **Approx. Stationing or Mileposts:** 15.31-15.58
- iii. **Watershed:** 10020002
- Watershed Name, County:** Upper Missouri, Madison
7. **a. Evaluating Agency:** Confluence Consulting
- b. Purpose of Evaluation:**
1. ☒ Wetlands potentially affected by MDT project
 2. ☐ Mitigation wetlands; pre-construction
 3. ☐ Mitigation wetlands; post-construction
 4. ☐ Other:
8. **Wetland size:** 3.000 acres (estimated)
9. **Assessment area (AA):** 3.000 acres (estimated)

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
R	EM	NA	SI	10.00
R	SS	NA	SI	10.00
R	UB	NA	PP	80.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (R), Depressional (D), Slope (S), Mineral Soil Flats (MSF), Organic Soil Flats (OSF), Lacustrine Fringe (LF);

Cowardin Classes: Rock Bottom (RB), Unconsolidated bottom (UB), Aquatic Bed (AB), Unconsolidated Shore (US), Moss-lichen Wetland (ML), Emergent Wetland (EM), Scrub-Shrub Wetland (SS), Forested Wetland (FO)

Modifiers: Excavated (E), Impounded (I), Diked (D), Partly Drained (PD), Farmed (F), Artificial (A)

Water Regimes: Permanent / Perennial (PP), Seasonal / Intermittent (SI), Temporary / Ephemeral (TE)

11. **Estimated relative abundance:** (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)

ABUNDANT

12. General condition of AA:

- i. **Disturbance:** (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (ANVS) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): Co-op Ditch with narrow fringe wetland that is adjacent to the highway and also cuts through an alfalfa field. The Co-op Ditch is regularly cleaned of sediment deposits.

ii. **Prominent noxious, aquatic nuisance, & other exotic vegetation species:** Reed canarygrass, creeping meadow-foxtail.

iii. **Provide brief descriptive summary of AA and surrounding land use/habitat:** Narrow fringe wetland adjacent to the Co-op Ditch. Traverses along the eastern edge of an alfalfa field.

13. **Structural Diversity:** (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PEM, PSS

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

- i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat
- Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)**

ii. Rating (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): No suitable habitat for *Spiranthes diluvialis*. MTNHP Report.

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

- i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat
- Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)**

ii. Rating (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP Report.

14C. General Wildlife Habitat Rating:

i. Evidence of overall wildlife use in the AA (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☒ few or no wildlife observations during peak use periods
- ☐ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☐ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☐ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other in terms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. Rating (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: Provides little value to wildlife. The steep sides of the ditch make it virtually inaccessible to terrestrial species other than birds.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is “correctable” such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark X **NA** and proceed to 14E.)

Type of Fishery: Cold Water (CW) Warm Water (WW) X Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA: MFWP

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed “Probable Impaired Uses” including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? If yes, add 0.1 to the adjusted score in i or **ii**a.

iii. Final Score and Rating: NA **Comments:** No fish were observed in this section of the Co-op Ditch. It is likely cut off from use by the warm springs and culvert upstream of this AA. Fish use is undesired in this ditch because it is used for irrigation.

14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark **NA** and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched – B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User’s Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

25.5 /

Flood-prone width

25 =

Bankfull width

1.02

Entrenchment ratio (ER)

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? **Comments:** Co-op Ditch is fed by the Beaverhead River. In this AA the ditch is highly entrenched with steep vertical bank.

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: This section of the Co-op Ditch does not appear to flood regularly. Because of the steep sides and narrow fringe there is little extra storage capacity in the wetlands.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.			
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%	
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L

Comments: This section of the Co-op Ditch does not appear to flood regularly. Vegetative cover is reduced because of ditch cleaning.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of wetland streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial		Seasonal / Intermittent
>= 65%	1H		.9H
35-64%	.7M		.6M
35%	.3L		.2L

Comments: Common species along the banks includes *Salix exigua*, *Phalaris arundinacea*, and *Carex* spp with root stability indices ranging from 7-10. However the wetland fringe is intermittent along the steep banks.

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) **Vegetated Upland Buffer (VUB):** Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference? NA If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: **0.30L**

Comments: This section of the Co-op Ditch in AA provides low potential to export food and nutrients. Much of the buffer area is cropped/mowed.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
- ☐ Springs or seeps are known or observed
- ☐ Vegetation growing during dormant season/drought
- ☐ Wetland occurs at the toe of a natural slope
- ☐ AA permanently flooded during drought periods
- ☐ Wetland contains an outlet, but no inlet
- ☐ Shallow water table and the site is saturated to the surface
- ☒ Other: seeps are present at the wetland edge

ii. Recharge Indicators

- ☐ Permeable substrate present without underlying impeding layer
- ☐ Wetland contains inlet but no outlet
- ☐ Stream is a known 'losing' stream; discharge volume decreases
- ☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands <u>FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM</u>			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: This section of the Co-op Ditch has no known springs or seeps. The bottom of the ditch is clayey, reducing the possibility of the ditch recharging the local aquifer.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: No warm springs occur in this section of the Co-op Ditch.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ____ (if 'Yes' continue with the evaluation; if 'No' then mark **X** **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ☒ Educational/scientific study; ☐ Consumptive rec.; ☐ Non-consumptive rec.;
☐ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: No potential for recreation or education in this AA.

General Site Notes

This is a very small, highly disturbed/manipulated AA.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-10 (W-14 (N end of Co-op Ditch))

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.00	1	0.00	
B. MT Natural Heritage Program Species Habitat	L	0.00	1	0.00	
C. General Wildlife Habitat	L	0.10	1	0.30	
D. General Fish Habitat	NA				
E. Flood Attenuation	L	0.10	1	0.30	
F. Short and Long Term Surface Water Storage	L	0.20	1	0.60	
G. Sediment/Nutrient/Toxicant Removal	M	0.40	1	1.20	
H. Sediment/Shoreline Stabilization	L	0.30	1	0.90	
I. Production Export/Food Chain Support	L	0.30	1	0.90	
J. Groundwater Discharge/Recharge	L	0.10	1	0.30	
K. Uniqueness	L	0.10	1	0.30	
L. Recreation/Education Potential (bonus points)	NA				
Totals:		1.60	10.00	4.80	
Percent of Possible Score			16%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☐ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☒ "Low" rating for Uniqueness; **and**
☒ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☒ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: IV

Summary Comments: No functions are prominent in this small, low functioning Category IV wetland.

MDT Montana Wetland Assessment Form (revised March 2008)

1. Project Name: Stone Creek - North 3. Evaluation Date: 09/18/2023 4. Evaluator(s): R. McElowney 6. Wetland Location(s): i. Legal: T5S,R7W,15 ii. Approx. Stationing or Mileposts: 15.38-16.4 iii. Watershed: 10020002 Watershed Name, County: Upper Missouri, Madison	2. MDT Project #: STPP49-1(25)9 Control #: 7931000 5. Wetlands/Site #(s): AA-11 (W-15 (Warm Springs Ditch)) Latitude/Longitude:
7. a. Evaluating Agency: Confluence Consulting b. Purpose of Evaluation: 1. <input checked="" type="checkbox"/> Wetlands potentially affected by MDT project 2. <input type="checkbox"/> Mitigation wetlands; pre-construction 3. <input type="checkbox"/> Mitigation wetlands; post-construction 4. <input type="checkbox"/> Other:	
8. Wetland size: 2.150 acres (measured) 9. Assessment area (AA): 2.150 acres (measured)	

10. Classification of Wetland and Aquatic Habitats in AA

HGM Class (Brinson)	Class (Cowardin)	Modifier (Cowardin)	Water Regime	% of AA
R	EM	NA	SI	67.00
R	SS	NA	SI	3.00
R	UB	E	PP	30.00

Abbreviations: (see manual for definitions)

HGM Classes: Riverine (**R**), Depressional (**D**), Slope (**S**), Mineral Soil Flats (**MSF**), Organic Soil Flats (**OSF**), Lacustrine Fringe (**LF**);

Cowardin Classes: Rock Bottom (**RB**), Unconsolidated bottom (**UB**), Aquatic Bed (**AB**), Unconsolidated Shore (**US**), Moss-lichen Wetland (**ML**), Emergent Wetland (**EM**), Scrub-Shrub Wetland (**SS**), Forested Wetland (**FO**)

Modifiers: Excavated (**E**), Impounded (**I**), Diked (**D**), Partly Drained (**PD**), Farmed (**F**), Artificial (**A**)

Water Regimes: Permanent / Perennial (**PP**), Seasonal / Intermittent (**SI**), Temporary / Ephemeral (**TE**)

11. Estimated relative abundance: (of similarly classified sites within the same Major Montana Watershed Basin, see definitions)
ABUNDANT

12. General condition of AA:

i. Disturbance: (use matrix below to determine [circle] appropriate response – see instructions for Montana-listed noxious weed and aquatic nuisance vegetation species (**ANVS**) list)

Conditions within AA	Predominant conditions adjacent to (within 500 feet of) AA		
	Managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or buildings; and noxious weed or ANVS cover is >=15%.	Land not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to minor clearing; contains few roads or buildings; noxious weed or ANVS cover is <= 30%.	Land cultivated or heavily grazed or logged; subject to substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.
AA occurs and is managed in predominantly natural state; is not grazed, hayed, logged, or otherwise converted; does not contain roads or occupied buildings; and noxious weed or ANVS cover is <= 15%.	low disturbance	low disturbance	moderate disturbance
AA not cultivated, but may be moderately grazed or hayed or selectively logged; or has been subject to relatively minor clearing, fill placement, or hydrological alteration; contains few roads or buildings; noxious weed or ANVS cover is <=	moderate disturbance	moderate disturbance	high disturbance
AA cultivated or heavily grazed or logged; subject to relatively substantial fill placement, grading, clearing, or hydrological alteration; high road or building density; or noxious weed or ANVS cover is > 30%.	high disturbance	high disturbance	high disturbance

Comments: (types of disturbance, intensity, season, etc.): Highway occurs west of AA, alfalfa and wheat fields occur east of AA.

ii. Prominent noxious, aquatic nuisance, & other exotic vegetation species: Reed canarygrass, creeping meadow-foxtail

iii. Provide brief descriptive summary of AA and surrounding land use/habitat: Warm Springs Ditch and the associated narrow fringe along it. Some areas are slightly wider where a headgate or other irrigation infrastructure backs water up. The AA is sandwiched between the highway to the west and cropped fields to the east.

13. Structural Diversity: (based on number of "Cowardin" **vegetated** classes present [do not include unvegetated classes], see #10 above)

Existing # of "Cowardin" Vegetated Classes in AA	Initial Rating	Is current management preventing (passive) existence of additional vegetated classes?		Modified Rating
>= 3 (or 2 if 1 is forested) classes	H	NA	NA	NA
2 (or 1 if forested) classes	M	NA	NA	NA
1 class, but not a monoculture	M	<-- NO	YES -->	L
1 class, monoculture (1 species comprises >= 90% of total cover)	L	NA	NA	NA

Comments: PEM, PSS

SECTION PERTAINING to FUNCTIONS & VALUES ASSESSMENT

14A. Habitat for Federally Listed or Proposed Threatened or Endangered Plants or Animals:

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions): No usable habitat

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
Functional Points and Rating	1H	.9H	.8M	.7M	.3L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP Report, 2015 Special Status Plant Survey

14B. Habitat for plant or animals rated S1, S2, or S3 by the Montana Natural Heritage Program: (not including species listed in 14A above)

i. AA is Documented (D) or Suspected (S) to contain (circle one based on definitions contained in instructions):

Primary or critical habitat (list species) Secondary habitat (list species) Incidental habitat (list species)

Great Blue Heron(S) - S2S3

ii. **Rating** (use the conclusions from i above and the matrix below to arrive at [circle] the functional points and rating)

Highest Habitat Level	doc/primary	sus/primary	doc/secondary	sus/secondary	doc/incidental	sus/incidental	None
S1 Species: Functional Points and Rating	1H	.8H	.7M	.6M	.2L	.1L	0L
S2 and S3 Species: Functional Points and Rating	.9H	.7M	.6M	.5M	.2L	.1L	0L

Sources for documented use (e.g. observations, records, etc): MTNHP Report, 2015 Special Status Plant Survey.

14C. General Wildlife Habitat Rating:

i. **Evidence of overall wildlife use in the AA** (circle substantial, moderate, or low based on supporting evidence):

Substantial (based on any of the following [check]):

- ☐ observations of abundant wildlife #s or high species diversity (during any period)
- ☐ abundant wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ presence of extremely limiting habitat features not available in the surrounding area
- ☐ interviews with local biologists with knowledge of the AA

Minimal (based on any of the following [check]):

- ☐ few or no wildlife observations during peak use periods
- ☒ little to no wildlife sign
- ☐ sparse adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

Moderate (based on any of the following [check]):

- ☐ observations of scattered wildlife groups or individuals or relatively few species during peak periods
- ☐ common occurrence of wildlife sign such as scat, tracks, nest structures, game trails, etc.
- ☐ adequate adjacent upland food sources
- ☐ interviews with local biologists with knowledge of the AA

ii. **Wildlife habitat features** (Working from top to bottom, circle appropriate AA attributes in matrix to arrive at rating. Structural diversity is from #13. For class cover to be considered evenly distributed, the most and least prevalent vegetated classes must be within 20% of each other interms of their percent composition of the AA (see #10). Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; T/E = temporary/ephemeral; and A = absent [see instructions for further definitions of these terms])

Structural diversity (see #13)	High								Moderate								Low			
Class cover distribution (all vegetated classes)	Even				Uneven				Even				Uneven				Even			
Duration of surface water in >=10% of AA	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A	P/P	S/I	T/E	A
Low disturbance at AA (see #12i)	E	E	E	H	E	E	H	H	E	H	H	M	E	H	M	M	E	H	M	M
Moderate disturbance at AA (see #12i)	H	H	H	H	H	H	H	M	H	H	M	M	H	M	M	L	H	M	L	L
High disturbance at AA (see #12i)	M	M	M	L	M	M	L	L	M	M	L	L	M	L	L	L	L	L	L	L

iii. **Rating** (use the conclusions from i and ii above and the matrix below to arrive at [circle] the functional points and rating)

Evidence of wildlife use (i)	Wildlife habitat features rating (ii)			
	Exceptional	High	Moderate	Moderate
Substantial	1E	.9H	.8H	.7M
Moderate	.9H	.7M	.5M	.3L
Minimal	.6M	.4M	.2L	.1L

Comments: Little sign or evidence of wildlife activity observed.

14D. General Fish Habitat Rating: (Assess this function if the AA is used by fish or the existing situation is "correctable" such that the AA could be used by fish [i.e., fish use is precluded by perched culvert or other barrier, etc.]. If the AA is not used by fish, fish use is not restorable due to habitat constraints, or is not desired from a management perspective [such as fish entrapped in a canal], then mark **X NA** and proceed to 14E.)

Type of Fishery: Cold Water (CW) ☐ Warm Water (WW) ☒ Use the CW or WW guidelines in the user manual to complete the matrix

i. Habitat Quality and Known / Suspected Fish Species in AA (use matrix to arrive at [circle] the functional points and rating)

Duration of surface water in AA	Permanent / Perennial						Seasonal / Intermittent						Temporary / Ephemeral					
Aquatic hiding / resting / escape cover	Optimal		Adequate		Poor		Optimal		Adequate		Poor		Optimal		Adequate		Poor	
Thermal cover optimal / suboptimal	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S	O	S
FWP Tier I fish species	1E	.9H	.8H	.7M	.6M	.5M	.9H	.8H	.7M	.6M	.5M	.4M	.7M	.6M	.5M	.4M	.3L	.2L
FWP Tier II or Native Game fish species	.9H	.8H	.7M	.6M	.5M	.5M	.8H	.7M	.6M	.5M	.4M	.4M	.6M	.5M	.4M	.3L	.2L	.2L
FWP Tier III or Introduced Game fish	.8H	.7M	.6M	.5M	.5M	.4M	.7M	.6M	.5M	.4M	.4M	.3L	.5M	.4M	.3L	.2L	.2L	.1L
FWP Non-Game Tier IV or No fish species	.5M	.5M	.5M	.4M	.4M	.3L	.4M	.4M	.4M	.3L	.3L	.2L	.2L	.2L	.2L	.1L	.1L	.1L

Sources used for identifying fish sp. potentially found in AA: MFWP

ii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1)

a) Is fish use of the AA significantly reduced by a culvert, dike, or other man-made structure or activity or is the waterbody included on the current final MDEQ list of waterbodies in need of TMDL development with listed "Probable Impaired Uses" including cold or warm water fishery or aquatic life support, or do aquatic nuisance plant or animal species (see Appendix E) occur in fish habitat? ☐ If yes, reduce score in i above by 0.1.

b) Does the AA contain a documented spawning area or other critical habitat feature (i.e., sanctuary pool, upwelling area, etc.- specify in comments) for native fish or introduced game fish? ☐ If yes, add 0.1 to the adjusted score in i or iia.

iii. Final Score and Rating: NA

Comments: Tropical aquarium fish have been documented in the AA upstream of this AA and may also occur in this AA. However, fish are not desired in this irrigation ditch. The warm water precludes use by many native species.


14E. Flood Attenuation: (Applies only to wetlands subject to flooding via in-channel or overbank flow. If wetlands in AA are not flooded from in-channel or overbank flow, mark **X NA** and proceed to 14F.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Estimated or Calculated Entrenchment (Rosgen 1994, 1996)	Slightly entrenched - C, D, E stream types			Moderately entrenched - B stream type			Entrenched-A, F, G stream types		
% of flooded wetland classified as forested and/or scrub/shrub	75%	25-75%	<25%	75%	25-75%	<25%	75%	25-75%	<25%
AA contains no outlet or restricted outlet	1H	.9H	.6M	.8H	.7M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.8H	.5M	.7M	.6M	.4M	.3L	.2L	.1L

Entrenchment ratio (ER) estimation – see User's Manual for additional guidance. Entrenchment ratio = (flood-prone width)/(bankfull width) Flood-prone width = estimated horizontal projection of where 2 x maximum bankfull depth elevation intersects the floodplain on each side of the stream.

$$\frac{\text{Flood-prone width}}{\text{Bankfull width}} = \text{Entrenchment ratio (ER)}$$

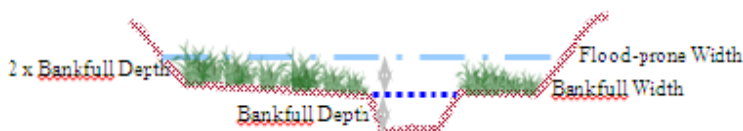

Slightly Entrenched ER = >2.2			Moderately Entrenched ER = 1.41 – 2.2	Entrenched ER = 1.0 – 1.4		
C stream type	D stream type	E stream type	B stream type	A stream type	F stream type	G stream type

ii. Are ≥10 acres of wetland in the AA subject to flooding AND are man-made features which may be significantly damaged by floods located within 0.5 mile downstream of the AA (circle)? ☐ **Comments:** The Warm Springs Ditch is known for being extremely reliable in its discharge and temperature. The site does not flood.

14F. Short and Long Term Surface Water Storage: (Applies to wetlands that flood or pond from overbank or in-channel flow, precipitation, upland surface flow, or groundwater flow. If no wetlands in the AA are subject to flooding or ponding, NA and proceed to 14G.)

i. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Abbreviations for surface water durations are as follows: P/P = permanent/perennial; S/I = seasonal/intermittent; and T/E = temporary/ephemeral [see instructions for further definitions of these terms].)

Estimated maximum acre feet of water contained in wetlands within the AA that are subject to periodic flooding or ponding	>5 acre feet			1.1 to 5 acre feet			<=1 acre foot		
Duration of surface water at wetlands within the AA	P/P	S/I	T/E	P/P	S/I	T/E	P/P	S/I	T/E
Wetlands in AA flood or pond >= 5 out of 10 years	1H	.9H	.8H	.8H	.6M	.5M	.4M	.3L	.2L
Wetlands in AA flood or pond < 5 out of 10 years	.9H	.8H	.7M	.7M	.5M	.4M	.3L	.2L	.1L

Comments: The emergent wetland is a narrow fringe along the channel with some larger pockets that can pond when subject to infrequent flooding.

14G. Sediment/Nutrient/Toxicant Retention and Removal: (Applies to wetlands with potential to receive sediments, nutrients, or toxicants through influx of surface or ground water or direct input. If no wetlands in the AA are subject to such input, NA and proceed to 14H.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating [H=high, M=moderate, or L=low])

Sediment, nutrient, and toxicant input levels within AA	AA receives or surrounding land use with potential to deliver levels of sediments, nutrients, or compounds at levels such that other functions are not substantially impaired. Minor sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.				Waterbody on MDEQ list of waterbodies in need of TMDL development for "probable causes" related to sediment, nutrients, or toxicants or AA receives or surrounding land use with potential to deliver high levels of sediments, nutrients, or compounds such that other functions are substantially impaired. Major sedimentation, sources of nutrients or toxicants, or signs of eutrophication present.			
% cover of wetland vegetation in AA	>= 70%		< 70%		>= 70%		< 70%	
Evidence of flooding / ponding in AA	Yes	No	Yes	No	Yes	No	Yes	No
AA contains no or restricted outlet	1H	.8H	.7M	.5M	.5M	.4M	.3L	.2L
AA contains unrestricted outlet	.9H	.7M	.6M	.4M	.4M	.3L	.2L	.1L

Comments: Cropped fields surrounding the AA have potential to deliver high nutrients to the wetlands.

14H Sediment/Shoreline Stabilization: (Applies only if AA occurs on or within the banks or a river, stream, or other natural or man-made drainage, or on the shoreline of a standing water body which is subject to wave action. If 14H does not apply, NA and proceed to 14I.)

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

% Cover of <u>wetland</u> streambank or shoreline by species with stability ratings of >=6 (see Appendix F).	Duration of surface water adjacent to rooted vegetation		
	Permanent / Perennial	Seasonal / Intermittent	Temporary / Ephemeral
>= 65%	1H	.9H	.7M
35-64%	.7M	.6M	.5M
35%	.3L	.2L	.1L

Comments: AA includes the Warm Springs Ditch. Dominant vegetation along the streambank is reed canarygrass with a root stability indices of 9.

14I. Production Export/Food Chain Support:

i. Level of Biological Activity (synthesis of wildlife and fish habitat ratings [circle])

General Fish Habitat Rating (14D.iii.)	General Wildlife Habitat Rating (14C.iii.)		
	E/H	M	L
E/H	H	H	M
M	H	M	M
L	M	M	L
N/A	H	M	L

ii. Rating (Working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating. Factor A = acreage of vegetated wetland component in the AA; Factor B = level of biological activity rating from above (14I.i.); Factor C = whether or not the AA contains a surface or subsurface outlet; the final three rows pertain to duration of surface water in the AA, where P/P, S/I, and T/E are as previously defined, and A = "absent" [see instructions for further definitions of these terms].)

A	Vegetated component >5 acres						Vegetated component 1-5 acres						Vegetated component < 1 acre					
B	High		Moderate		Low		High		Moderate		Low		High		Moderate		Low	
C	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
P/P	1H	.7M	.8H	.5M	.6M	.4M	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.6M	.6M	.4M	.3L	.2L
S/I	.9H	.6M	.7M	.4M	.5M	.3L	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.5M	.5M	.3L	.3L	.2L
T/E/A	.8H	.5M	.6M	.3L	.4M	.2L	.7M	.4M	.5M	.2L	.3L	.1L	.6M	.4M	.4M	.2L	.2L	.1L

iii. Modified Rating (NOTE: Modified score cannot exceed 1 or be less than 0.1.) Vegetated Upland Buffer (VUB): Area with >= 30% plant cover, = 15% noxious weed or ANVS cover, and that is not subjected to periodic mechanical mowing or clearing (unless for weed control).

a) Is there an average >= 50 foot-wide vegetated upland buffer around >= 75% of the AA circumference?

If yes, add 0.1 to the score in ii above.

iv. Final Score and Rating: 0.50M

Comments: Surrounding agricultural fields are subject to haying/mowing.

14J. Groundwater Discharge/Recharge: (check the appropriate indicators in i & ii below)

i. Discharge Indicators

- ☐ The AA is a slope wetland
☐ Springs or seeps are known or observed
☐ Vegetation growing during dormant season/drought
☐ Wetland occurs at the toe of a natural slope
☐ AA permanently flooded during drought periods
☐ Wetland contains an outlet, but no inlet
☐ Shallow water table and the site is saturated to the surface
☐ Other:

ii. Recharge Indicators

- ☐ Permeable substrate present without underlying impeding layer
☐ Wetland contains inlet but no outlet
☐ Stream is a known 'losing' stream; discharge volume decreases
☐ Other:

iii. Rating (use the information from i and ii above and the table below to arrive at [circle] the functional points and rating)

Criteria	Duration of saturation at AA Wetlands FROM GROUNDWATER DISCHARGE OR WITH WATER THAT IS RECHARGING THE GROUNDWATER SYSTEM			
	P/P	S/I	T	None
Groundwater Discharge or Recharge	1H	.7M	.4M	.1L
Insufficient Data/Information	N/A			

Comments: This section of the Warm Springs ditch has no known springs or seeps.

14K. Uniqueness:

i. Rating (working from top to bottom, use the matrix below to arrive at [circle] the functional points and rating)

Replacement potential	AA contains fen, bog, warm springs or mature (>80 yr-old) forested wetland or plant association listed as "S1" by the MTNHP			AA does not contain previously cited rare types and structural diversity (#13) is high or contains plant association listed as "S2" by the MTNHP			AA does not contain previously cited rare types or associations and structural diversity (#13) is low-moderate		
Estimated relative abundance (#11)	rare	common	abundant	rare	common	abundant	rare	common	abundant
Low disturbance at AA (#12i)	1H	.9H	.8H	.8H	.6M	.5M	.5M	.4M	.3L
Moderate disturbance at AA (#12i)	.9H	.8H	.7M	.7M	.5M	.4M	.4M	.3L	.2L
High disturbance at AA (#12i)	.8H	.7M	.6M	.6M	.4M	.3L	.3L	.2L	.1L

Comments: This wetland type is abundant in the watershed.

14L. Recreation/Education Potential: (affords "bonus" points if AA provides recreation or education opportunity)

i. Is the AA a known or potential rec./ed. site: (circle) ____ (if 'Yes' continue with the evaluation; if 'No' then mark **X** **NA** and proceed to the overall summary and rating page)

ii. Check categories that apply to the AA: ____ Educational/scientific study; ____ Consumptive rec.; ____ Non-consumptive rec.;
 ____ Other :

iii. Rating:

Known or Potential Recreation or Education Area	Known	Potential
Public ownership or public easement with general public access (no permission required)	.2H	.15H
Private ownership with general public access (no permission required)	.15H	.1M
Private or public ownership without general public access, or requiring permission for public access	.1M	.05L

Comments: This AA has little to no potential for education or recreation.

General Site Notes
This is a low scoring Category III wetland dominated by introduced pasture grasses.

FUNCTION & VALUE SUMMARY & OVERALL RATING FOR WETLAND/SITE #(S): AA-11 (W-15 (Warm Springs Ditch))

Function & Value Variables	Rating	Actual Functional Points	Possible Functional Points	Functional Units: (Actual Points x Wetland Acreage)	Indicate the four most prominent functions with an asterisk (*)
A. Listed/Proposed T&E Species Habitat	L	0.00	1	0.00	
B. MT Natural Heritage Program Species Habitat	L	0.10	1	0.22	
C. General Wildlife Habitat	L	0.20	1	0.43	*
D. General Fish Habitat	NA				
E. Flood Attenuation	NA				
F. Short and Long Term Surface Water Storage	L	0.20	1	0.43	
G. Sediment/Nutrient/Toxicant Removal	M	0.40	1	0.86	*
H. Sediment/Shoreline Stabilization	H	1.00	1	2.15	*
I. Production Export/Food Chain Support	M	0.50	1	1.08	*
J. Groundwater Discharge/Recharge	NA				
K. Uniqueness	L	0.10	1	0.22	
L. Recreation/Education Potential (bonus points)	NA				
Totals:		2.50	8.00	5.39	
Percent of Possible Score			31%		

Category I Wetland: (must satisfy one of the following criteria; otherwise go to Category II)

- ☐ Score of 1 functional point for Listed/Proposed Threatened or Endangered Species; **or**
☐ Score of 1 functional point for Uniqueness; **or**
☐ Score of 1 functional point for Flood Attenuation and answer to Question 14E.ii is "yes"; **or**
☐ Percent of possible score > 80% (round to nearest whole #).

Category II Wetland: (Criteria for Category I not satisfied and meets any one of the following criteria; otherwise go to Category IV)

- ☐ Score of 1 functional point for MT Natural Heritage Program Species Habitat; **or**
☐ Score of .9 or 1 functional point for General Wildlife Habitat; **or**
☐ Score of .9 or 1 functional point for General Fish Habitat; **or**
☐ "High" to "Exceptional" ratings for **both** General Wildlife Habitat **and** General Fish/Aquatic Habitat; **or**
☐ Score of .9 functional point for Uniqueness; **or**
☐ Percent of possible score > 65% (round to nearest whole #).

Category III Wetland: (Criteria for Categories I, II, or IV not satisfied)

Category IV Wetland: (Criteria for Categories I or II are not satisfied and all of the following criteria are met; otherwise go to Category III)

- ☒ "Low" rating for Uniqueness; **and**
☐ Vegetated wetland component 1 acre (do not include upland vegetated buffer); **and**
☒ Percent of possible score 35% (round to nearest whole #).

OVERALL ANALYSIS AREA RATING: III

Summary Comments: The highest scoring functions are also the most prominent ones of this low functioning irrigation ditch AA.

Appendix C

Photographs

AQUATIC RESOURCE DELINEATION REPORT
Stone Creek – North
STPP 49-1(25)9
UPN 7931

Beaverhead and Madison Counties, Montana
December 2023

THIS PAGE INTENTIONALLY LEFT BLANK



Photo 1: Facing southwest towards sample point SP01a-u.



Photo 2: Facing southwest towards sample point SP01a-w.



Photo 3: Facing east towards sample point SP01b-u.



Photo 4: Facing north-northwest towards SP01b-w.



Photo 5: Facing east towards sample point SP02-u.



Photo 6: Facing southeast towards sample point SP02-w.



Photo 7: Facing west towards sample point SP03a-u.



Photo 8: Facing west towards sample point SP03a-w.

This cell intentionally left blank.



Photo 9: Facing south towards island where sample point SP03a-w (PFO) is located.



Photo 10: Facing south towards sample point SP03b-u.



Photo 11: Facing south towards sample point SP03b-w.



Photo 12: Facing north towards sample point SP04-u.



Photo 13: Facing north towards sample point SP04-w.



Photo 14: Facing north towards sample point SP05-u.

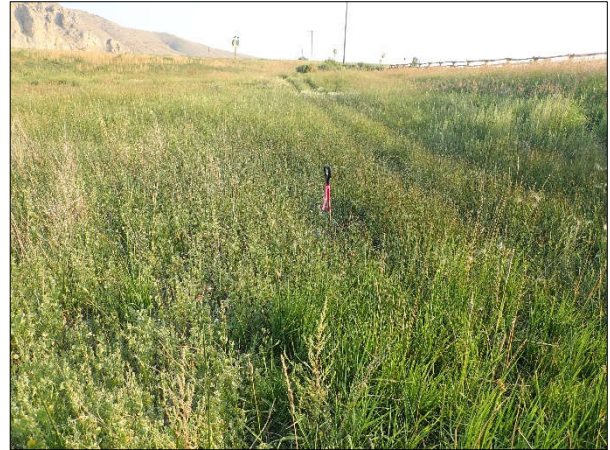


Photo 15: Facing north towards sample point SP05-w.

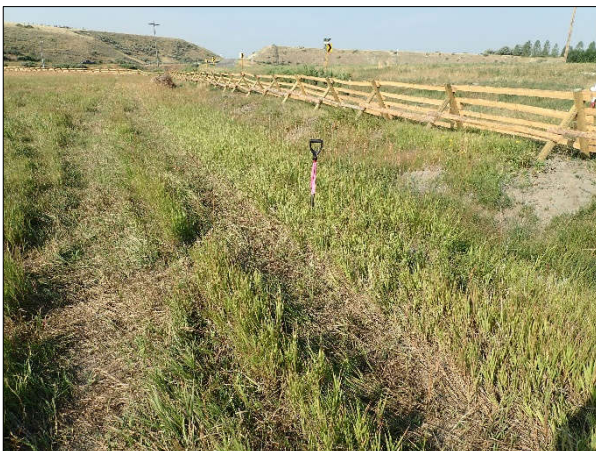


Photo 16: Facing west towards sample point SP06a-u.



Photo 17: Facing west towards sample point SP06a-w.



Photo 18: Facing south towards sample point SP06b-u.



Photo 19: Facing east towards sample point SP06b-w.

This cell intentionally left blank.



Photo 20: Facing south towards sample point SP06c-w.



Photo 21: Facing northeast towards sample point SP06d-u.



Photo 22: Facing east towards sample point SP06d-w.



Photo 23: Facing north towards sample point SP06e-u.



Photo 24: Facing north towards sample point SP06e-w.



Photo 25: Facing south towards sample point SP06f-u.



Photo 26: Facing south towards sample point SP06f-w.



Photo 27: Facing west towards sample point SP06g-u.



Photo 28: Facing southeast towards sample point SP06g-w.



Photo 29: Facing south towards sample point SP06h-u.



Photo 30: Facing south towards sample point SP06h-w.



Photo 31: Facing south towards sample point SP06i-u.



Photo 32: Facing south towards sample point SP06i-w.



Photo 33: Facing south towards sample point SP06j-u.



Photo 34: Facing northwest towards sample point SP06j-w.



Photo 35: Facing south towards sample point SP07-u.



Photo 36: Facing west towards sample point SP07-w.



Photo 37: Facing west towards sample point SP08a-u.



Photo 38: Facing west towards sample point SP08a-w.



Photo 39: Facing west towards sample point SP08b-u.



Photo 40: Facing west towards sample point SP08b-w.

This cell intentionally left blank.



Photo 41: Facing west towards sample point SP08c-w.



Photo 42: Facing south at sample point SP08d-u.

This cell intentionally left blank.



Photo 43: Facing west towards sample point SP09-u.



Photo 44: Facing south towards sample point SP09-w.



Photo 45: Facing west towards sample point SP010a-u.



Photo 46: Facing east towards sample point SP10a-w.



Photo 47: Facing south towards sample point SP10b-u.



Photo 48: Facing north towards sample point SP10b-w.



Photo 49: Facing southwest towards sample point SP10c-u.

This cell intentionally left blank.



Photo 50: Facing north at sample point SP11a-u.



Photo 51: Facing at sample point SP11a-w.



Photo 52: Facing southeast at sample point SP11b-u.

This cell intentionally left blank.



Photo 53: Facing north at sample point SP11c-u.

This cell intentionally left blank.



This cell intentionally left blank.

Photo 54: Facing north towards sample point SP11d-u.



Photo 55: Facing east towards sample point SP12a-u.



Photo 56: Facing north towards sample point SP12a-w.

This cell intentionally left blank.

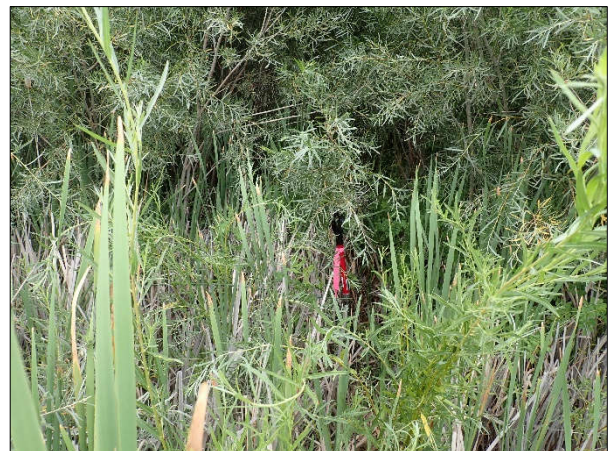


Photo 57: Facing north towards sample point SP12b-w.

This cell intentionally left blank.



Photo 58: Facing west towards sample point SP12c-w.



Photo 59: Facing south towards sample point SP12d-u.

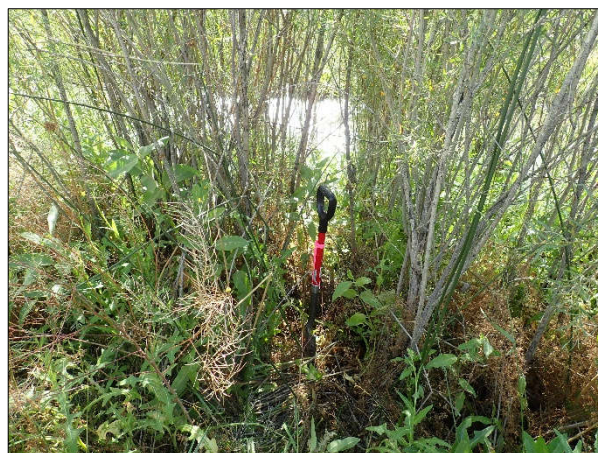


Photo 60: Facing west towards sample point SP12d-w.



Photo 61: Facing south towards sample point SP13a-u.

This cell intentionally left blank.



Photo 62: Facing south towards sample point SP13b-u.

This cell intentionally left blank.

This cell intentionally left blank.



Photo 63: Facing west towards sample point SP13c-w.

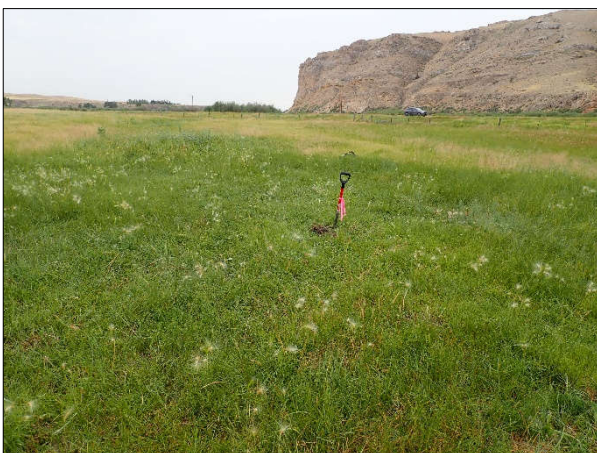


Photo 64: Facing south towards sample point SP13d-u.

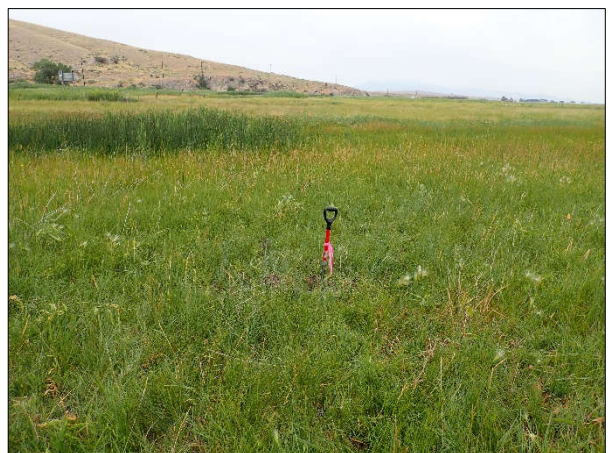


Photo 65: Facing north towards sample point SP13d-w.



Photo 66: Facing north towards sample point SP13e-u.



Photo 67: Facing north towards sample point SP13e-w.



Photo 68: Facing south towards sample point SP13f-u.



Photo 69: Facing south towards sample point SP13f-w.



Photo 70: Facing south towards sample point SP13g-u.



Photo 71: Facing southwest towards sample point SP13g-w.



Photo 72: Facing east towards sample point SP13h-u.



Photo 73: Facing east towards sample point SP13h-w.



Photo 74: Facing west towards sample point SP13i-u.

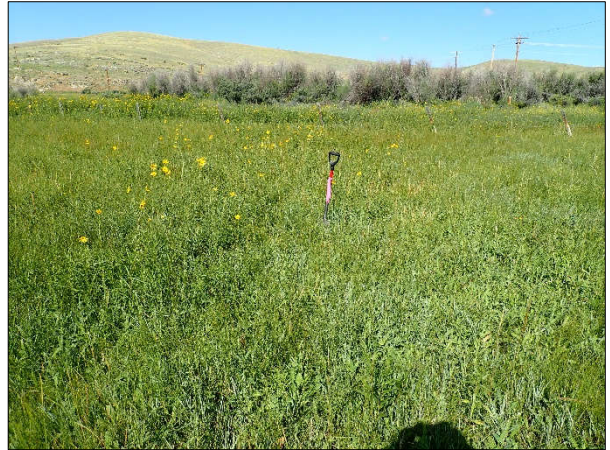


Photo 75: Facing west towards sample point SP13i-w.



Photo 76: Facing south towards sample point SP13j-u.



Photo 77: Facing east towards sample point SP13j-w.



This cell intentionally left blank.

Photo 78: Facing south towards sample point SP13k-u.



This cell intentionally left blank.

Photo 79: Facing northeast towards sample point SP13l-u.



Photo 80: Facing north towards sample point SP14a-u.



Photo 81: Facing west towards sample point SP14a-w.



Photo 82: Facing south towards sample point SP14b-u.



Photo 83: Facing south towards sample point SP14b-w.



Photo 84: Facing south towards sample point SP14c-u.



Photo 85: Facing south towards sample point SP14c-w.



Photo 86: Facing south towards sample point SP15a-u.



Photo 87: Facing north towards sample point SP15a-w.

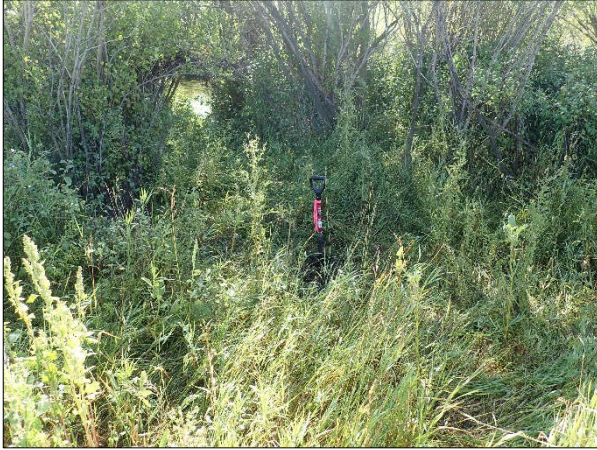


Photo 88: Facing east towards sample point SP15b-u.



Photo 89: Facing northeast towards sample point SP15b-w.



Photo 90: Facing south towards sample point SP15c-u.



Photo 91: Facing east towards sample point SP15c-w.



Photo 92: Facing south towards sample point SP15d-u.



Photo 93: Facing north towards sample point SP15d-w.



Photo 94: Facing south towards sample point SP15e-u.



Photo 95: Facing south towards sample point SP15e-w.



Photo 96: Facing north towards sample point SP15f-u.



Photo 97: Facing southeast towards sample point SP15f-w.



Photo 98: Facing north towards sample point SP15g-u.



Photo 99: Facing south towards sample point SP15g-w.



Photo 100: Facing south towards sample point SP15h-u.



Photo 101: Facing north towards sample point SP15h-w.



Photo 102: Facing south towards sample point SP15i-u.



Photo 103: Facing south towards sample point SP15i-w.



Photo 104: Facing west at Stone Creek (NWW-01) underneath bridge.

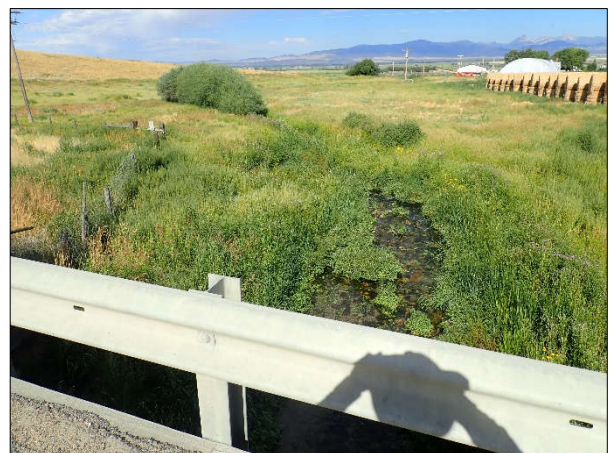


Photo 105: Facing downstream on west side of bridge over Stone Creek (NWW-01).



Photo 106: View to the south on west side of bridge over Stone Creek (NWW-01).



Photo 107: View to the north on east side of bridge over Stone Creek (NWW-01).



Photo 108: Unnamed spring creek (NWW-02/W03-a) is impounded south of highway.



Photo 109: Vegetated channel of unnamed spring creek (NWW-03/W03-b) north of highway.



Photo 110: Facing upstream at right bank of Beaverhead River (NWW-03) under bridge.



Photo 111: Facing north across river at left bank of Beaverhead River (NWW-03) under the bridge.



Photo 112: View of the upstream side (west) of Beaverhead River (NWW-03) crossing, facing south.

To be inserted

Photo 113: Facing downstream at Beaverhead River (NWW-03) bridge.

Photo 114: Facing upstream at Beaverhead River (NWW-03) bridge.



Photo 115: Facing north at Co-op Ditch (IR-01) to the west of highway.



Photo 116: Facing south at Co-op ditch (IR-01) on west side of canal.



Photo 117: Facing south (upstream) towards bridge over Co-op ditch (IR-01).



Photo 118: Facing north towards irrigation infrastructure on Co-op Ditch (IR-01).



Photo 119: Facing south (upstream) at Co-op Ditch (IR-01) from project boundary.



Photo 120: Facing south at Warm Springs Irrigation Ditch (IR-02).



Photo 121: Facing north at Warm Springs Irrigation Ditch (IR-02) at culvert adjacent to entrance to cropped field.



Photo 122: Facing south at Warm Springs Irrigation Ditch (IR-02) from northern project boundary.

